

SECTION AV

AUDIO VISUAL, NAVIGATION & TELEPHONE SYSTEM

CONTENTS

SERVICE INFORMATION	3	Removal and Installation of Rear Speaker	43	A
PRECAUTIONS	3	Removal and Installation of Tweeter	44	B
Precaution for Supplemental Restraint System (SRS) "AIR BAG" and "SEAT BELT PRE-TENSIONER"	3	Removal and Installation of Woofer and Woofer Amp (BOSE System)	44	C
Precaution for Battery Service	3	Removal and Installation of BOSE Speaker Amp....	45	D
PREPARATION	4	Removal and Installation of Microphone	45	E
Commercial Service Tool	4	Removal and Installation of Satellite Radio Tuner....	46	F
AUDIO	5	Removal and Installation of Satellite Radio Antenna	46	G
System Description	5	ANTENNA	47	H
Component Parts Location	7	System Description	47	I
Schematic / Base System	8	Wiring Diagram - M/ANT -	48	J
Wiring Diagram - AUDIO - / Base System	9	Location of Antenna	49	
Schematic / BOSE System	12	Removal and Installation of Antenna Amp	49	
Wiring Diagram - AUDIO - / BOSE System (Coupe Models)	13	Removal and Installation of Antenna	50	
Wiring Diagram - AUDIO - / BOSE System (Roadster Models)	22	Removal and Installation of Satellite Radio Antenna	50	AV
Terminal and Reference Value for Audio Unit / Base System	29	NAVIGATION SYSTEM	51	L
Terminal and Reference Value for Audio Unit / BOSE System	30	System Description	51	
Terminal and Reference Value for BOSE Speaker Amp	33	Component Description	52	M
Terminal and Reference Value for Woofer Amp	35	Component Parts Location	54	
Terminal and Reference Value for Satellite Radio Tuner	36	Schematic	55	N
Trouble Diagnosis	36	Wiring Diagram - NAVI -	56	
Power Supply Circuit Inspection	37	Wiring Diagram - COMM -	60	O
Steering Switch Does Not Operate	38	Terminal and Reference Value for NAVI Control Unit	62	
AudioPilot@Does Not Work	40	Terminal and Reference Value for Display Unit	64	P
Removal and Installation of Audio Unit (Base system)	41	Terminal and Reference Value for NAVI Switch	65	
Locking CD Auto Changer Mechanism (Audio unit of BOSE system)	42	Special Note for Trouble Diagnosis	66	
Removal and Installation of Audio Unit (BOSE system)	42	On Board Self-Diagnosis Function	66	
Removal and Installation of Door Speaker	43	Self-Diagnosis Mode	66	
		Confirmation/Adjustment Mode	68	
		All Images Are Not Displayed	73	
		Navigation System Is Not Operated by NAVI Switch	75	
		Tint Is Strange for the RGB Image	77	
		RGB Image Is Rolling	79	
		Voice Guidance Is Not Heard	79	
		Vehicle Mark Is Not Displayed Properly	82	

Example of Symptom Possible No Malfunction	82	Schematic	91
Removal and Installation of NAVI Control Unit	85	Wiring Diagram - H/PHONE -	92
Removal and Installation of GPS Antenna	85	Terminal and Reference Value for TEL Adapter	
Removal and Installation of NAVI Switch	86	Unit	98
Removal and Installation of Display Unit	86	Self-Diagnosis Function	99
TELEPHONE	88	Symptom Chart	102
System Description	88	Component Inspection	102
Component Parts Location	89	Removal and Installation of Telephone Micro-	
Location of TEL Antenna	90	phone	103

PRECAUTIONS

< SERVICE INFORMATION >

SERVICE INFORMATION

PRECAUTIONS

Precaution for Supplemental Restraint System (SRS) "AIR BAG" and "SEAT BELT PRE-TENSIONER"

INFOID:000000005874498

The Supplemental Restraint System such as "AIR BAG" and "SEAT BELT PRE-TENSIONER", used along with a front seat belt, helps to reduce the risk or severity of injury to the driver and front passenger for certain types of collision. This system includes seat belt switch inputs and dual stage front air bag modules. The SRS system uses the seat belt switches to determine the front air bag deployment, and may only deploy one front air bag, depending on the severity of a collision and whether the front occupants are belted or unbelted. Information necessary to service the system safely is included in the "SUPPLEMENTAL RESTRAINT SYSTEM" and "SEAT BELTS" of this Service Manual.

WARNING:

- To avoid rendering the SRS inoperative, which could increase the risk of personal injury or death in the event of a collision which would result in air bag inflation, all maintenance must be performed by an authorized NISSAN/INFINITI dealer.
- Improper maintenance, including incorrect removal and installation of the SRS, can lead to personal injury caused by unintentional activation of the system. For removal of Spiral Cable and Air Bag Module, see the "SUPPLEMENTAL RESTRAINT SYSTEM".
- Do not use electrical test equipment on any circuit related to the SRS unless instructed to in this Service Manual. SRS wiring harnesses can be identified by yellow and/or orange harnesses or harness connectors.

PRECAUTIONS WHEN USING POWER TOOLS (AIR OR ELECTRIC) AND HAMMERS

WARNING:

- When working near the Air Bag Diagnosis Sensor Unit or other Air Bag System sensors with the ignition ON or engine running, DO NOT use air or electric power tools or strike near the sensor(s) with a hammer. Heavy vibration could activate the sensor(s) and deploy the air bag(s), possibly causing serious injury.
- When using air or electric power tools or hammers, always switch the ignition OFF, disconnect the battery, and wait at least 3 minutes before performing any service.

Precaution for Battery Service

INFOID:000000004657362

Before disconnecting the battery, lower both the driver and passenger windows. This will prevent any interference between the window edge and the vehicle when the door is opened/closed. During normal operation, the window slightly raises and lowers automatically to prevent any window to vehicle interference. The automatic window function will not work with the battery disconnected.

A
B
C
D
E
F
G
H
I
J
AV
L
M
N
O
P


PREPARATION

< SERVICE INFORMATION >

PREPARATION

Commercial Service Tool

INFOID:000000004657363

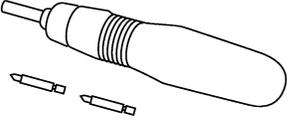Tool name	Description
<p data-bbox="162 457 267 483">Power tool</p>  <p data-bbox="852 571 922 588">PBIC0191E</p>	<p data-bbox="1015 457 1258 483">Loosening bolts and nuts</p>

AUDIO

< SERVICE INFORMATION >

AUDIO

System Description

INFOID:000000004657364

BASE SYSTEM

For Audio System operation information, refer to Owner's Manual.

Power is supplied at all times

- through 15 A fuse [No. 37, located in the fuse and fusible link box]
- to audio unit terminal 6.

With the ignition switch in the ACC or ON position, power is supplied

- through 10 A fuse [No. 6, located in the fuse block (J/B)]
- to audio unit terminal 10.

Ground is supplied through the case of the audio unit.

When audio switch is pressed, audio signals are supplied

- through audio unit terminals 1, 2, 3, 4, 13, 14, 15 and 16
- to terminals 1 and 2 of driver door speaker and passenger door speaker
- to terminals 1 and 2 of rear speaker LH and RH
- to terminals 1 and 2 of tweeter (driver side) and tweeter (passenger side).

When one of steering switch is pressed to volume up, seek up, or mode ON, resistance in steering switch circuit changes depending on which button is pressed.

When one of steering switch is pressed to volume down, seek down, or power ON, resistance in steering switch circuit changes depending on which button is pressed.

BOSE SYSTEM (COUPE MODELS)

CD auto changer (built into audio unit) operation is controlled by audio unit.

Refer to owner's manual for the system operation.

Power is supplied at all times

- through 15 A fuse [No. 37, located in the fuse and fusible link box]
- to audio unit terminal 6
- to BOSE speaker amp. terminal 11
- to satellite radio tuner terminal 32,
- through 15 A fuse [No. 17, located in the fuse block (J/B)]
- to woofer amp. terminal 8.

With the ignition switch in the ACC or ON position, power is supplied

- through 10 A fuse [No. 6, located in the fuse block (J/B)]
- to audio unit terminal 10

- to satellite radio tuner terminal 36,

- through audio unit terminal 12

- to BOSE speaker amp. terminal 41,

- through BOSE speaker amp. terminal 32

- to woofer amp. terminal 6.

Ground is supplied through the case of the audio unit.

Ground is also supplied

- to BOSE speaker amp. terminal 27
- to woofer amp. terminal 7
- through body grounds B5, B6, D105 and T14.

When audio switch is pressed, audio signals are supplied

- through audio unit terminals 1, 2, 3, 4, 13, 14, 15 and 16
- to BOSE speaker amp. terminals 33, 34, 35, 36, 37, 38, 39 and 40.

Audio signals are amplified by the BOSE speaker amp.

The amplified audio signals are supplied

- through BOSE speaker amp. terminals 12, 19, 20, 21, 22, 23, 24, 25, 26 and 28
- to terminals 1 and 2 of driver door speaker and passenger door speaker
- to terminals 1 and 2 of rear speaker LH and RH
- to terminals 1 and 2 of tweeter (driver side) and tweeter (passenger side)
- to terminals 1 and 2 of woofer amp.

Audio signals are amplified by the woofer amp.

The amplified audio signals are supplied

- through woofer amp. terminals 3 and 4
- to terminals 1 and 2 of woofer.

A

B

C

D

E

F

G

H

I

J

AV

L

M

N

O

P

AUDIO

< SERVICE INFORMATION >

When one of steering switch is pressed to volume up, seek up, or mode ON, resistance in steering switch circuit changes depending on which button is pressed.

When one of steering switch is pressed to volume down, seek down, or power ON, resistance in steering switch circuit changes depending on which button is pressed.

BOSE SYSTEM (ROADSTER MODELS)

CD auto changer (built into audio unit) operation is controlled by audio unit.

Refer to owner's manual for the system operation.

Power is supplied at all times

- through 15 A fuse [No. 37, located in the fuse and fusible link box]
- to audio unit terminal 6
- to BOSE speaker amp. terminal 11,
- through 15 A fuse [No. 17, located in the fuse block (J/B)]
- to woofer amp. terminal 8.

With the ignition switch in the ACC or ON position, power is supplied

- through 10 A fuse [No. 6, located in the fuse block (J/B)]
- to audio unit terminal 10,
- through audio unit terminal 12
- to BOSE speaker amp. terminal 41,
- through BOSE speaker amp. terminal 32
- to woofer amp. terminal 6.

Ground is supplied through the case of the audio unit.

Ground is also supplied

- to BOSE speaker amp. terminal 27
- to woofer amp. terminal 7
- through body grounds B5, B6 and T14.

When audio switch is pressed, audio signals are supplied

- through audio unit terminals 1, 2, 3, 4, 13, 14, 15 and 16
- to BOSE speaker amp. terminals 33, 34, 35, 36, 37, 38, 39 and 40.

Audio signals are amplified by the BOSE speaker amp.

The amplified audio signals are supplied

- through BOSE speaker amp. terminals 12, 19, 20, 21, 22, 23, 24, 25, 26 and 28
- to terminals 1 and 2 of driver door speaker and passenger door speaker
- to terminals 1 and 2 of rear speaker LH and RH
- to terminals 1 and 2 of tweeter (driver side) and tweeter (passenger side)
- to terminals 1 and 2 of woofer amp.

Audio signals are amplified by the woofer amp.

The amplified audio signals are supplied

- through woofer amp. terminals 3 and 4
- to terminals 1 and 2 of woofer.

When one of steering switch is pressed to volume up, seek up, or mode ON, resistance in steering switch circuit changes depending on which button is pressed.

When one of steering switch is pressed to volume down, seek down, or power ON, resistance in steering switch circuit changes depending on which button is pressed.

AudioPilot® System

AudioPilot® is the sound improving system that picks up by a microphone under the steering any noises or the sound of music coming into the vehicle, and that uses the BOSE speaker amp. to revise the frequency feature of music in real time in response to the frequency feature of the noise while driving and listening to music.


- If low frequency area noise from vehicle is loud, it adjusts low frequency element of music to be bigger than vehicle noise.
- If high frequency area noise from vehicle is loud, it adjusts high frequency element of music to be bigger than vehicle noise.
- If vehicle noise is smaller than the setting volume, correction is not performed.

AUDIO

< SERVICE INFORMATION >

Component Parts Location

INFOID:000000004657365

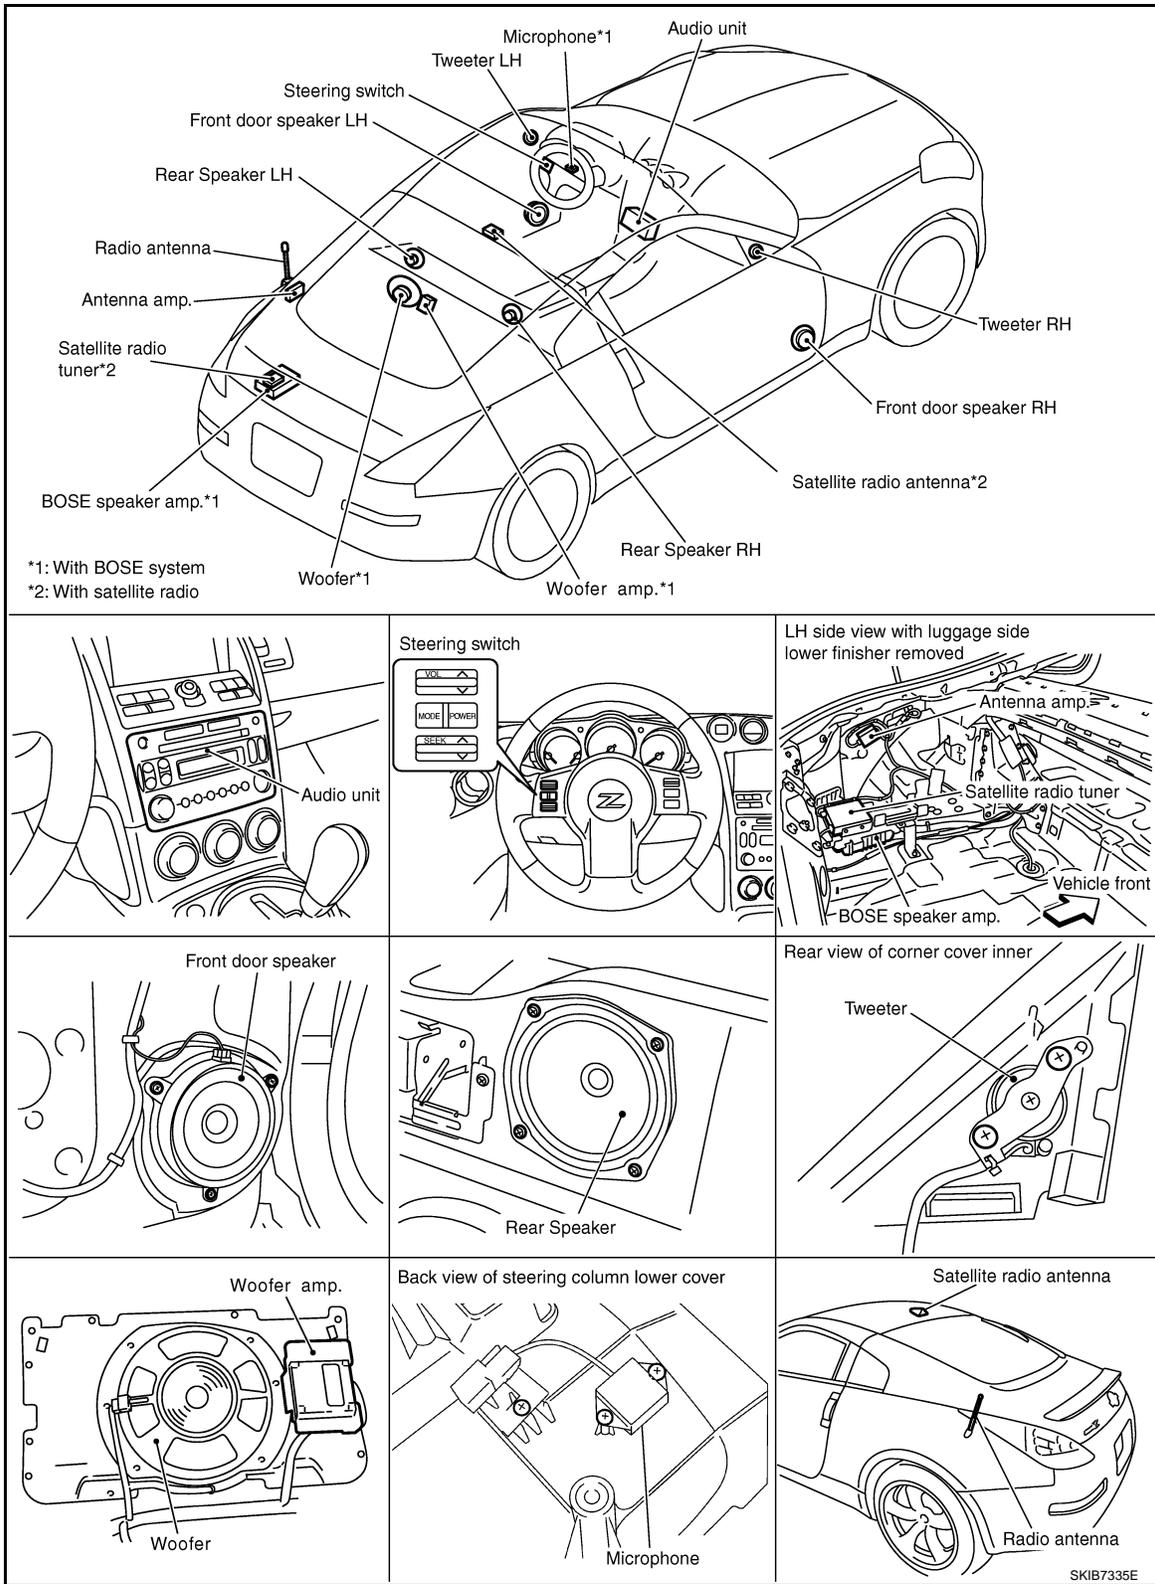


A
B
C
D
E
F
G
H
I
J
K
L
M
N
O
P

AV

AUDIO

< SERVICE INFORMATION > Schematic / Base System

INFOID:000000004657366

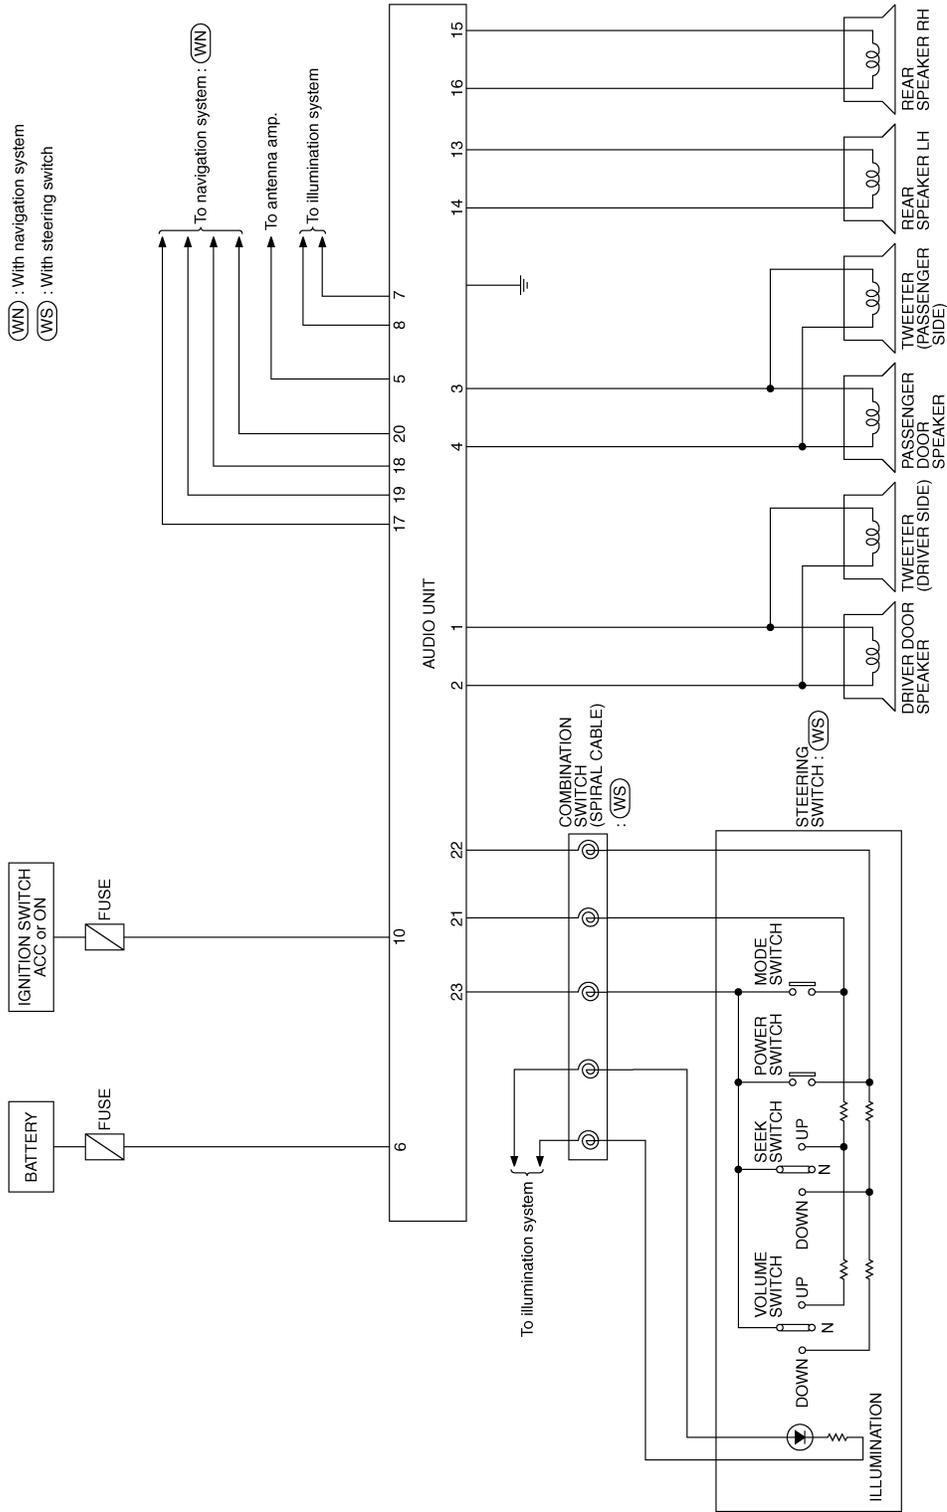

TKWT4061E


AUDIO

< SERVICE INFORMATION >


Wiring Diagram - AUDIO - / Base System

INFOID:000000004657367

AV-AUDIO-01

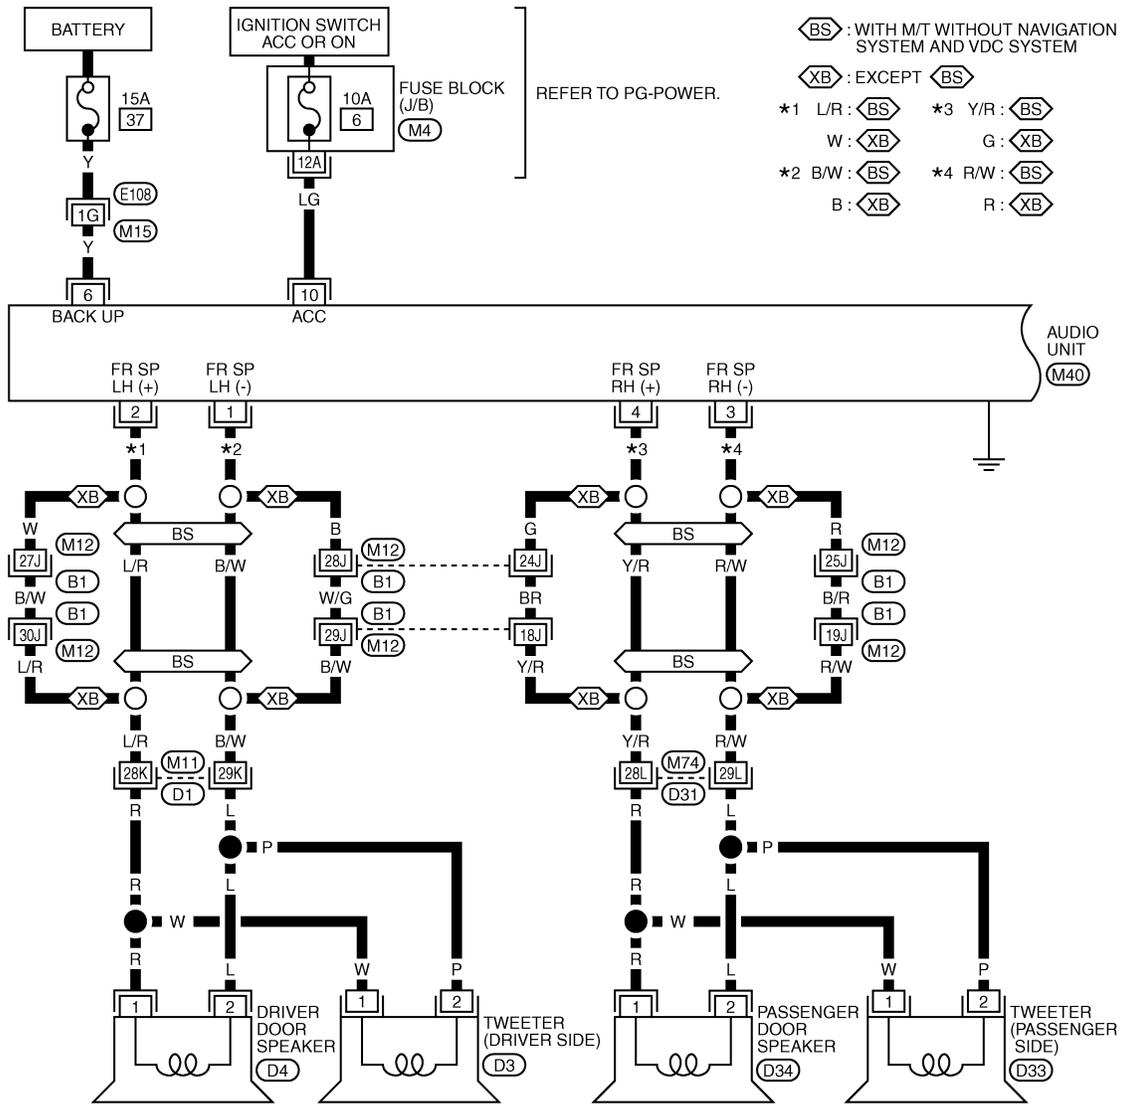

 ◊BS◊ : WITH M/T WITHOUT NAVIGATION SYSTEM AND VDC SYSTEM
 ◊XB◊ : EXCEPT ◊BS◊
 *1 L/R : ◊BS◊ *3 Y/R : ◊BS◊
 W : ◊XB◊ G : ◊XB◊
 *2 B/W : ◊BS◊ *4 R/W : ◊BS◊
 B : ◊XB◊ R : ◊XB◊





REFER TO THE FOLLOWING.
 (E108), (B1), (D1), (D31)
 -SUPER MULTIPLE JUNCTION (SMJ)
 (M4) -FUSE BLOCK-JUNCTION BOX (J/B)

TKWT5785E

AUDIO

< SERVICE INFORMATION >

 AV-AUDIO-02

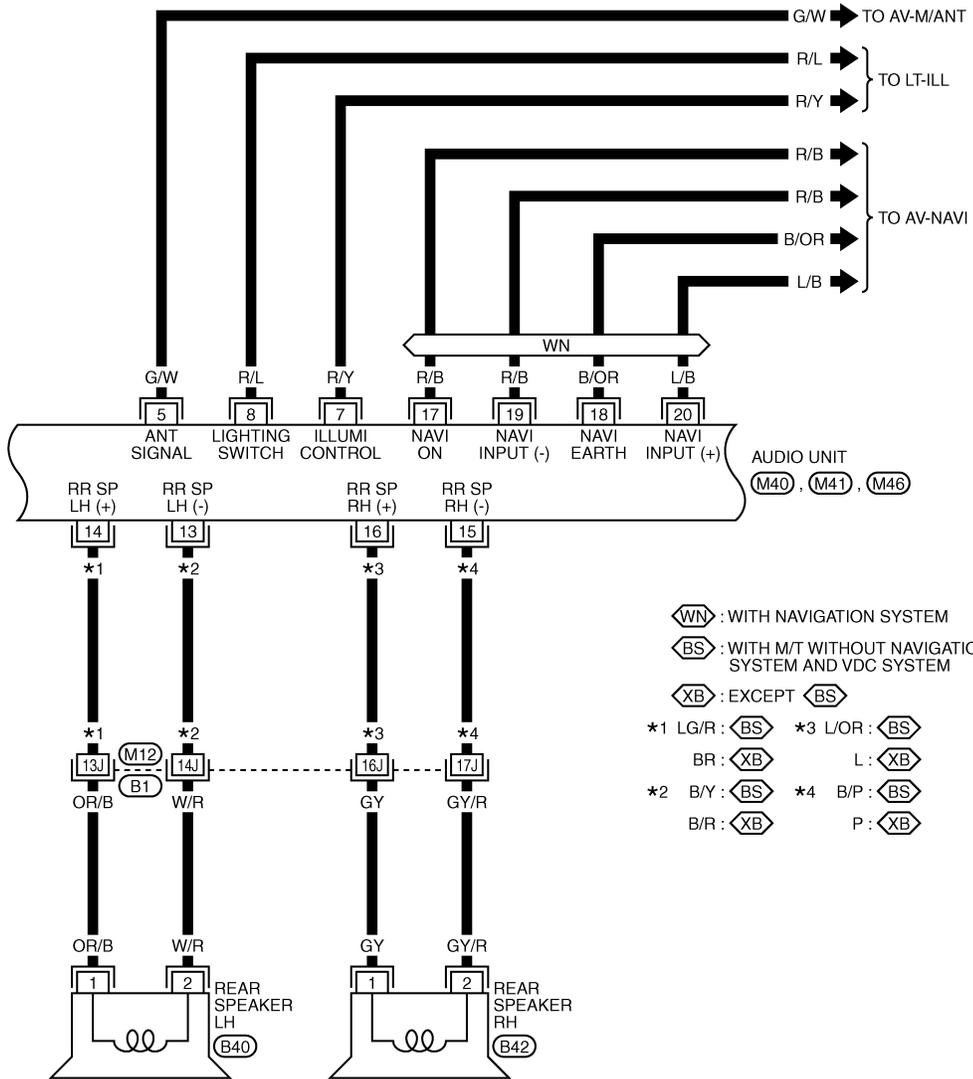

REFER TO THE FOLLOWING.
 (B1) -SUPER MULTIPLE JUNCTION (SMJ)



TKWT5648E

AUDIO

< SERVICE INFORMATION >

AV-AUDIO-03

 WS : WITH STEERING SWITCH

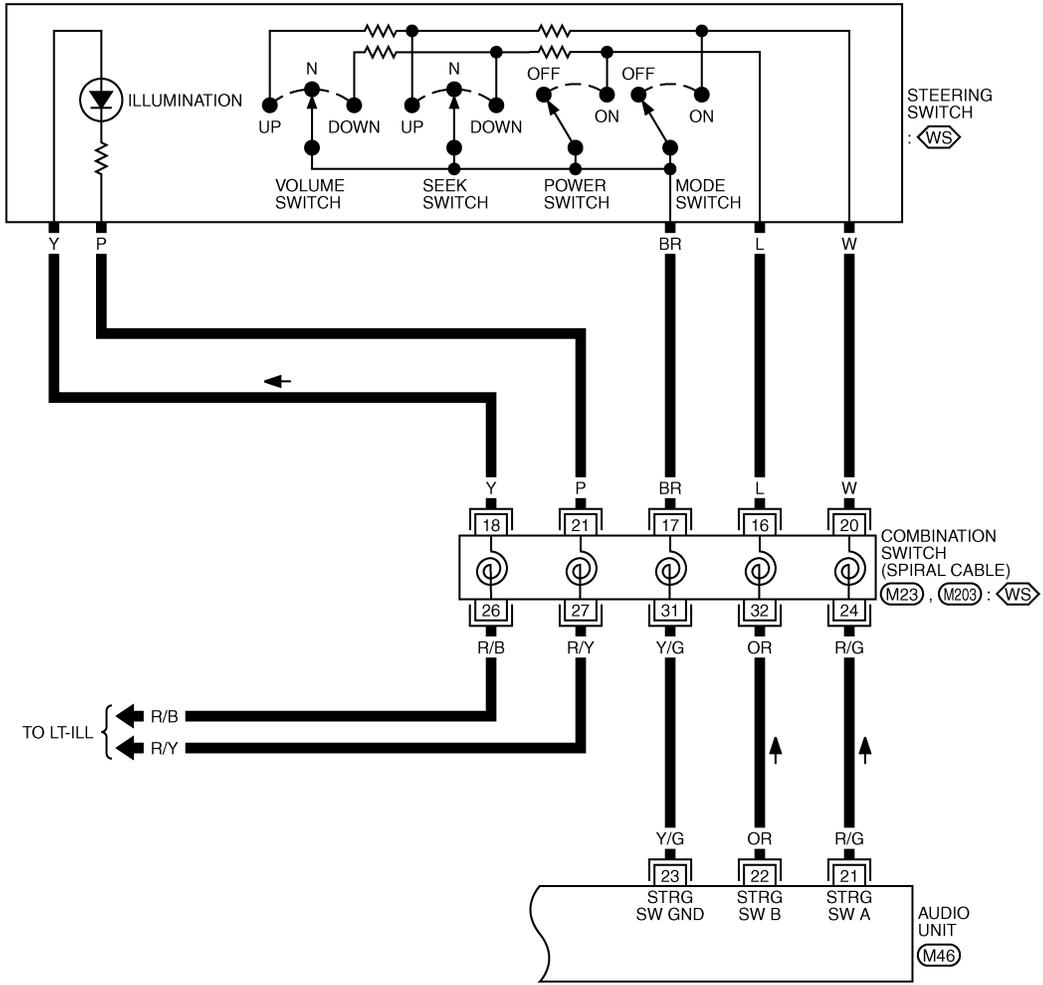

*: THIS CONNECTOR IS NOT SHOWN IN "HARNESS LAYOUT", PG SECTION.

TKWT5649E

A
B
C
D
E
F
G
H
I
J
K
L
M
N
O
P


AV

AUDIO

< SERVICE INFORMATION >

Schematic / BOSE System

INFOID:00000004657368

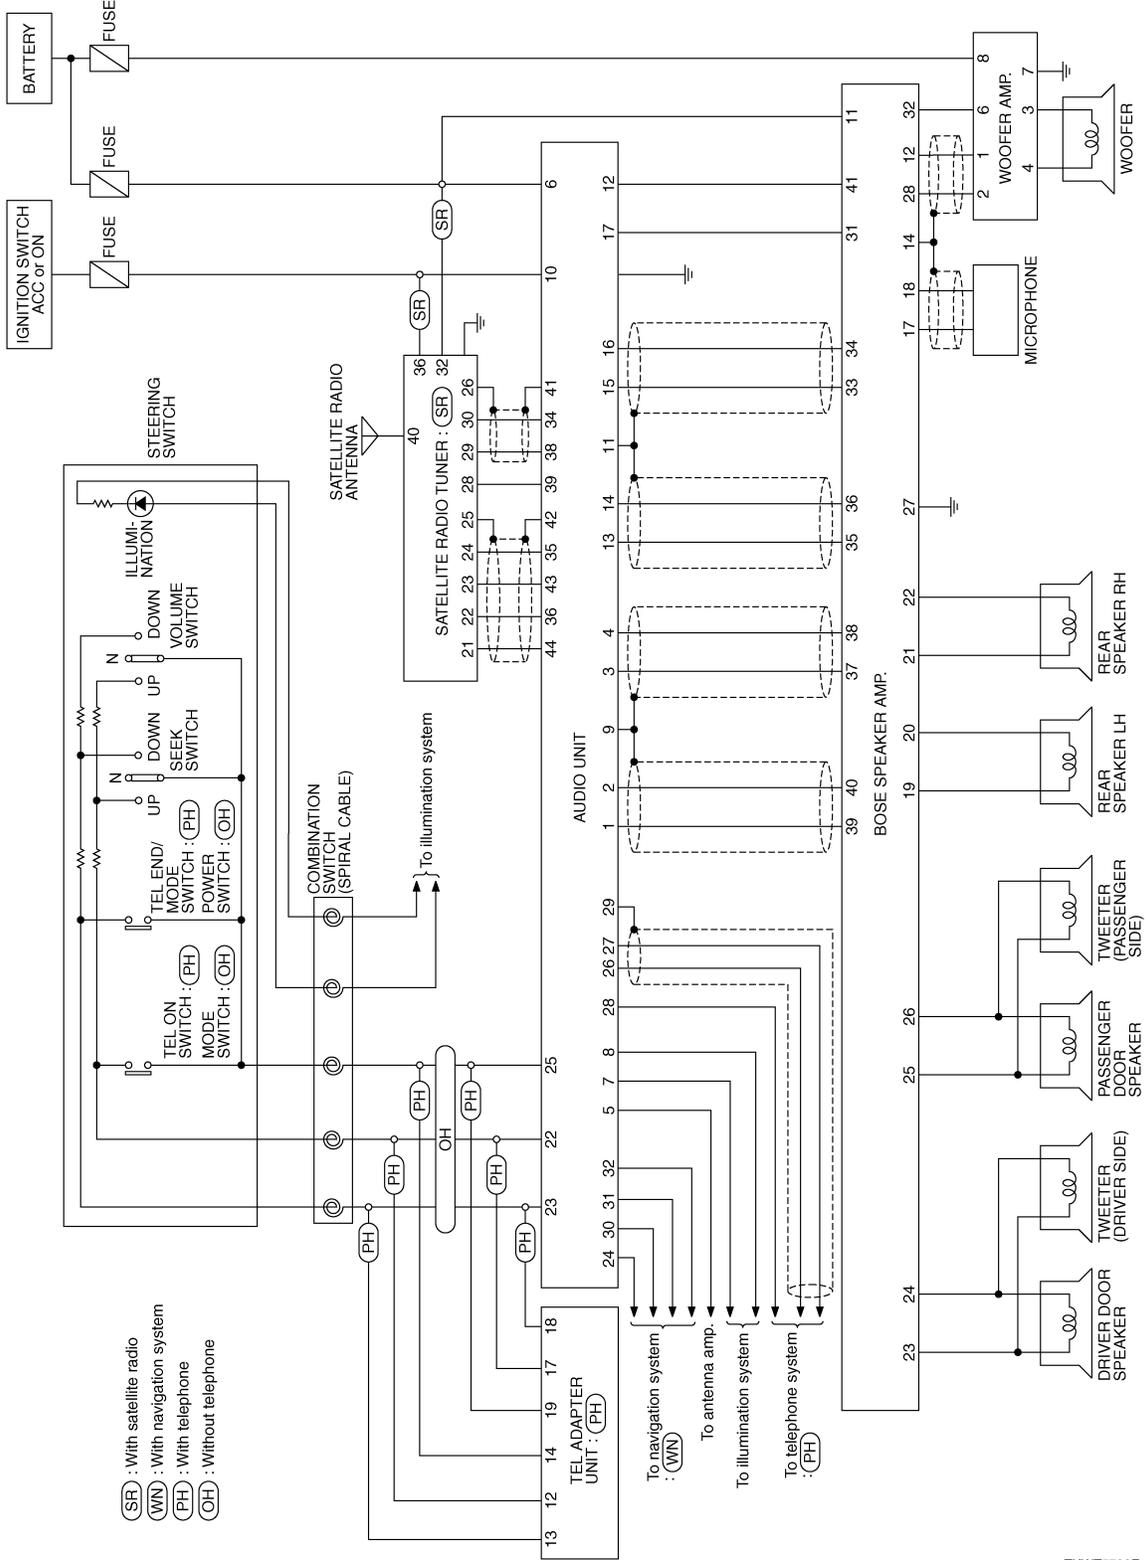

TKWWT5786E

AUDIO

< SERVICE INFORMATION >

AV-AUDIO-05

Ⓟ : WITH TELEPHONE

 

Ⓞ : WITHOUT TELEPHONE

*1 SB : Ⓟ *3 PU : Ⓟ

R/G : Ⓞ Y/G : Ⓞ

*2 G : Ⓟ

OR : Ⓞ

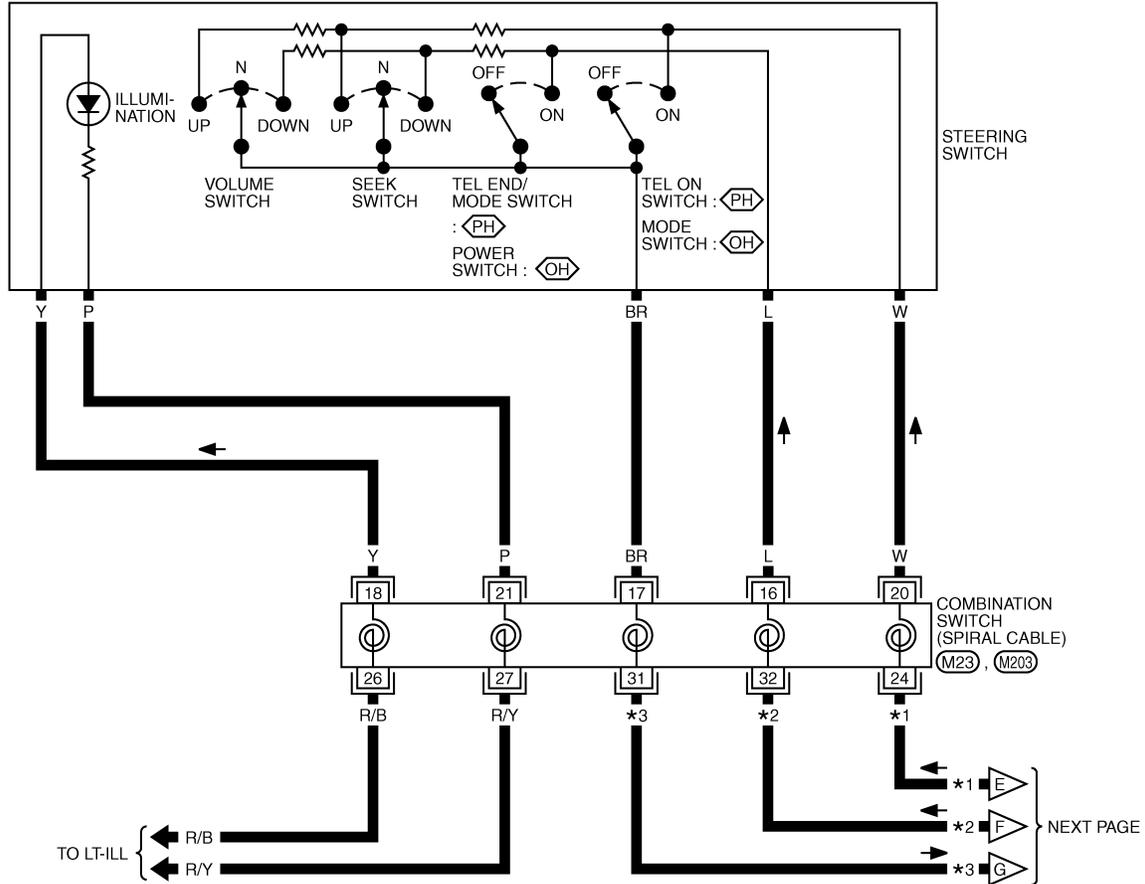

*: THIS CONNECTOR IS NOT SHOWN IN "HARNESS LAYOUT", PG SECTION.

TKWT5788E

AUDIO

< SERVICE INFORMATION >

AV-AUDIO-06

Ⓟ : WITH TELEPHONE



Ⓞ : WITHOUT TELEPHONE

*1 SB : Ⓟ *3 PU : Ⓟ

R/G : Ⓞ Y/G : Ⓞ

*2 G : Ⓟ *4 GR : Ⓟ

OR : Ⓞ Y/G : Ⓞ

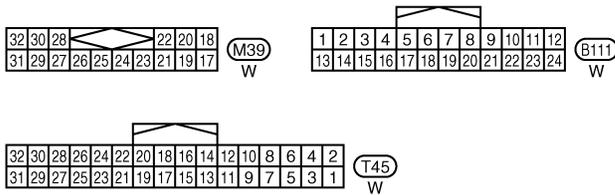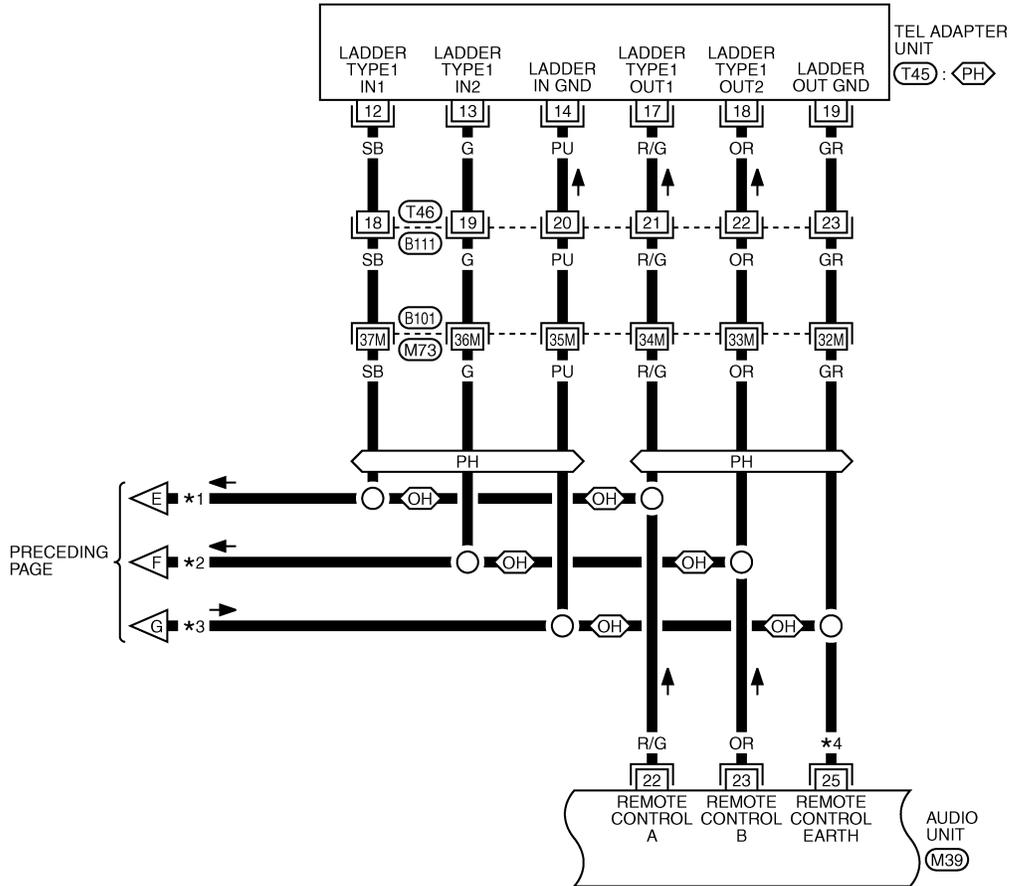

REFER TO THE FOLLOWING.

Ⓟ -SUPER MULTIPLE JUNCTION (SMJ)

TKWT5789E


A
B
C
D
E
F
G
H
I
J
L
M
N
O
P

AV



AUDIO

< SERVICE INFORMATION >

AV-AUDIO-07

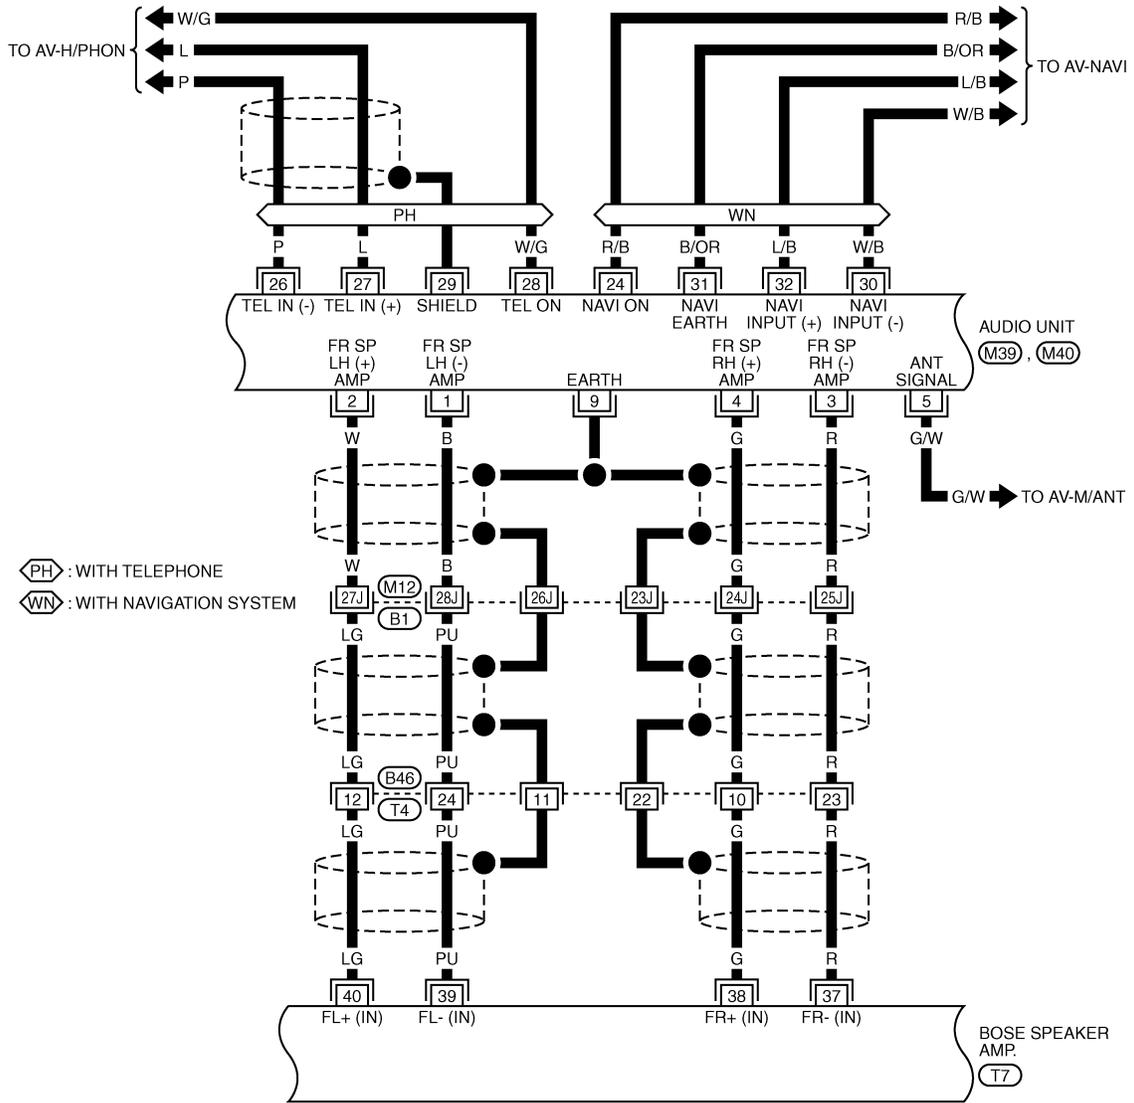

  Ⓟ : WITH TELEPHONE
 Ⓜ : WITH NAVIGATION SYSTEM





REFER TO THE FOLLOWING.
 Ⓟ -SUPER MULTIPLE JUNCTION (SMJ)

TKW75790E

AUDIO

< SERVICE INFORMATION >

AV-AUDIO-08

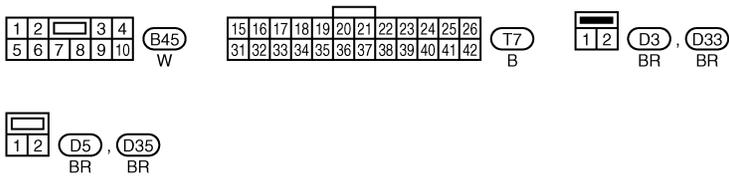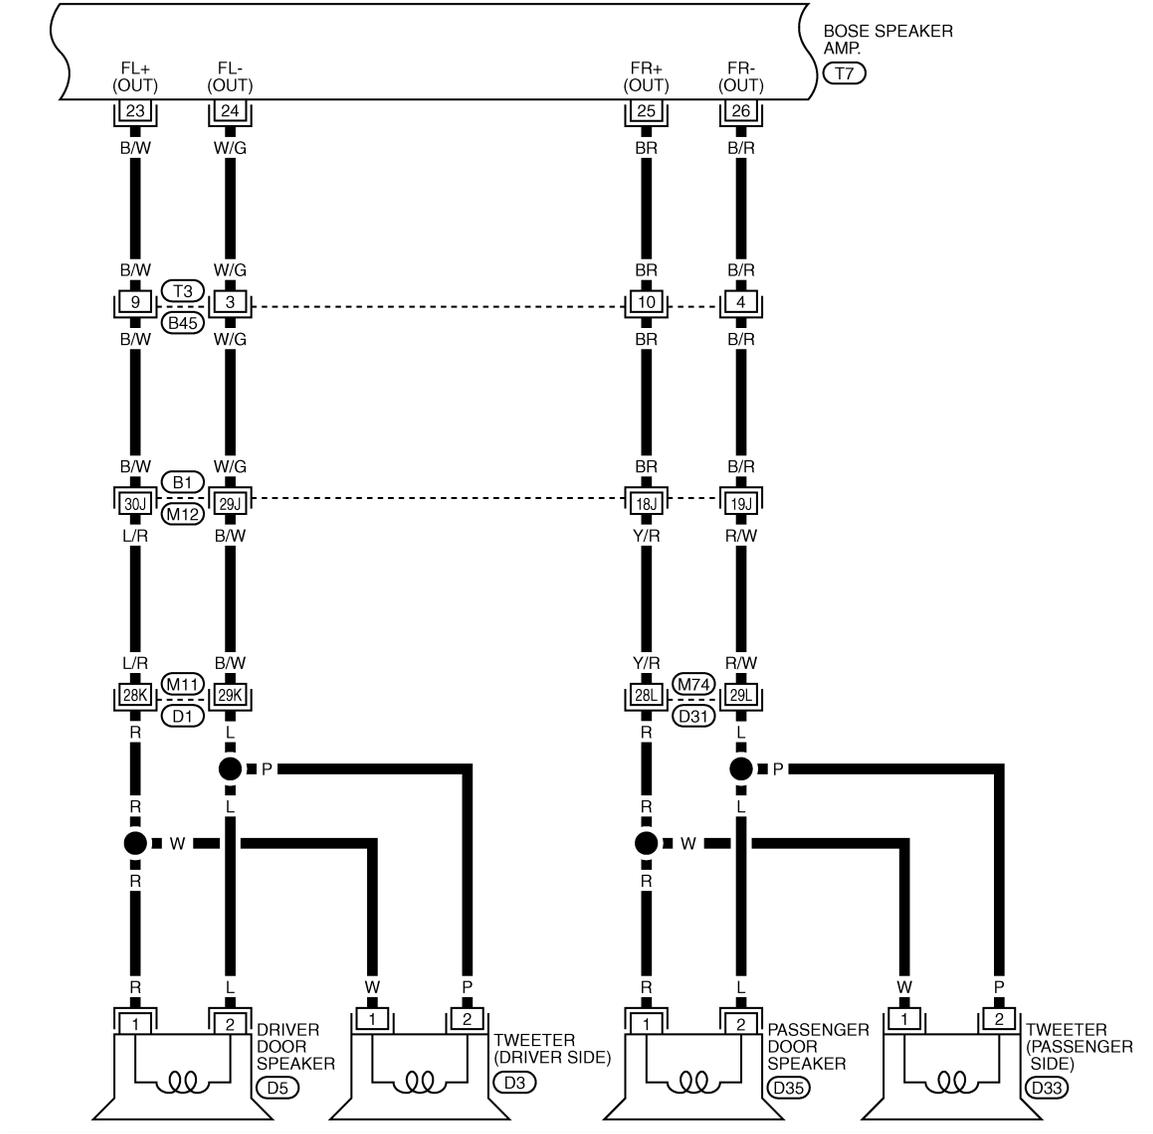

REFER TO THE FOLLOWING.
 (B1), (D1), (D31) -SUPER
 MULTIPLE JUNCTION (SMJ)

TKW75791E



A
B
C
D
E
F
G
H
I
J
L
M
N
O
P

AV

AUDIO

< SERVICE INFORMATION >

AV-AUDIO-09

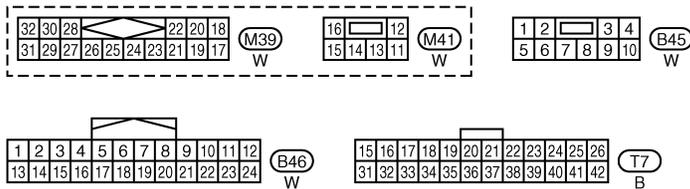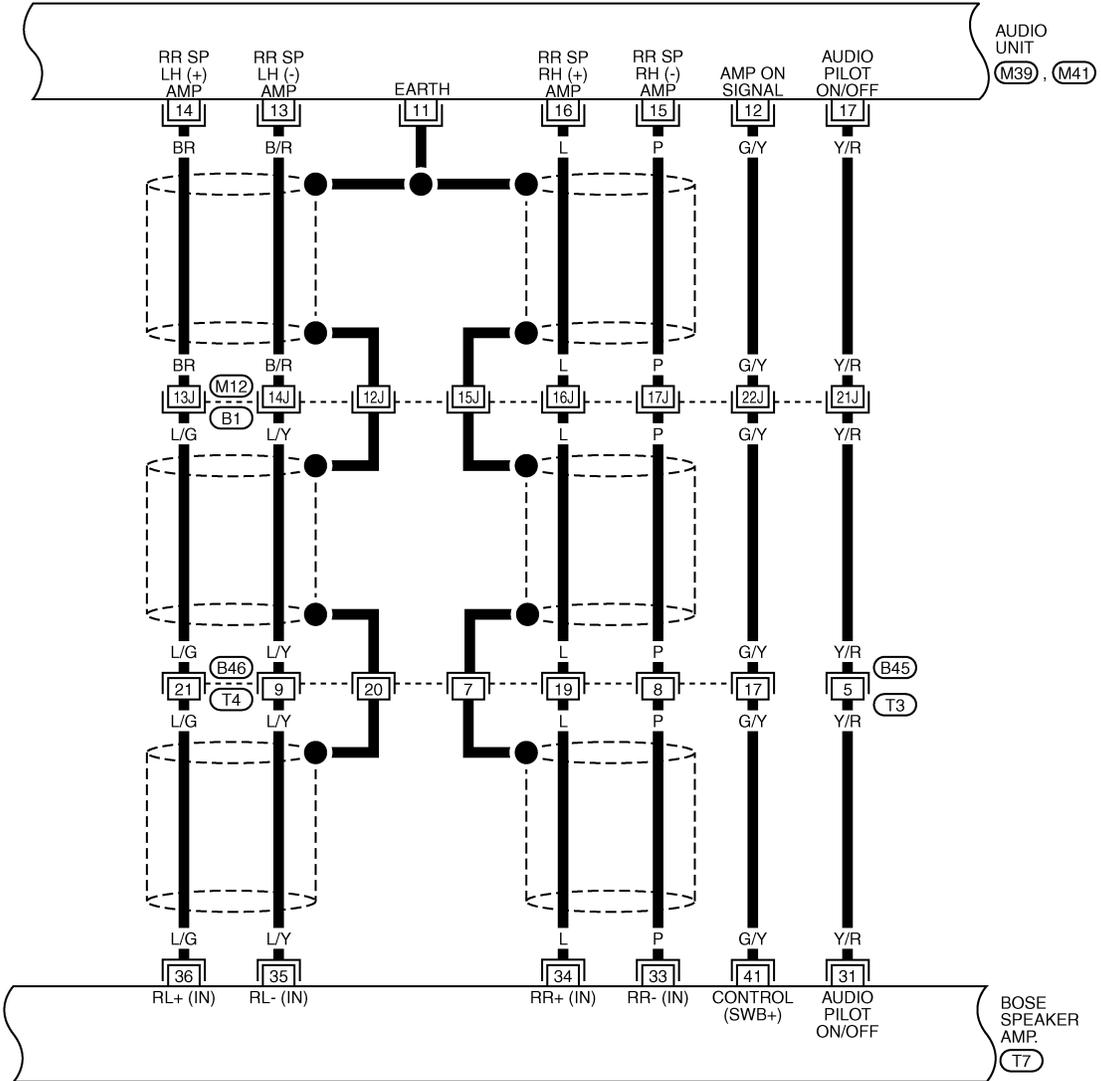



REFER TO THE FOLLOWING.
 (B1) -SUPER MULTIPLE JUNCTION (SMJ)

TKWT5792E

AUDIO

< SERVICE INFORMATION >

AV-AUDIO-11

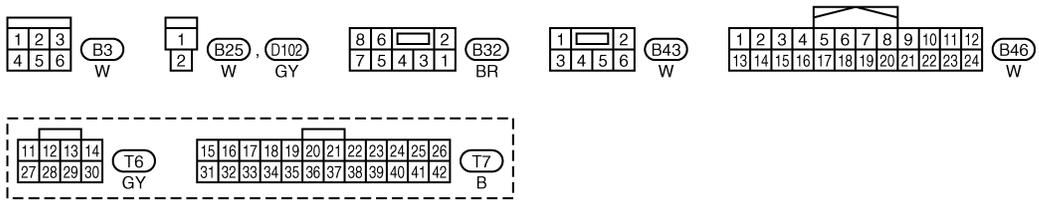
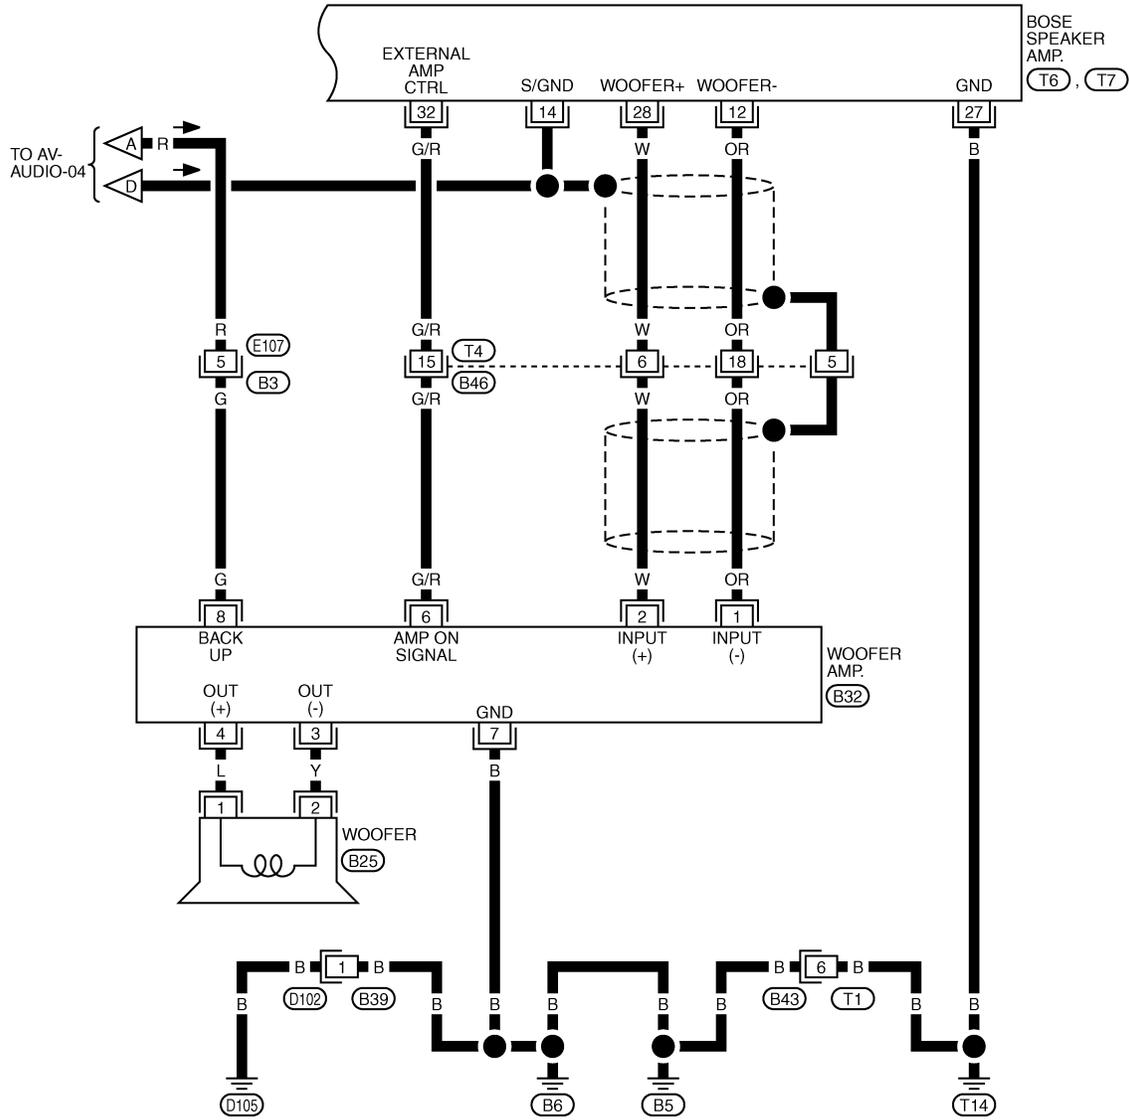


TKWT5794E

AUDIO

< SERVICE INFORMATION >

AV-AUDIO-12

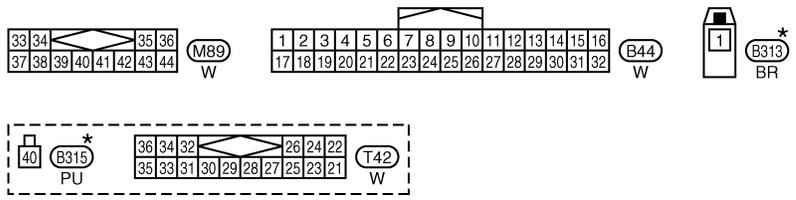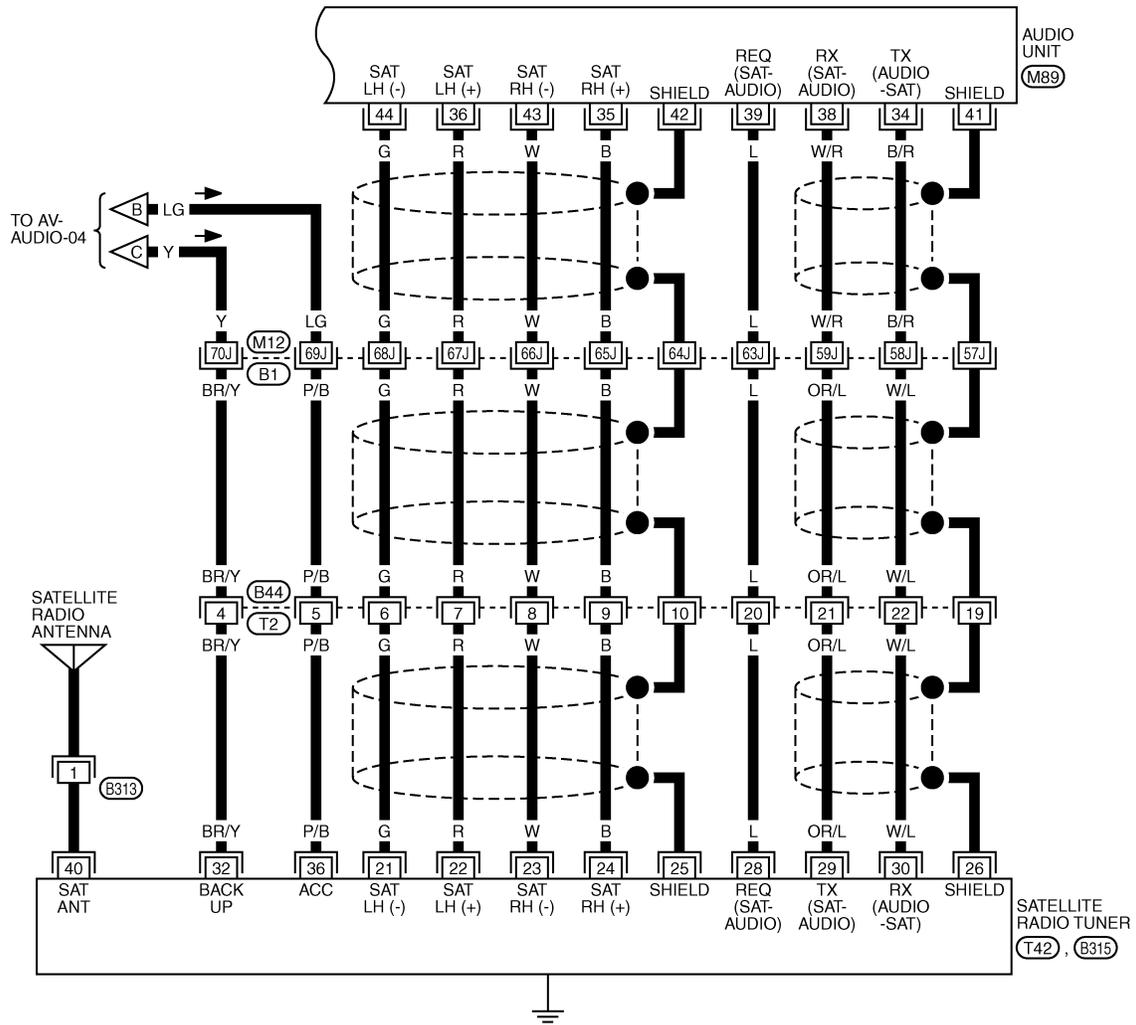

*: THIS CONNECTOR IS NOT SHOWN IN "HARNESS LAYOUT", PG SECTION.

REFER TO THE FOLLOWING.

(B1) -SUPER MULTIPLE JUNCTION (SMJ)

TKWT6662E

A
B
C
D
E
F
G
H
I
J
K
L
M
N
O
P



AV

AUDIO

< SERVICE INFORMATION >

Wiring Diagram - AUDIO - / BOSE System (Roadster Models)

INFOID:000000004657370

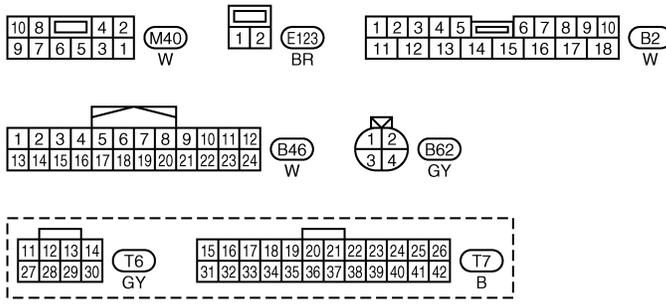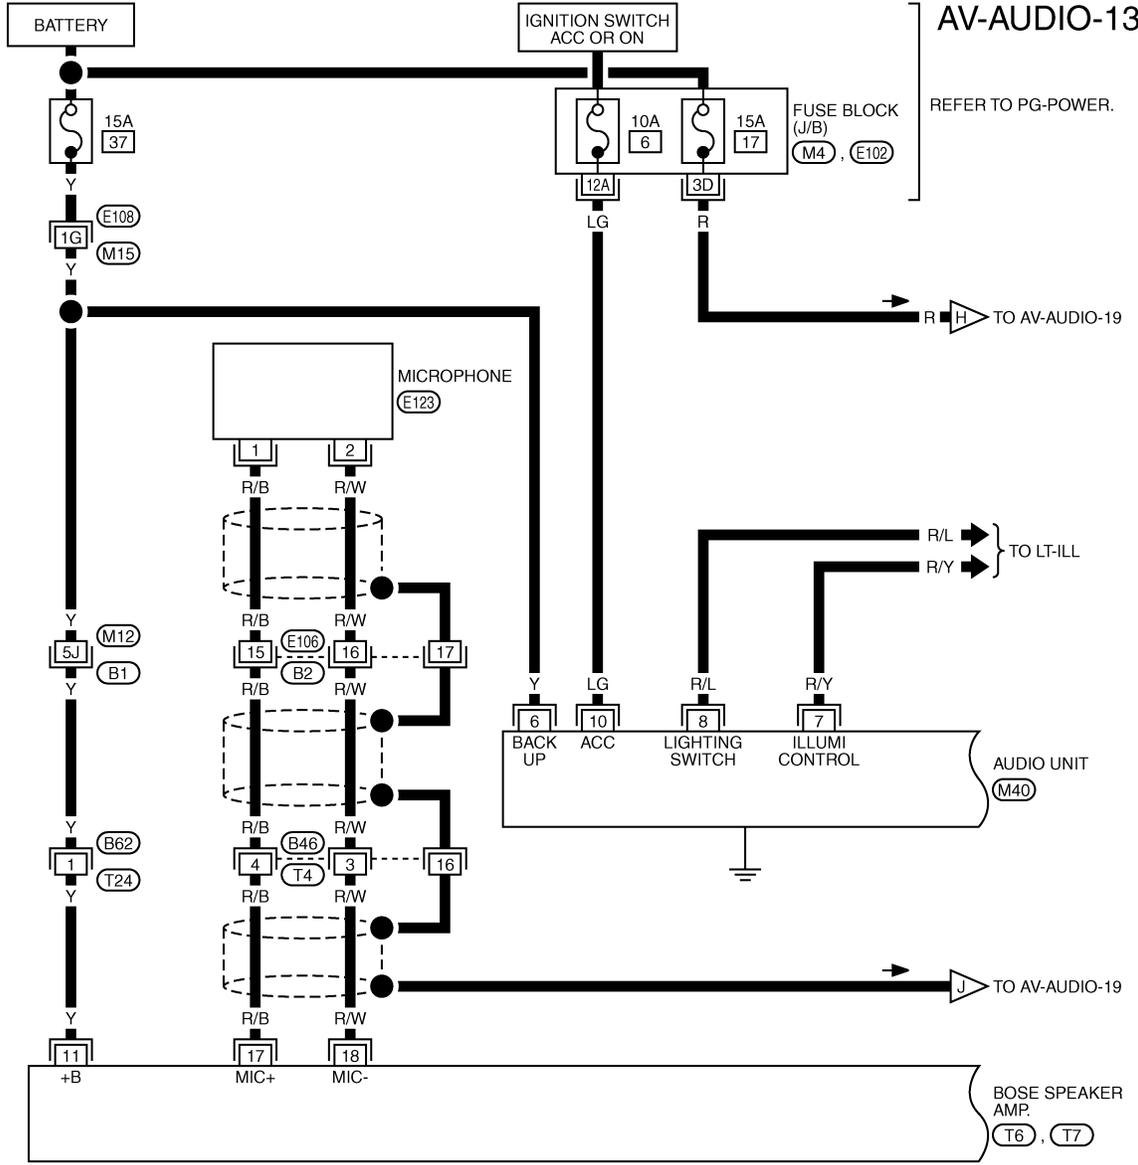



REFER TO THE FOLLOWING.
 (E108), (B1) -SUPER MULTIPLE JUNCTION (SMJ)
 (M4), (E102) -FUSE BLOCK-JUNCTION BOX (J/B)

TKWT5796E

AUDIO

< SERVICE INFORMATION >

 AV-AUDIO-14

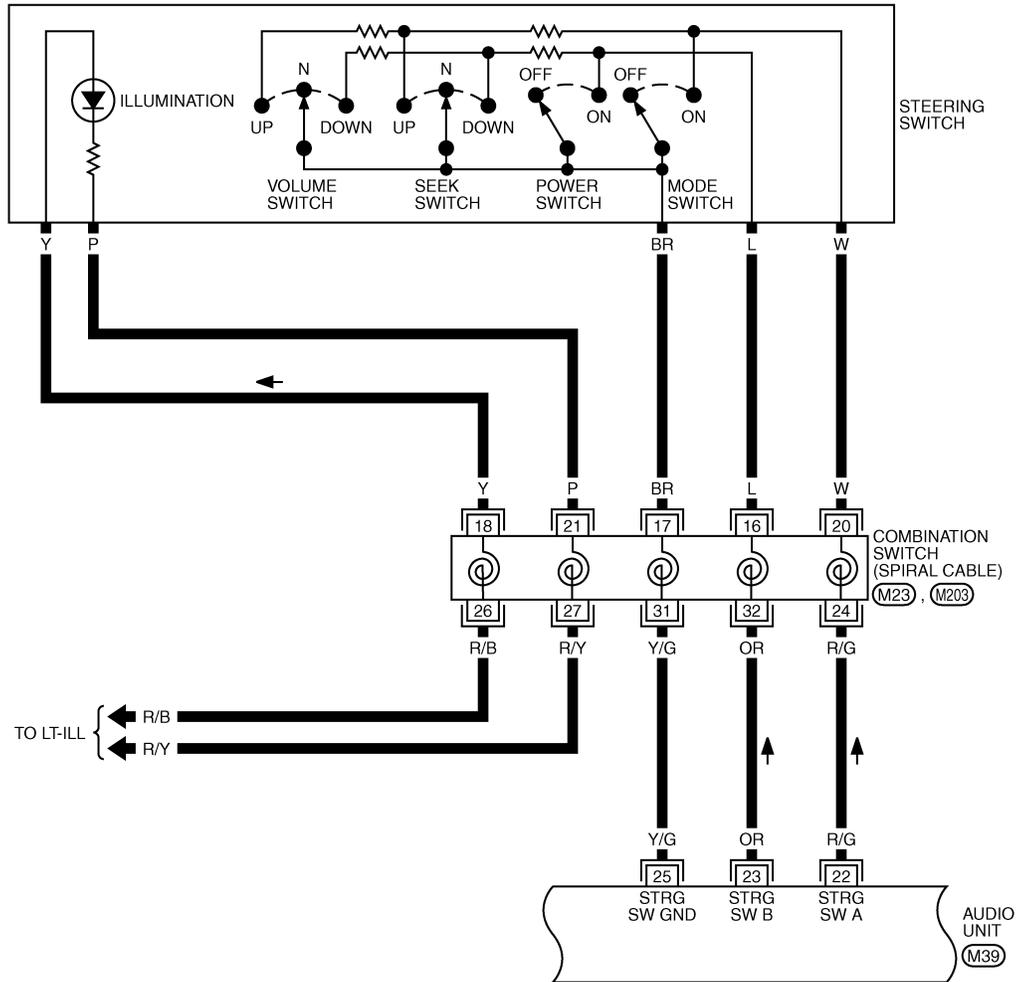

*: THIS CONNECTOR IS NOT SHOWN IN "HARNES LAYOUT", PG SECTION.

TKWT5797E

 
 

A
B
C
D
E
F
G
H
I
J
AV
L
M
N
O
P

AUDIO

< SERVICE INFORMATION >

AV-AUDIO-15

WN : WITH NAVIGATION SYSTEM

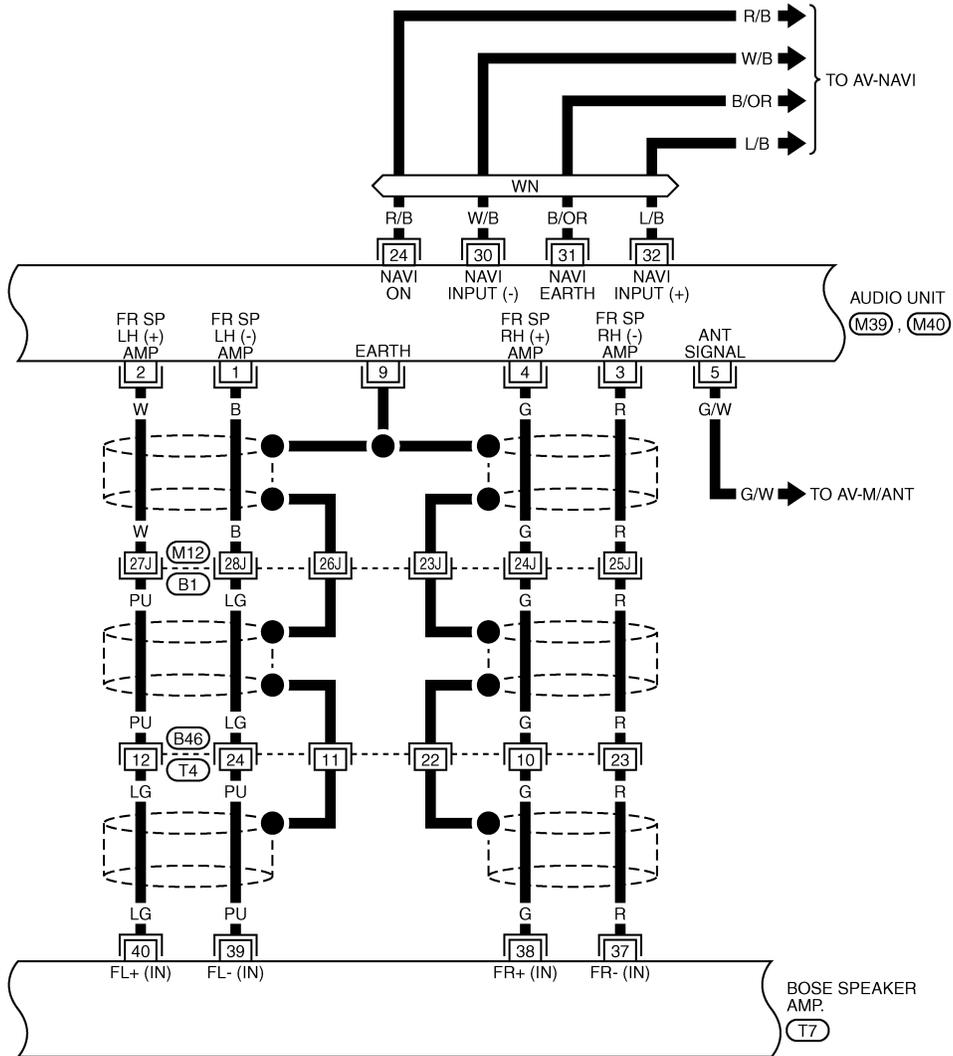

REFER TO THE FOLLOWING.



(B1) -SUPER MULTIPLE JUNCTION (SMJ)

TKWT5798E

AUDIO

< SERVICE INFORMATION >

AV-AUDIO-16

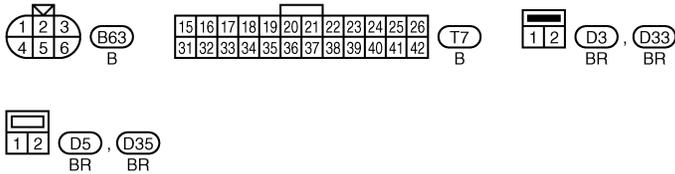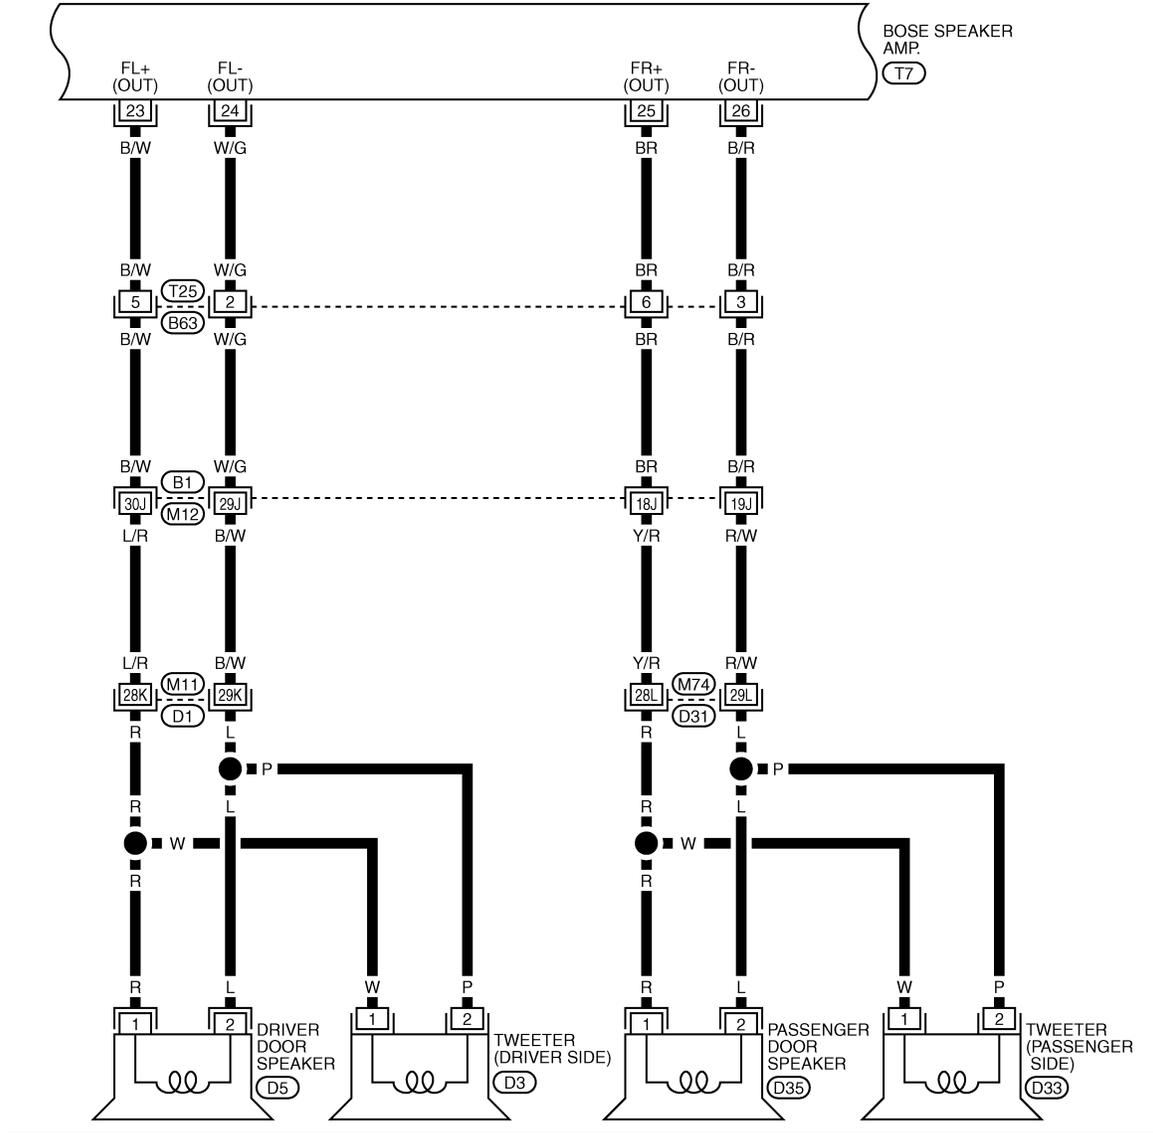

REFER TO THE FOLLOWING.
 (B1), (D1), (D31) -SUPER
 MULTIPLE JUNCTION (SMJ)





TKWT5799E

A
B
C
D
E
F
G
H
I
J
AV
L
M
N
O
P

AUDIO

< SERVICE INFORMATION >

   AV-AUDIO-17

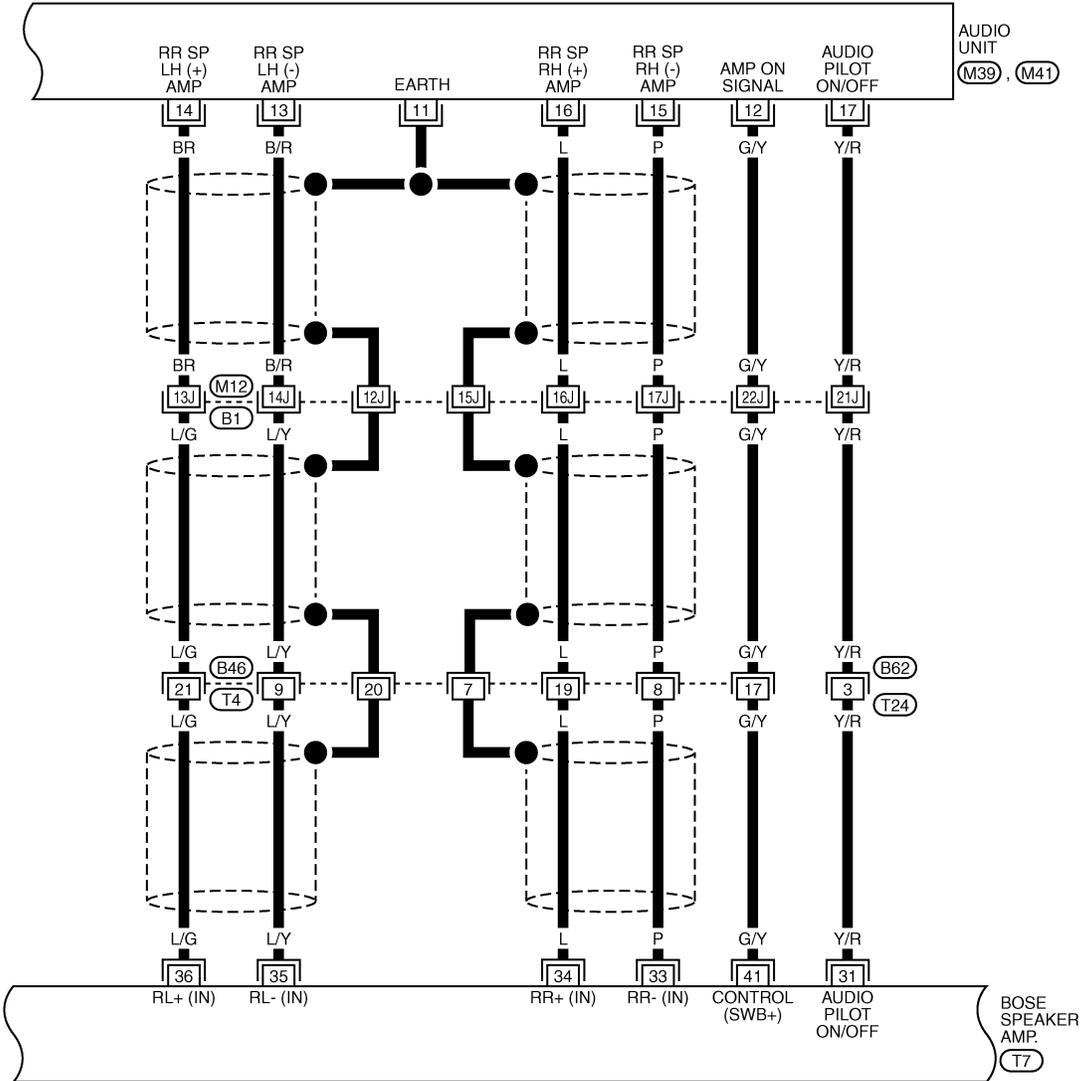



REFER TO THE FOLLOWING.
 (B1) -SUPER MULTIPLE JUNCTION (SMJ)

TKWT5800E

AUDIO

< SERVICE INFORMATION >

 AV-AUDIO-18

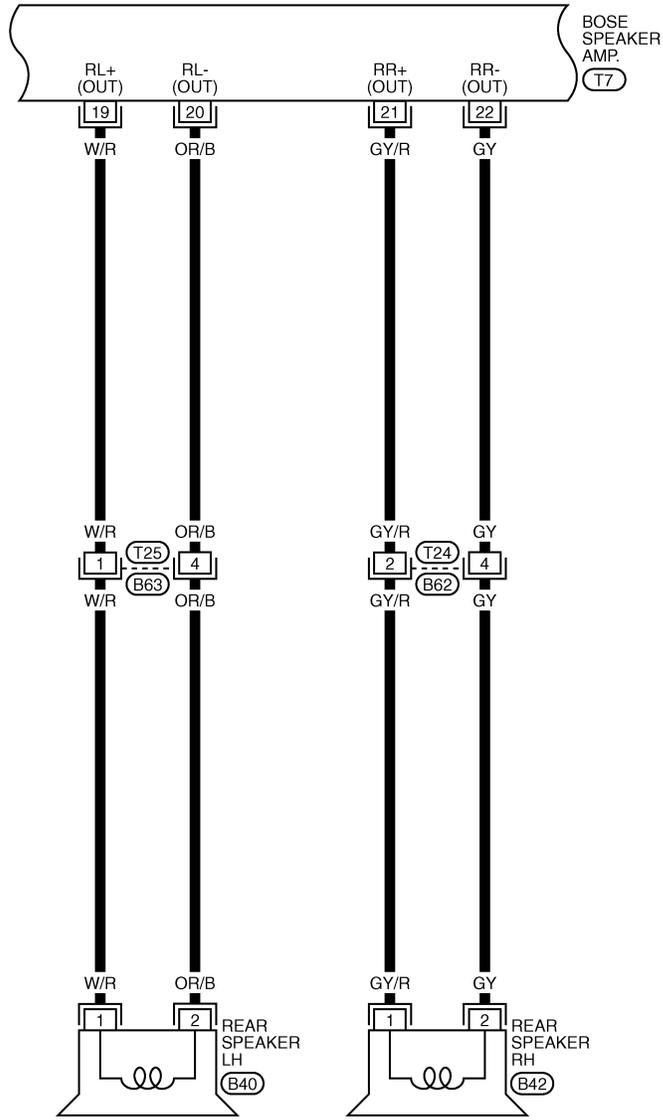



A
B
C
D
E
F
G
H
I
J
AV
L
M
N
O
P

TKWT5801E

AUDIO

< SERVICE INFORMATION >

AV-AUDIO-19

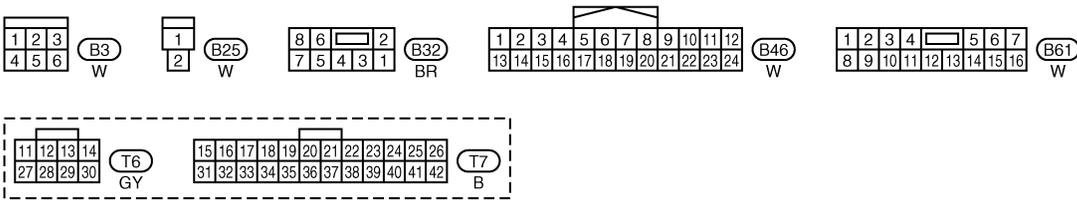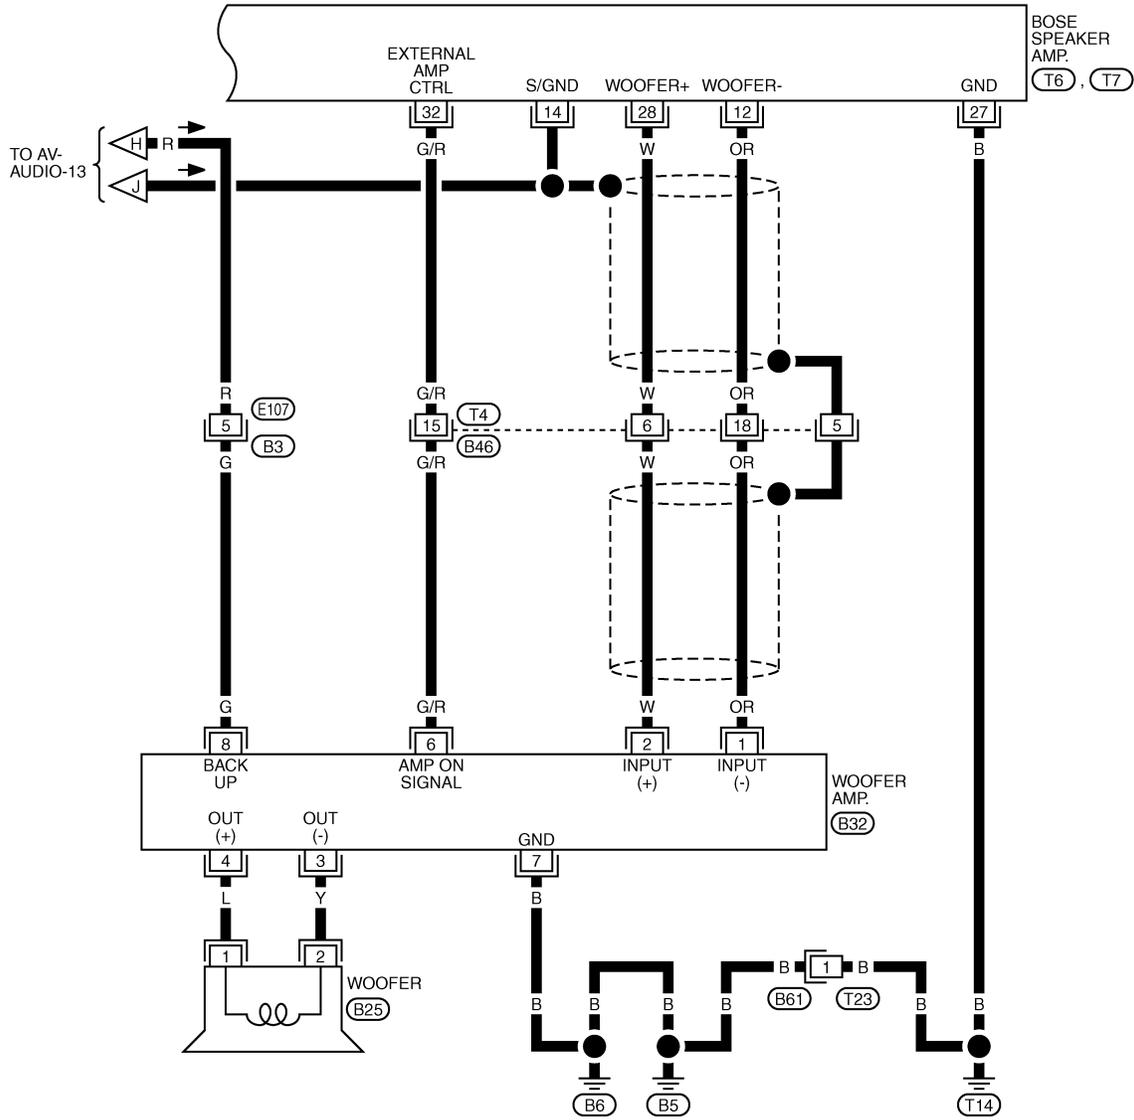






TKWT5802E

AUDIO

< SERVICE INFORMATION >

Terminal and Reference Value for Audio Unit / Base System

INFOID:000000004657371

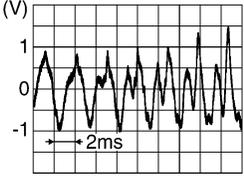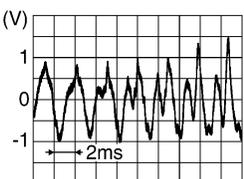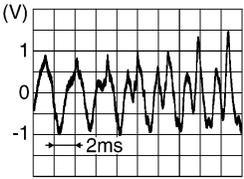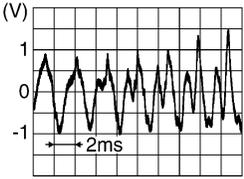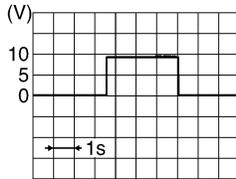Terminal (Wire color)		Item	Signal input/ output	Condition		Reference value
+	-			Ignition switch	Operation	
2 (L/R) ^{*1} (W) ^{*2}	1 (B/W) ^{*1} (B) ^{*2}	Audio signal front LH	Output	ON	Receive audio signal	
4 (Y/R) ^{*1} (G) ^{*2}	3 (R/W) ^{*1} (R) ^{*2}	Audio signal front RH	Output	ON	Receive audio signal	
5 (G/W)	Ground	Antenna amp. ON signal	Output	ON	—	Approx. 12 V
6 (Y)	Ground	Battery power supply	Input	OFF	—	Battery voltage
7 (R/Y)	Ground	Illumination control signal	Input	ON	Illumination control switch is operated by lighting switch in ON position	Changes between approx. 0 and approx. 12 V
8 (R/L)	Ground	Lighting switch signal	Input	ON	Lighting switch ON	Approx. 12 V
					Lighting switch OFF	Approx. 0 V
10 (LG)	Ground	ACC power supply	Input	ACC	—	Battery voltage
14 (LG/R) ^{*1} (BR) ^{*2}	13 (B/Y) ^{*1} (B/R) ^{*2}	Audio signal rear LH	Output	ON	Receive audio signal	
16 (L/OR) ^{*1} (L) ^{*2}	15 (B/P) ^{*1} (P) ^{*2}	Audio signal rear RH	Output	ON	Receive audio signal	
17 (R/B)	18 (B/OR)	Voice guidance ON signal ^{*3}	Input	ON	Press "VOICE" button	

A

B

C

D

E

F

G

H

I

J

AV

L

M


N

O

P

AUDIO



< SERVICE INFORMATION >

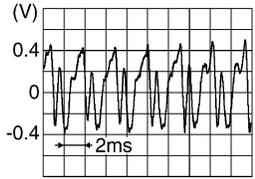Terminal (Wire color)		Item	Signal input/ output	Condition		Reference value
+	-			Ignition switch	Operation	
20 (L/B)	19 (R/B)	Voice guidance signal*3	Input	ON	Press "VOICE" button	 <small>SKIB3597E</small>
21 (R/G)	23 (Y/G)	Remote control signal A	Input	ON	Press and hold MODE switch	Approx. 0 V
					Press and hold SEEK UP switch	Approx. 1.7 V
					Press and hold VOLUME UP switch	Approx. 3.3 V
					Except for above	Approx. 5 V
22 (OR)	23 (Y/G)	Remote control signal B	Input	ON	Press and hold POWER switch	Approx. 0 V
					Press and hold SEEK DOWN switch	Approx. 1.7 V
					Press and hold VOLUME DOWN switch	Approx. 3.3 V
					Except for above	Approx. 5 V
23 (Y/G)	Ground	Remote control ground	—	ON	—	Approx. 0 V

- *1: With M/T without navigation system and VDC system
- *2: Except *1
- *3: With navigation system



Terminal and Reference Value for Audio Unit / BOSE System

INFOID:000000004657372

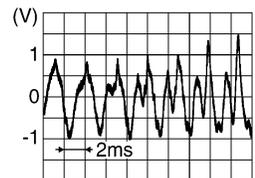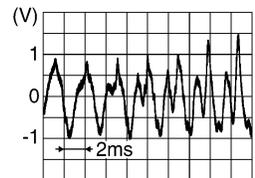Terminal (Wire color)		Item	Signal input/ output	Condition		Reference value
+	-			Ignition switch	Operation	
2 (W)	1 (B)	Audio signal front LH	Output	ON	Receive audio signal	 <small>SKIB3609E</small>
4 (G)	3 (R)	Audio signal front RH	Output	ON	Receive audio signal	 <small>SKIB3609E</small>

AUDIO






< SERVICE INFORMATION >

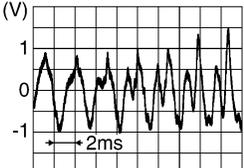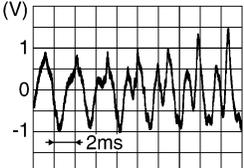Terminal (Wire color)		Item	Signal input/ output	Condition		Reference value
+	-			Ignition switch	Operation	
5 (G/W)	Ground	Antenna amp. ON signal	Output	ON	—	Approx. 12 V
6 (Y)	Ground	Battery power supply	Input	OFF	—	Battery voltage
7 (R/Y)	Ground	Illumination control signal	Input	ON	Illumination control switch is operated by lighting switch in ON position	Changes between approx. 0 and approx. 12 V
8 (R/L)	Ground	Lighting switch signal	Input	ON	Lighting switch ON	Approx. 12 V
					Lighting switch OFF	Approx. 0 V
9	—	Shield	—	—	—	—
10 (LG)	Ground	ACC power supply	Input	ACC	—	Battery voltage
11	—	Shield	—	—	—	—
12 (G/Y)	Ground	BOSE speaker amp. ON signal	Output	ON	—	Approx. 12 V
14 (BR)	13 (B/R)	Audio signal rear LH	Output	ON	Receive audio signal	 SKIB3609E
16 (L)	15 (P)	Audio signal rear RH	Output	ON	Receive audio signal	 SKIB3609E
17 (Y/R)	Ground	AudioPilot® ON/OFF signal	Output	ON	AudioPilot® OFF	Approx. 7.5 V
					AudioPilot® ON	Approx. 0 V
22 (R/G)	25 (GR) ^{*1} (Y/G) ^{*2}	Remote control signal A	Input	ON	Press and hold MODE switch	Approx. 0 V
					Press and hold SEEK UP switch	Approx. 1.7 V
					Press and hold VOLUME UP switch	Approx. 3.3 V
					Except for above	Approx. 5 V
23 (OR)	25 (GR) ^{*1} (Y/G) ^{*2}	Remote control signal B	Input	ON	Press and hold POWER switch	Approx. 0 V
					Press and hold SEEK DOWN switch	Approx. 1.7 V
					Press and hold VOLUME DOWN switch	Approx. 3.3 V
					Except for above	Approx. 5 V

A
B
C
D
E
F
G
H
I
J
AV
L
M
N
O
P




AUDIO

< SERVICE INFORMATION >

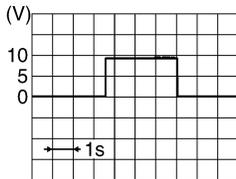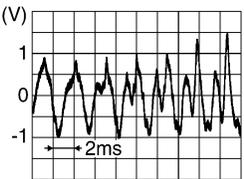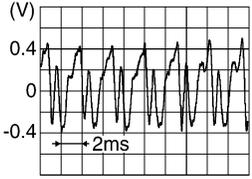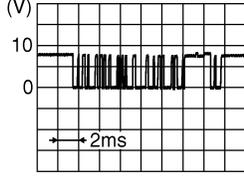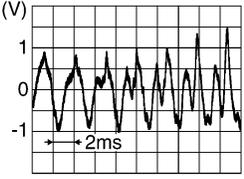Terminal (Wire color)		Item	Signal input/ output	Condition		Reference value
+	-			Ignition switch	Operation	
24 (R/B)	31 (B/OR)	Voice guidance ON signal*3	Input	ON	Press "VOICE" button	 <small>SKIB0232E</small>
25 (GR)*1 (Y/G)*2	Ground	Remote control ground	—	ON	—	Approx. 0 V
27 (L)	26 (P)	TEL voice signal*1	Input	ON	Receiving the party's voice while using the hands-free phone system.	 <small>SKIB3609E</small>
28 (W/G)	Ground	TEL ON signal*1	Input	ON	When using hands-free phone system	Approx. 0 V
					Except while using hands- free phone system	Approx. 5 V
29	—	Shield*1	—	—	—	—
32 (L/B)	30 (W/B)	Voice guidance signal*3	Input	ON	Press "VOICE" button	 <small>SKIB3597E</small>
34 (B/R)	Ground	Communication signal Tx (AUDIO-SAT)*4	Output	ON	When setting to satellite ra- dio mode	 <small>SKIB7336E</small>
35 (B)	43 (W)	Satellite radio audio signal RH*4	Input	ON	Receive satellite radio audio signal	 <small>SKIB3609E</small>

AUDIO


< SERVICE INFORMATION >

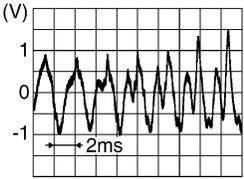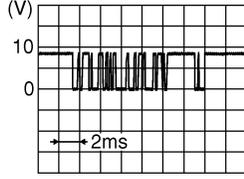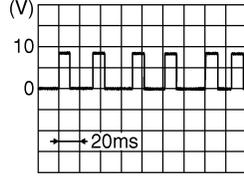Terminal (Wire color)		Item	Signal input/ output	Condition		Reference value
+	-			Ignition switch	Operation	
36 (R)	44 (G)	Satellite radio audio signal LH*4	Input	ON	Receive satellite radio audio signal	 <small>SKIB3609E</small>
38 (W/R)	Ground	Communication signal Rx (SAT-AUDIO)*4	Input	ON	When setting to satellite ra- dio mode	 <small>SKIB7337E</small>
39 (L)	Ground	Communication signal REQ (SAT-AUDIO)*4	Input	ON	When setting to satellite ra- dio mode	 <small>SKIB7338E</small>
41	—	Shield*4	—	—	—	—
42	—	Shield*4	—	—	—	—

- *1: With telephone system
- *2: Without telephone system
- *3: With navigation system
- *4: With satellite radio







Terminal and Reference Value for BOSE Speaker Amp

INFOID:000000004657373

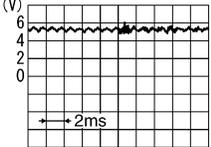Terminal (Wire color)		Item	Signal input/ output	Condition		Reference value
+	-			Ignition switch	Operation	
11 (Y)	Ground	Battery power supply	Input	ON	—	Battery voltage
14	—	Shield	—	—	—	—
17 (R/B)	18 (R/W)	Microphone signal	Input	ON	When inputting some sounds (voice, etc.) toward the microphone	 <small>PKIA2104E</small>




AUDIO

< SERVICE INFORMATION >

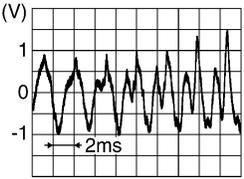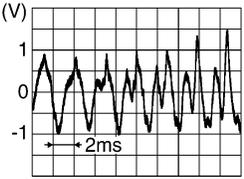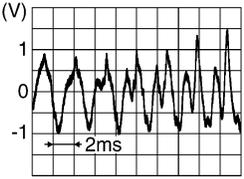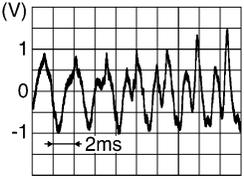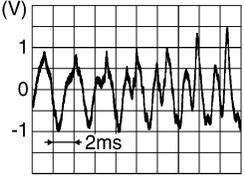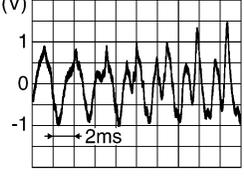Terminal (Wire color)		Item	Signal input/ output	Condition		Reference value
+	-			Ignition switch	Operation	
19 (W/R)	20 (OR/B)	Audio signal rear LH	Output	ON	Receive audio signal	 SKIB3609E
21 (GY/R)	22 (GY)	Audio signal rear RH	Output	ON	Receive audio signal	 SKIB3609E
23 (B/W)	24 (W/G)	Audio signal front LH	Output	ON	Receive audio signal	 SKIB3609E
25 (BR)	26 (B/R)	Audio signal front RH	Output	ON	Receive audio signal	 SKIB3609E
27 (B)	Ground	Ground	—	ON	—	Approx. 0 V
28 (W)	12 (OR)	Audio signal woofer	Output	ON	Receive audio signal	 SKIB3609E
31 (Y/R)	Ground	AudioPilot® ON/OFF signal	Input	ON	AudioPilot® OFF	Approx. 7.5 V
					AudioPilot® ON	Approx. 0 V
32 (G/R)	Ground	Woofer amp. ON signal	Output	ON	—	Approx. 12 V
34 (L)	33 (P)	Audio signal rear RH	Input	ON	Receive audio signal	 SKIB3609E



AUDIO

< SERVICE INFORMATION >

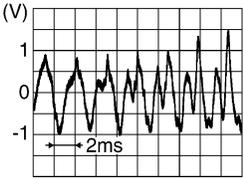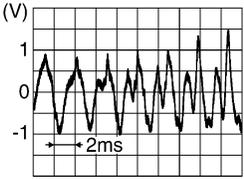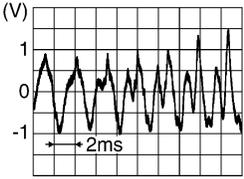Terminal (Wire color)		Item	Signal input/ output	Condition		Reference value
+	-			Ignition switch	Operation	
36 (L/G)	35 (L/Y)	Audio signal rear LH	Input	ON	Receive audio signal	 SKIB3609E
38 (G)	37 (R)	Audio signal front RH	Input	ON	Receive audio signal	 SKIB3609E
40 (LG)	39 (PU)	Audio signal front LH	Input	ON	Receive audio signal	 SKIB3609E
41 (G/Y)	Ground	BOSE speaker amp. ON signal	Input	ON	—	Approx. 12 V

Terminal and Reference Value for Woofer Amp

INFOID:0000000004657374




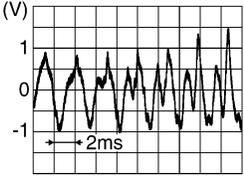
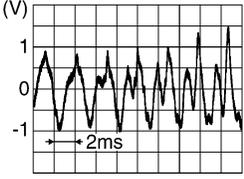
Terminal (Wire color)		Item	Signal input/ output	Condition		Reference value
+	-			Ignition switch	Operation	
2 (W)	1 (OR)	Audio signal woofer	Input	ON	Receive audio signal	 SKIB3609E
4 (L)	3 (Y)	Audio signal woofer	Output	ON	Receive audio signal	 SKIB3609E
6 (G/R)	Ground	Woofer amp. ON signal	Input	ON	—	Approx. 12 V
7 (B)	Ground	Ground	—	ON	—	Approx. 0 V
8 (G)	Ground	Battery power supply	Input	OFF	—	Battery voltage

AUDIO

< SERVICE INFORMATION >

Terminal and Reference Value for Satellite Radio Tuner

INFOID:000000004657375

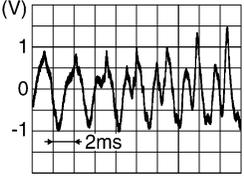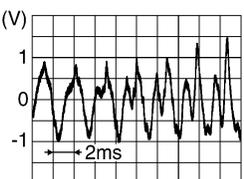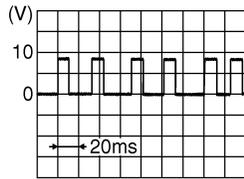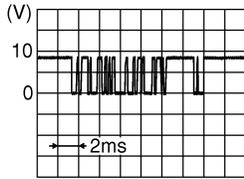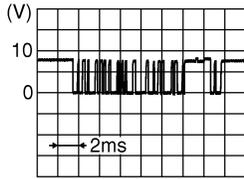Terminal (Wire color)		Item	Signal input/ output	Condition		Reference value
+	-			Ignition switch	Operation	
22 (R)	21 (G)	Satellite radio audio signal LH	Output	ON	Receive satellite radio audio signal	 <p style="text-align: right; font-size: small;">SKIB3609E</p>
24 (B)	23 (W)	Satellite radio audio signal RH	Output	ON	Receive satellite radio audio signal	 <p style="text-align: right; font-size: small;">SKIB3609E</p>
25	—	Shield	—	—	—	—
26	—	Shield	—	—	—	—
28 (L)	Ground	Communication signal REQ (SAT-AUDIO)	Output	ON	When setting to satellite ra- dio mode	 <p style="text-align: right; font-size: small;">SKIB7338E</p>
29 (OR/L)	Ground	Communication signal Tx (SAT-AUDIO)	Output	ON	When setting to satellite ra- dio mode	 <p style="text-align: right; font-size: small;">SKIB7337E</p>
30 (W/L)	Ground	Communication signal Rx (AUDIO-SAT)	Input	ON	When setting to satellite ra- dio mode	 <p style="text-align: right; font-size: small;">SKIB7336E</p>
32 (BR/Y)	Ground	Battery power supply	Input	OFF	—	Battery voltage
36 (P/B)	Ground	ACC power supply	Input	ACC	—	Battery voltage
40	—	Satellite radio antenna	—	—	—	—

Trouble Diagnosis

INFOID:000000004657376

- The majority of the audio malfunctions are the result of outside causes (bad CD, electromagnetic interference, etc.). Check the symptoms below to diagnose the malfunction.

AUDIO

< SERVICE INFORMATION >

- The vehicle itself can be a source of noise if noise prevention parts or electrical equipment is malfunctioning. Check if noise is caused and/or changed by engine speed, ignition switch turned to each position, and operation of each piece of electrical equipment, and then determine the cause.
- Refer to "SERVICE BULLETIN NTB04-119" for the diagnosis of satellite radio.

Symptom	Possible malfunction location
Audio system does not work properly.	<ul style="list-style-type: none"> • Audio unit power supply circuit • Audio unit
No sound can be heard from all speakers.	Base system <ul style="list-style-type: none"> • Audio unit
	BOSE system <ul style="list-style-type: none"> • BOSE speaker amp. power supply and ground circuit • BOSE speaker amp. ON signal circuit • Audio unit • BOSE speaker amp.
No sound can be heard from one or several speakers.	Base system <ul style="list-style-type: none"> • Audio signal circuit between audio unit and speaker • Speaker • Tweeter • Audio unit
	BOSE system <ul style="list-style-type: none"> • Audio signal circuit between audio unit and BOSE speaker amp. • Audio signal circuit between BOSE speaker amp. and speaker • Speaker • Tweeter • Audio unit • BOSE speaker amp.
No sound can be heard from woofer.	<ul style="list-style-type: none"> • Woofer amp. power supply and ground circuit • Woofer amp. ON signal circuit • Audio signal circuit between BOSE speaker amp. and woofer • Audio signal circuit between woofer amp. and woofer • Woofer • Woofer amp. • BOSE speaker amp.
No sound can be heard from radio or noise is caught.	<ul style="list-style-type: none"> • Antenna amp. ON signal circuit • Antenna feeder • Antenna • Antenna amp. • Audio unit
None of the steering switch operations work	<ul style="list-style-type: none"> • TEL adapter unit control signal 1 circuit • Steering switch signal ground circuit

NOTE:

Noise resulting from variations in field strength, such as fading noise and multi-path noise, or external noise from trains and other sources. It is not a malfunction.

- Fading noise: This noise occurs because of variations in the field strength in a narrow range due to mountains or buildings blocking the signal.
- Multi-path noise: This noise results from a time difference between the broadcast waves directly from the station arriving at the antenna and the waves reflected by mountains or buildings.

Power Supply Circuit Inspection

INFOID:000000004657377

1. CHECK FUSE

Make sure that the following fuses of the audio unit, BOSE speaker amp. and woofer amp. are not blown.

Unit	Signal	Fuse No.
Audio unit	Battery power supply	37
	Ignition switch ACC or ON	6

AUDIO

< SERVICE INFORMATION >

Unit	Signal	Fuse No.
BOSE speaker amp.	Battery power supply	37
Woofer amp.	Battery power supply	17

OK or NG


OK >> GO TO 2.

NG >> If fuse is blown, be sure to eliminate cause of malfunction before installing new fuse. Refer to [PG-4](#).

2. CHECK POWER SUPPLY CIRCUIT


1. Check voltage between audio unit harness connector terminals and ground.

Unit	Terminals		OFF	ACC	ON	
	(+)					
	Connector	Terminal				
Audio unit	M40	6	Ground	Battery voltage	Battery voltage	Battery voltage
		10	Ground	0 V	Battery voltage	Battery voltage

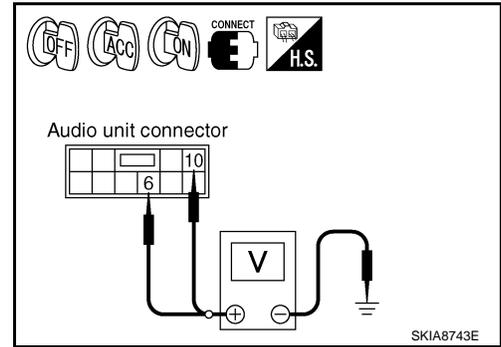

2. Check voltage between BOSE speaker amp., woofer amp. harness connector terminals and ground (BOSE system).

Unit	Terminals		OFF	ACC	ON	
	(+)					
	Connector	Terminal				
BOSE speaker amp.	T6	11	Ground	Battery voltage	Battery voltage	Battery voltage
Woofer amp.	B32	8				

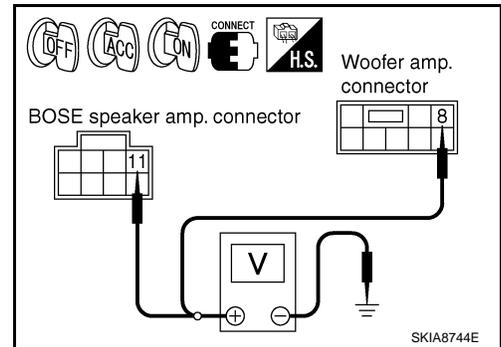

OK or NG

OK >> • INSPECTION END (Base system)
• GO TO 3 (BOSE system).

NG >> Repair harness or connector.

3. CHECK GROUND CIRCUIT

1. Turn ignition switch OFF.
2. Disconnect BOSE speaker amp. and woofer amp. connectors.
3. Check continuity between BOSE speaker amp. harness connector T6 terminal 27 and ground.

27 – Ground : Continuity should exist.


4. Check continuity between woofer amp. harness connector B32 terminal 7 and ground.

7 – Ground : Continuity should exist.

OK or NG

OK >> INSPECTION END

NG >> Repair harness or connector.

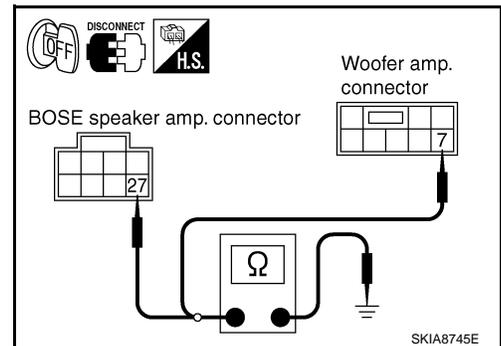

Steering Switch Does Not Operate

INFOID:000000004657378


1. CHECK STEERING SWITCH RESISTANCE

AUDIO

< SERVICE INFORMATION >

1. Turn ignition switch OFF.
2. Disconnect combination switch (spiral cable) connector.
3. Check resistance between steering switch harness connector M203 terminals.

Terminal	Signal name	Condition	Resistance (Ω)
16	Power	Press and hold POWER switch.	Approx. 0
	Seek down	Press and hold SEEK DOWN switch.	Approx. 165
	Volume down	Press and hold VOLUME DOWN switch.	Approx. 652
20	Mode	Press and hold MODE switch.	Approx. 0
	Seek up	Press and hold SEEK UP switch.	Approx. 165
	Volume up	Press and hold VOLUME UP switch.	Approx. 652

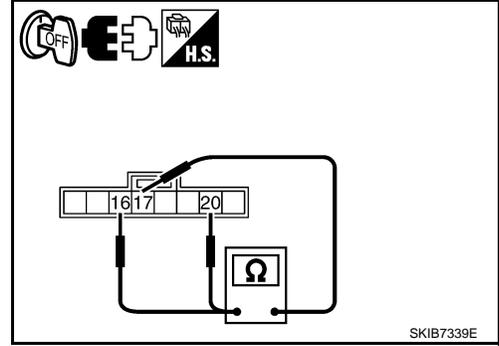

OK or NG

- OK >> GO TO 2.
 NG >> Replace steering switch.

2. CHECK SPIRAL CABLE

1. Disconnect combination switch (spiral cable) connector.
2. Check continuity between combination switch (spiral cable) connector (A) terminals 16, 17, 20 and connector (B) terminals 32, 31, 24.

- 16 – 32 : Continuity should exist.**
17 – 31 : Continuity should exist.
20 – 24 : Continuity should exist.

OK or NG

- OK >> GO TO 3.
 NG >> Replace spiral cable.

3. CHECK HARNESS

Base system

1. Disconnect audio unit connector.
2. Check continuity between audio unit harness connector (A) M46 terminals 21, 22, 23 and combination switch (spiral cable) harness connector (B) M23 terminals 24, 32, 31.



- 21 – 24 : Continuity should exist.**
22 – 32 : Continuity should exist.
23 – 31 : Continuity should exist.

3. Check continuity between audio unit harness connector (A) M46 terminals 21, 22 and ground.

- 21, 22 – Ground : Continuity should not exist.**

BOSE system

1. Disconnect audio unit connector.

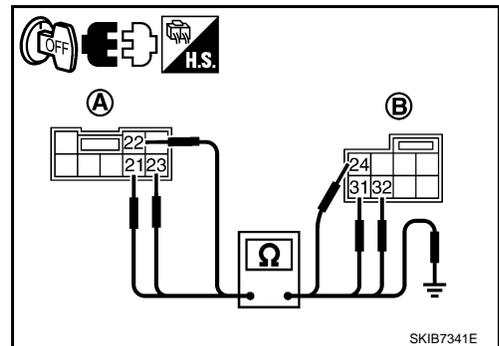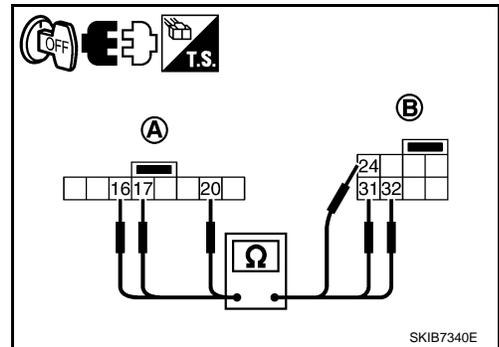

AUDIO


< SERVICE INFORMATION >

- Check continuity between audio unit harness connector (A) M39 terminals 22, 23, 25 and combination switch (spiral cable) harness connector (B) M23 terminals 24, 32, 31.

22 – 24 : Continuity should exist.
23 – 32 : Continuity should exist.
25 – 31 : Continuity should exist.

- Check continuity between audio unit harness connector (A) M39 terminals 22, 23 and ground.

22, 23 – Ground : Continuity should not exist.

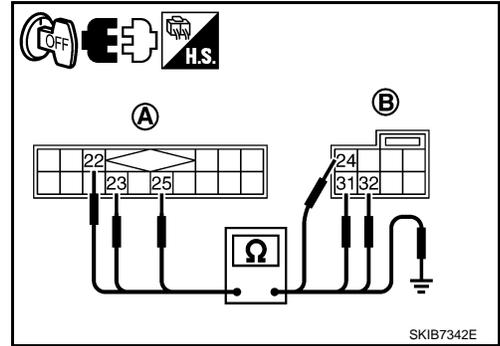

OK or NG

- OK >> Replace audio unit.
- NG >> Repair harness or connector.

AudioPilot® Does Not Work

INFOID:000000004657379

1. CHECK AUDIO UNIT

Check AudioPilot® turns ON.

OK or NG

- OK >> GO TO 2.
- NG >> Turn AudioPilot® ON.


2. CHECK HARNESS

- Turn ignition switch OFF.
- Disconnect audio unit and BOSE speaker amp. connectors.
- Check continuity between audio unit harness connector M39 terminal 17 and BOSE speaker amp. harness connector T7 terminal 31.

17 – 31 : Continuity should exist.

- Check continuity between audio unit harness connector M39 terminal 17 and ground.

17 – Ground : Continuity should not exist.

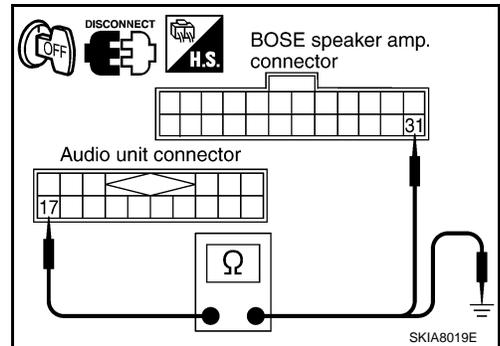

OK or NG

- OK >> GO TO 3.
- NG >> Repair harness or connector.


3. CHECK AUDIOPILOT® SIGNAL

- Connect audio unit and BOSE speaker amp. connectors.
- Turn ignition switch ON.
- Check voltage between audio unit harness connector terminals and ground.

Terminals		Condition	Voltage
(+)	(-)		
Connector	Terminal		
M39	17	AudioPilot® OFF	Approx. 7.5 V
		AudioPilot® ON	Approx. 0 V

OK or NG

- OK >> GO TO 4.
- NG >> Replace audio unit.

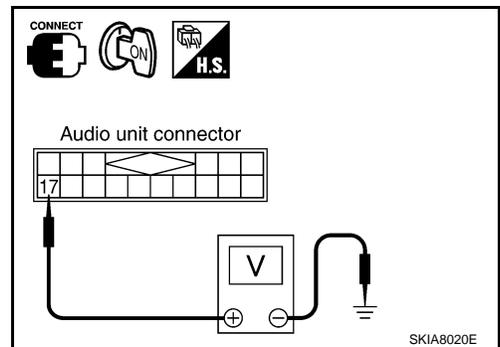

AUDIO

< SERVICE INFORMATION >

4. CHECK HARNESS

1. Turn ignition switch OFF
2. Disconnect BOSE speaker amp. and microphone connectors.
3. Check continuity between BOSE speaker amp. harness connector T7 terminal 17 and microphone harness connector E123 terminal 1.

17 – 1 : Continuity should exist.


4. Check continuity between BOSE speaker amp. harness connector T7 terminal 17 and ground.

17 – Ground : Continuity should not exist.

OK or NG

OK >> GO TO 5.

NG >> Repair harness or connector.

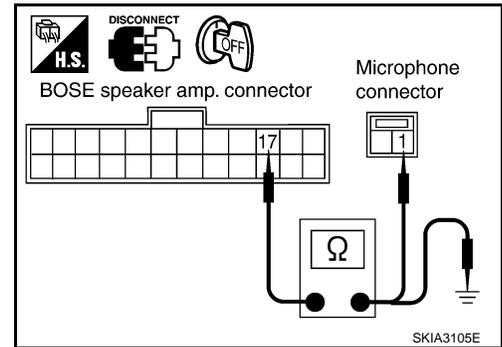

5. CHECK HARNESS

1. Check continuity between BOSE speaker amp. harness connector T7 terminal 18 and microphone harness connector E123 terminal 2.

18 – 2 : Continuity should exist.


2. Check continuity between BOSE speaker amp. harness connector T7 terminal 18 and ground.

18 – Ground : Continuity should not exist.

OK or NG

OK >> GO TO 6.


NG >> Repair harness or connector.

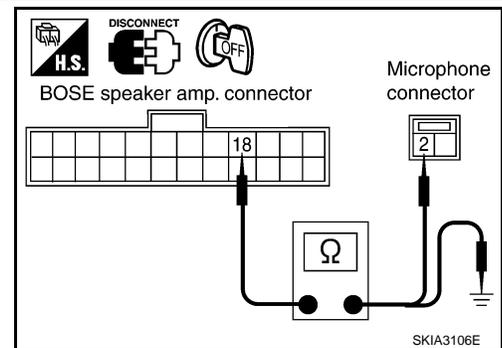


6. CHECK MICROPHONE SIGNAL

1. Connect BOSE speaker amp. and microphone connectors.
2. Turn ignition switch ON.
3. Check voltage waveform between BOSE speaker amp. harness connector T7 terminal 17 and 18 using oscilloscope, when inputting some sounds (voice, etc.) toward the microphone.

17 – 18:

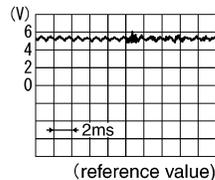

PKIA2104E

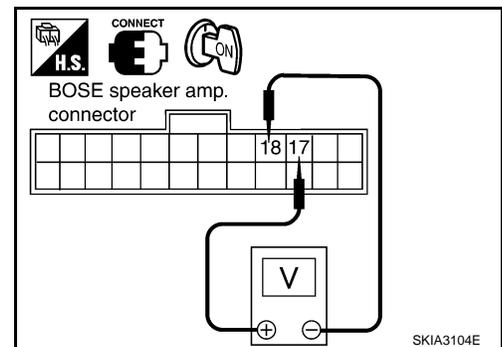

Does the voltage waveform change with sounds?

YES >> Replace BOSE speaker amp.

NO >> Replace microphone.

Removal and Installation of Audio Unit (Base system)

INFOID:000000004657380


REMOVAL

1. Remove cluster lid C. Refer to [IP-12](#).


AUDIO

< SERVICE INFORMATION >

2. Remove screws (A), and remove audio unit (1).

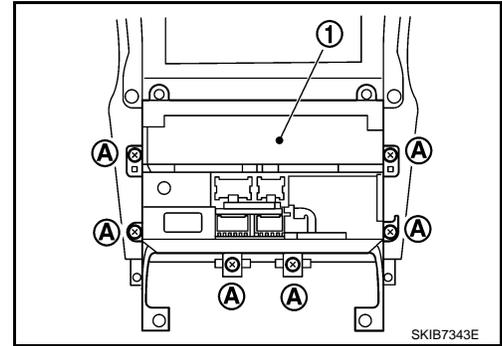

3. Remove screws (8), and remove bracket.

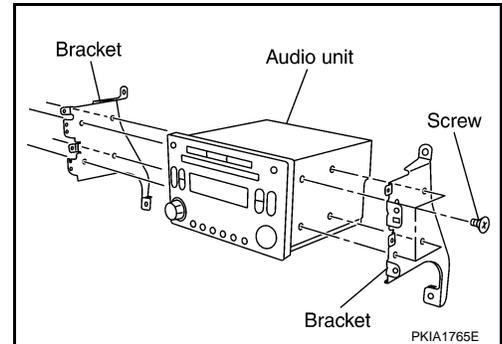

INSTALLATION

Installation is the reverse order of removal.

Locking CD Auto Changer Mechanism (Audio unit of BOSE system)

INFOID:0000000004657381

CAUTION:

- Prior to removing a malfunctioning CD auto changer unit (Audio unit of BOSE system) that will be shipped for repair, the changer mechanism **MUST BE LOCKED** to prevent the mechanism from being damaged during shipping.
- If a CD is jammed or unable to be removed from the unit, do **NOT** lock the changer mechanism. If the unit is to be shipped for repair, carefully package the unit to prevent vibration and shock.

DAMPER LOCK PROCEDURE

1. Eject and remove any CDs from the audio unit (BOSE system).
2. Turn ignition switch OFF. Wait until audio unit (BOSE system) display is off and mechanism stops moving (mechanism sound stops).
3. Press any one of the disc selection buttons once. When a display shows on the audio unit (BOSE system), press the same disc selection button again within 5 seconds.
 - The changer mechanism will lock itself within 10 seconds.
4. After mechanism stops moving (mechanism sound stops), open the driver and passenger window, and then disconnect negative battery cable.

CAUTION:

After the battery cables are disconnected, do not open/close the driver and/or front passenger door with the window in the full up position. The automatic window adjusting function will not work and the side roof panel may be damaged.

NOTE:

After installing a new or remanufactured audio unit (BOSE system), switching the audio unit (BOSE system) ON will automatically unlock the mechanism. A special unlocking procedure is not required.

Removal and Installation of Audio Unit (BOSE system)

INFOID:0000000004657382


REMOVAL

1. Perform damper lock operation. Refer to [AV-42. "Locking CD Auto Changer Mechanism \(Audio unit of BOSE system\)"](#).
2. Remove cluster lid C. Refer to [IP-12](#).

AUDIO

< SERVICE INFORMATION >


3. Remove screws (A), and remove audio unit (1).

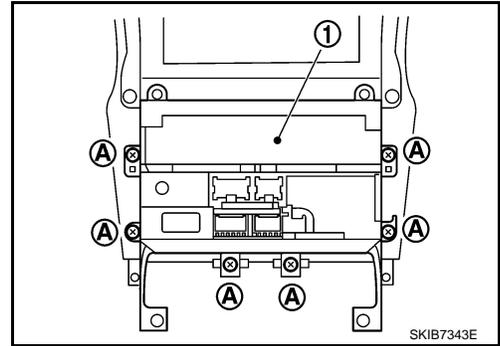

4. Remove screws (8), and remove bracket.

CAUTION:

- When carrying audio unit body, do not touch internal mechanism access from cassette tape slot.
- Be careful not to allow foreign matter from cassette tape slot.

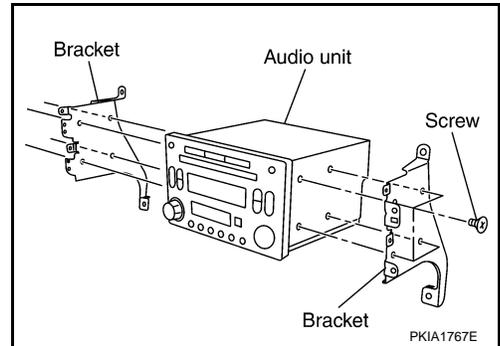

INSTALLATION


Installation is the reverse order of removal.

Removal and Installation of Door Speaker

INFOID:000000004657383

REMOVAL

1. Remove door finisher. Refer to [EI-28, "Removal and Installation"](#).
2. Remove screws (3), and remove door speaker.

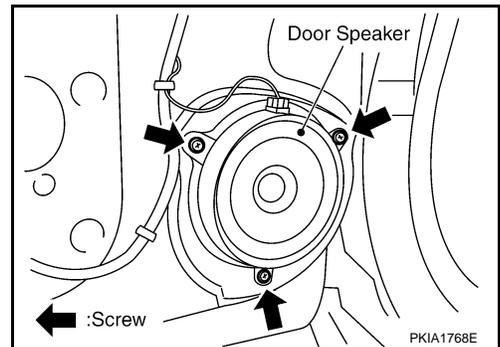

INSTALLATION

Installation is the reverse order of removal.

Removal and Installation of Rear Speaker

INFOID:000000004657384

REMOVAL


1. Remove luggage floor finisher upper (front) (Coupe models), or luggage floor finisher upper (Roadster models). Refer to [EI-34, "Removal and Installation \(for Coupe Models\)"](#), or [EI-36, "Removal and Installation \(for Roadster Models\)"](#).

A
B
C
D
E
F
G
H
I
J
AV
L
M
N
O
P

AUDIO

< SERVICE INFORMATION >

2. Remove screws (4), and remove rear speaker.

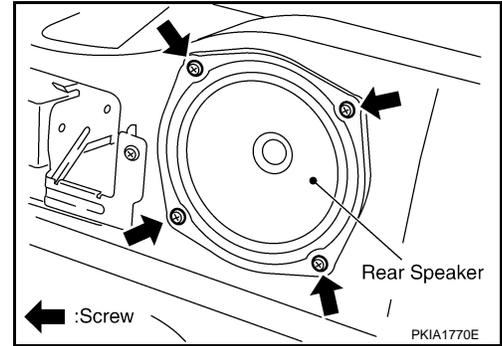

INSTALLATION


Installation is the reverse order of removal.

Removal and Installation of Tweeter

INFOID:000000004657385

REMOVAL

1. Remove corner cover inner. Refer to [GW-73, "Removal and Installation"](#).
2. Remove screws (2), and remove tweeter from corner cover inner.

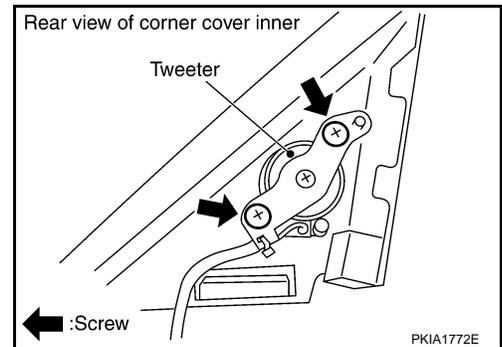

INSTALLATION

Installation is the reverse order of removal.


Removal and Installation of Woofer and Woofer Amp (BOSE System)

INFOID:000000004657386

REMOVAL

Woofer Assembly

1. Remove luggage floor finisher lower. Refer to [EI-34, "Removal and Installation \(for Coupe Models\)"](#), or [EI-36, "Removal and Installation \(for Roadster Models\)"](#).
2. Remove woofer mounting screws (4), and remove woofer.
3. Remove bracket mounting bolts (12), and remove bracket.
4. Remove woofer amp. mounting bolts (2), and remove woofer amp. from bracket.

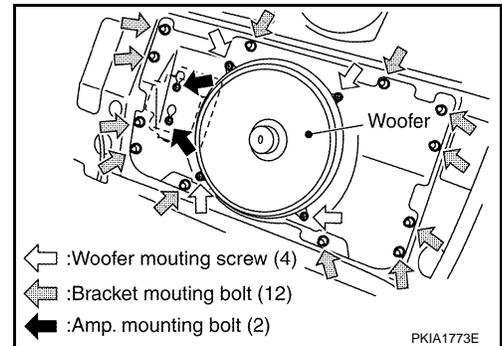

Woofer or Woofer Amp. Only

1. Remove luggage floor finisher mask. Refer to [EI-34, "Removal and Installation \(for Coupe Models\)"](#), or [EI-36, "Removal and Installation \(for Roadster Models\)"](#).
2. Remove woofer mounting screws (4), and remove woofer.
3. Remove woofer amp. mounting bolts (2), and remove woofer amp. from bracket.

INSTALLATION

AUDIO

< SERVICE INFORMATION >

Installation is the reverse order of removal, taking care of the following point.

Bracket mounting bolt




: 9 N·m (0.92 kg·m, 80 in·lb)

Removal and Installation of BOSE Speaker Amp


INFOID:000000004657387

REMOVAL

1. Remove trunk side box. Refer to [EI-34. "Removal and Installation \(for Coupe Models\)"](#), or [EI-44. "Removal and Installation \(for Roadstar Models\)"](#).
2. Remove luggage floor carpet and spare tire cover (Coupe models), or trunk floor carpet and spare tire cover (Roadster models). Refer to [EI-34. "Removal and Installation \(for Coupe Models\)"](#), or [EI-44. "Removal and Installation \(for Roadstar Models\)"](#).
3. Remove nuts (3), and remove BOSE speaker amp. from trunk room floor.

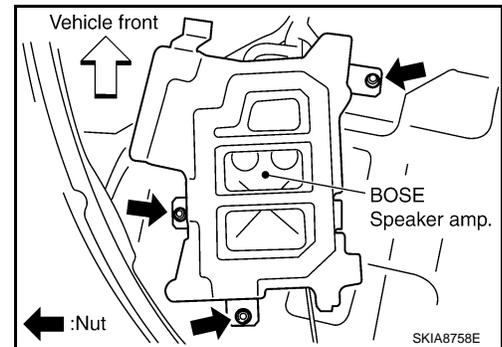

4. Remove bolts (4), and remove bracket.

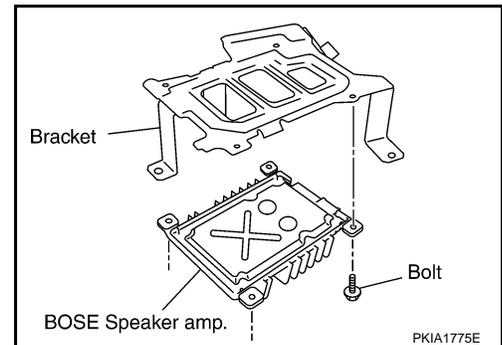

INSTALLATION


Installation is the reverse order of removal.

Removal and Installation of Microphone

INFOID:000000004657388

REMOVAL

1. Remove steering column lower cover. Refer to [IP-12](#).
2. Remove screws (3), and remove microphone.

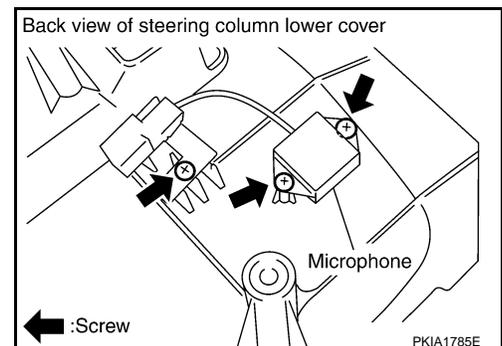

INSTALLATION

Installation is the reverse order of removal.

AUDIO

< SERVICE INFORMATION >


Removal and Installation of Satellite Radio Tuner

INFOID:000000004657389

REMOVAL

↩: Vehicle front

1. Remove trunk side box. Refer to [EI-34. "Removal and Installation \(for Coupe Models\)"](#).
2. Remove luggage floor carpet and spare tire cover. Refer to [EI-34. "Removal and Installation \(for Coupe Models\)"](#).
3. Remove screws (A), and remove satellite radio tuner (1).

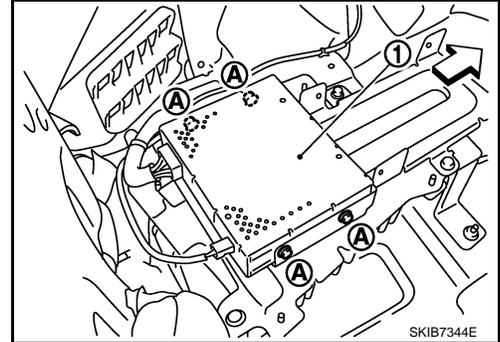

INSTALLATION

Installation is the reverse order of removal.


Removal and Installation of Satellite Radio Antenna

INFOID:000000004657390

REMOVAL

↩: Vehicle front

1. Remove headlining. Refer to [EI-39. "Removal and Installation \(for Coupe Models\)"](#).
2. Remove nut (A), and then disconnect connector (1).
3. Remove satellite radio antenna.

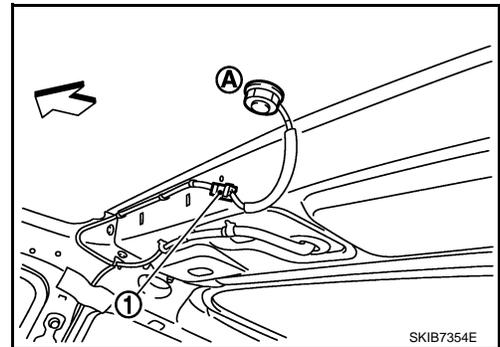

INSTALLATION

Installation is the reverse order of removal.

Roof antenna mounting nut  : 6.0 N-m (0.61 kg-m, 53 in-lb)

ANTENNA

< SERVICE INFORMATION >

ANTENNA

System Description

INFOID:000000004657391

With the ignition switch in ACC or ON, power is supplied

- through 10A fuse [No. 6, located in the fuse block (J/B)]
- to audio unit terminal 10.

Ground is supplied through the case of the antenna amp.

When the radio switch is turned ON, antenna signal is supplied

- through audio unit terminal 5
- to antenna amp. terminal 1.

Then the antenna amp. is activated.

Antenna signals amplified by the antenna amp. are supplied to the audio unit.

A

B

C

D

E

F

G

H

I

J

AV

L

M

N

O

P


ANTENNA

< SERVICE INFORMATION >

Wiring Diagram - M/ANT -


INFOID:000000004657392

AV-M/ANT-01

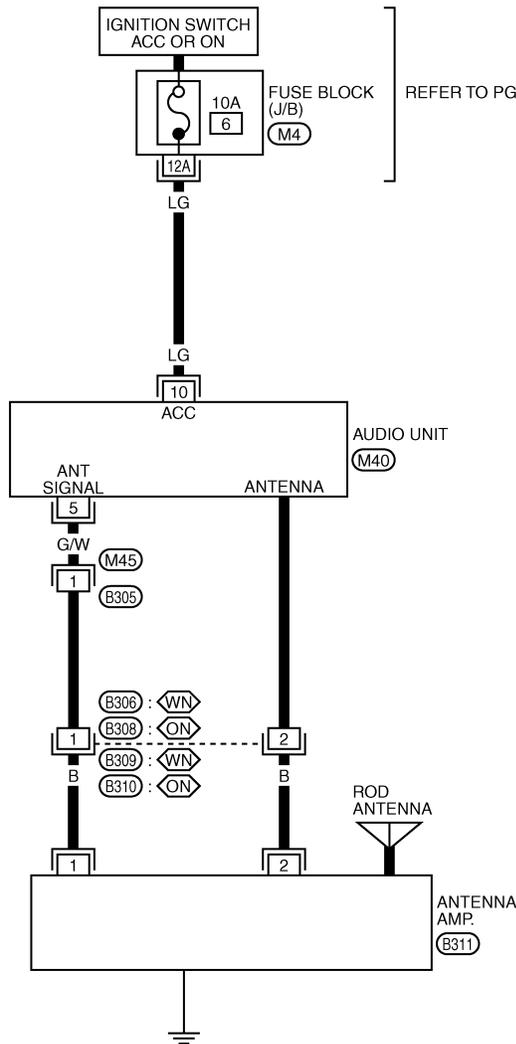

WN : WITH NAVIGATION SYSTEM
ON : WITHOUT NAVIGATION SYSTEM

 REFER TO PG-POWER.



REFER TO THE FOLLOWING.
M4 - FUSE BLOCK-JUNCTION BOX (J/B)

*: THIS CONNECTOR IS NOT SHOWN IN "HARNESS LAYOUT", PG SECTION.


TKWT0509E

ANTENNA

< SERVICE INFORMATION >

Location of Antenna

INFOID:000000004657393

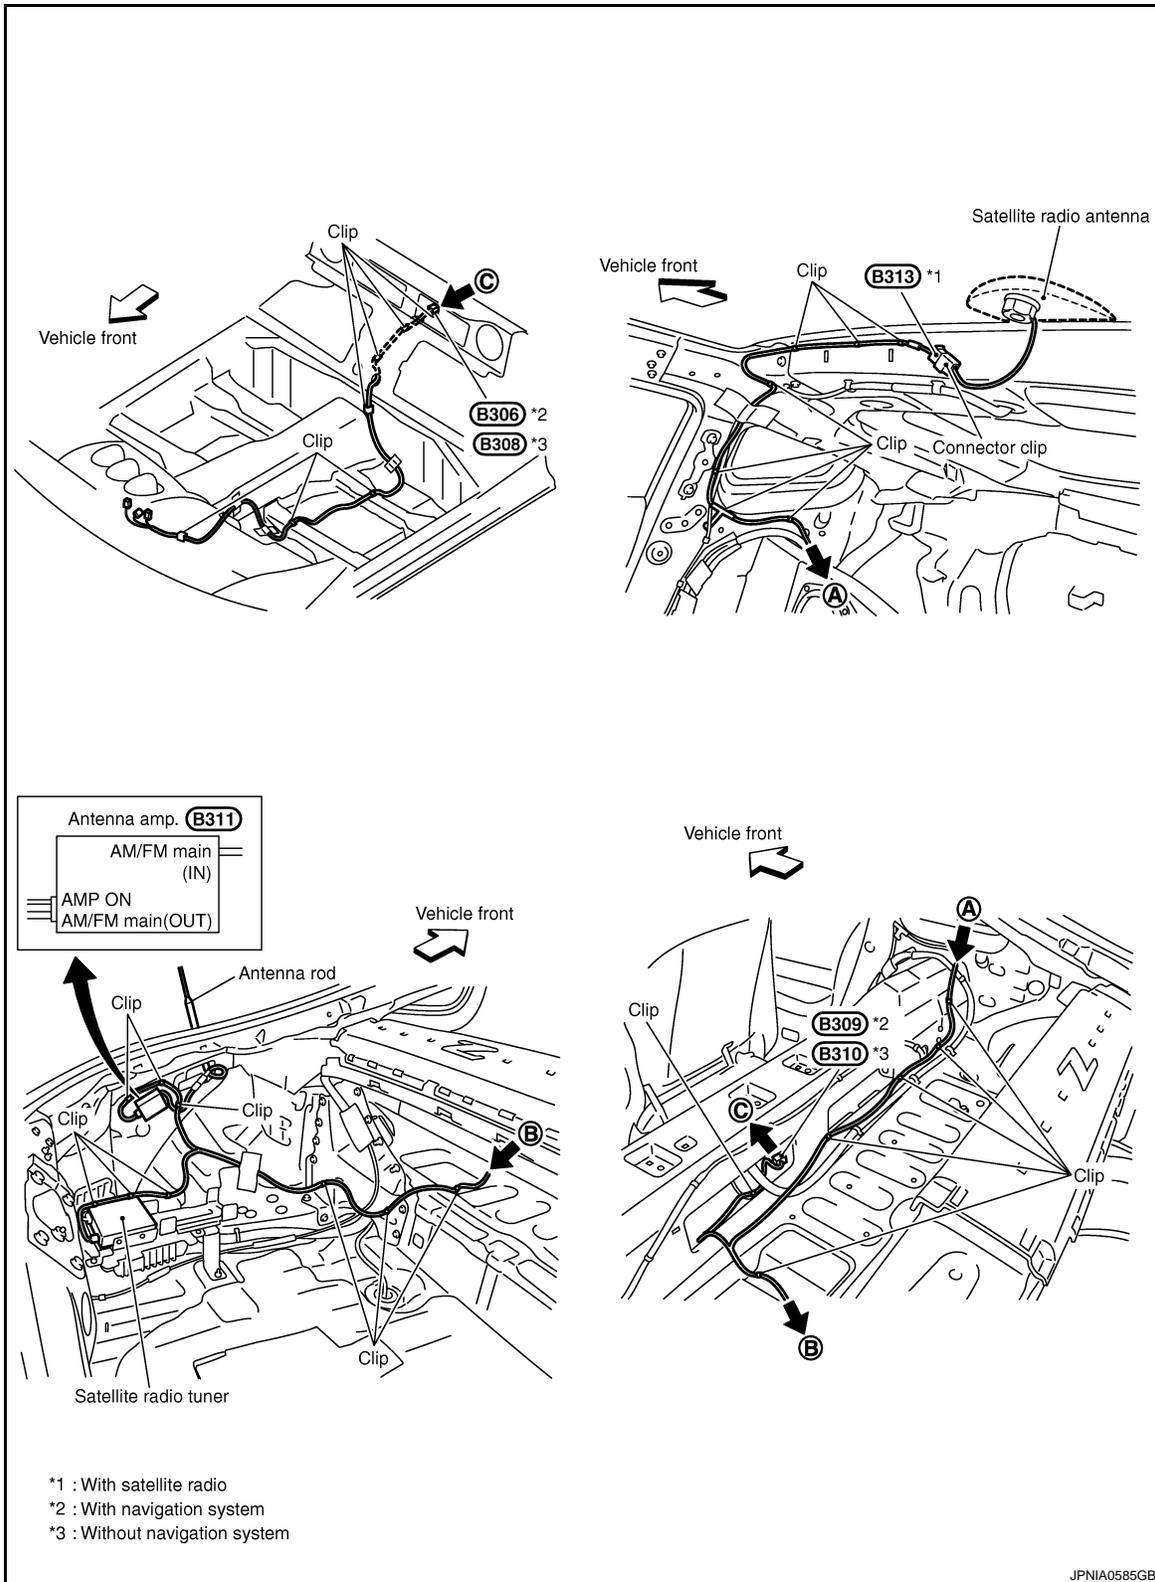

A
B
C
D
E
F
G
H
I
J
AV
L
M
N
O
P

Removal and Installation of Antenna Amp

INFOID:000000004657394


REMOVAL

1. Remove luggage side finisher lower (LH) (Coupe models), or trunk front finisher (Roadster models). Refer to [EI-34, "Removal and Installation \(for Coupe Models\)"](#), or [EI-44, "Removal and Installation \(for Roadstar Models\)"](#).

ANTENNA

< SERVICE INFORMATION >

2. Remove luggage floor carpet and spare tire cover (Coupe models), or trunk floor carpet and spare tire cover (Roadster models). Refer to [EI-34, "Removal and Installation \(for Coupe Models\)"](#), or [EI-44, "Removal and Installation \(for Roadstar Models\)"](#).
3. Remove screw (1), and remove antenna amp.

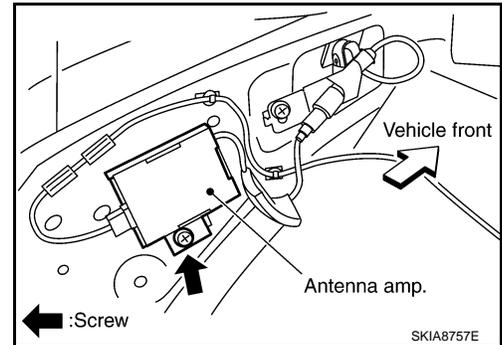


INSTALLATION

Installation is the reverse order of removal.

Removal and Installation of Antenna

INFOID:000000004657395

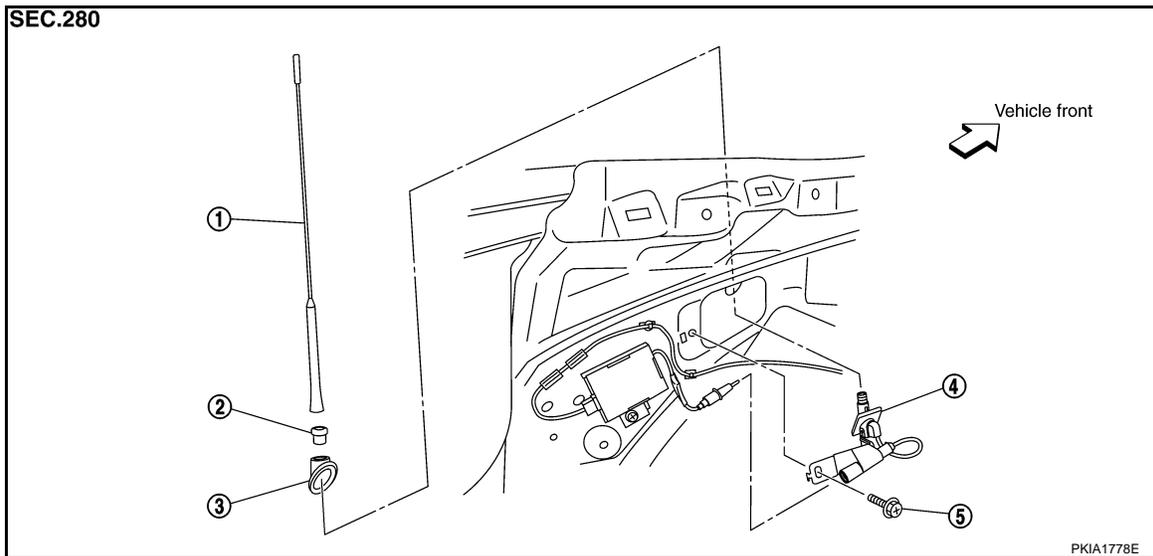

- | | | |
|---------------------|----------------|-----------------|
| 1. Antenna rod | 2. Antenna nut | 3. Antenna base |
| 4. Antenna assembly | 5. Screw | |

REMOVAL

1. Remove luggage side finisher lower (LH) (Coupe models), or trunk front finisher (Roadster models). Refer to [EI-34, "Removal and Installation \(for Coupe Models\)"](#), or [EI-44, "Removal and Installation \(for Roadstar Models\)"](#).
2. Remove antenna rod and remove antenna nut.
3. Disconnect antenna amp. plug.
4. Remove screw and remove antenna assembly.
5. Remove antenna base.

INSTALLATION

Installation is the reverse order of removal.

Removal and Installation of Satellite Radio Antenna

INFOID:000000004657396

Refer to [AV-46, "Removal and Installation of Satellite Radio Antenna"](#).

NAVIGATION SYSTEM

< SERVICE INFORMATION >

NAVIGATION SYSTEM

System Description

INFOID:000000004657397


For Navigation System operation information, refer to Navigation System Owner's Manual.

LOCATION DETECTION PRINCIPLE

The navigation system periodically calculates the vehicle's current position according to the following three signals:


- Travel distance of the vehicle as determined by the vehicle speed sensor
- Turning angle of the vehicle as determined by the gyroscope (angular velocity sensor)
- Direction of vehicle travel as determined by the GPS antenna (GPS information)

The current position of the vehicle is then identified by comparing the calculated vehicle position with map data read from the DVD-ROM, which is stored in the DVD-ROM drive (map-matching), and indicated on the screen as a current-location mark. More accurate data is judged and used by comparing vehicle position detection results found by the GPS with the result by map-matching.

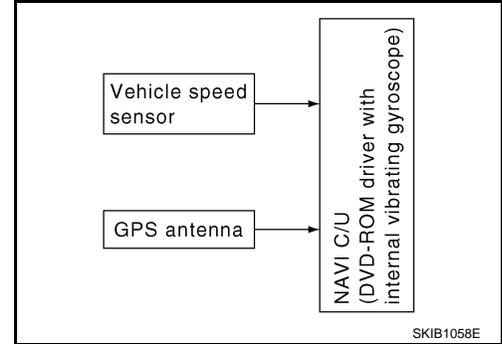

The current vehicle position will be calculated by detecting the distance the vehicle moved from the previous calculation point and its direction.

- Travel distance
Travel distance calculations are based on the vehicle speed sensor input signal. Therefore, the calculation may become incorrect as the tires wear down. To prevent this, an automatic distance correction function has been adopted.
- Travel direction
Change in the travel direction of the vehicle is calculated by a gyroscope (angular velocity sensor) and a GPS antenna (GPS information). They have both advantages and disadvantages.

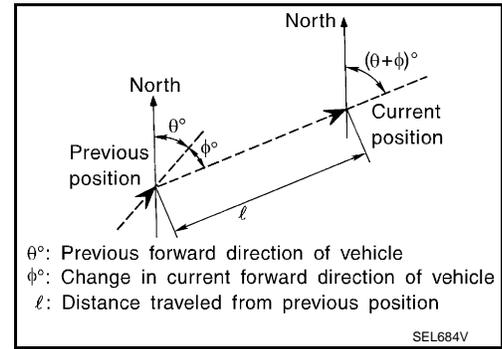

Type	Advantage	Disadvantage
Gyroscope (angular velocity sensor)	Can detect the vehicle's turning angle quite accurately.	Direction errors may accumulate when vehicle is driven for long distances without stopping.
GPS antenna (GPS information)	Can detect the vehicle's travel direction (North/South/East/West).	Correct direction cannot be detected when vehicle speed is low.

A
B
C
D
E
F
G
H
I
J

AV

L
M
N
O
P


More accurate traveling direction is detected because priorities are set for the signals from these two devices according to the situation.

MAP-MATCHING

Map-matching compares a current location detected by the method in the "Location Detection Principle" with a road map data from DVD-ROM stored in DVD-ROM drive.

NOTE:

The road map data is based on data stored in the DVD-ROM.

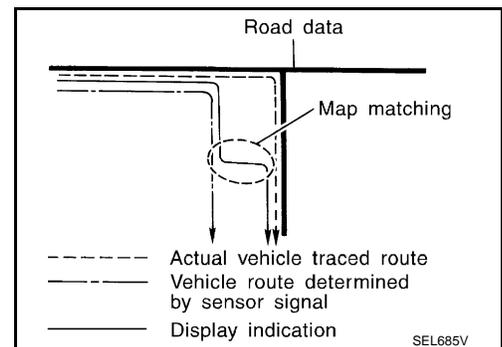

The vehicle position may not be corrected under the following circumstances and after driving for a certain time when GPS information is difficult to receive. In this case, the current-location mark on the display must be corrected manually.


NAVIGATION SYSTEM

< SERVICE INFORMATION >

- In map-matching, alternative routes to reach the destination will be shown and prioritized, after the road on which the vehicle is currently driven has been judged and the current-location mark has been repositioned.

If there is an error in distance and/or direction, alternative routes will be shown in different order of priority, and the incorrect road can be avoided.


If two roads are running in parallel, they are of the same priority. Therefore, the current-location mark may appear on either of them alternately, depending on maneuvering of the steering wheel and configuration of the road.

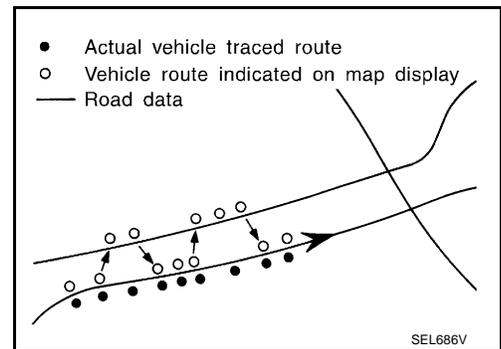

- Map-matching does not function correctly when a road on which the vehicle is driving is new and not recorded in the DVD-ROM, or when road pattern stored in the map data and the actual road pattern are different due to repair.

When driving on a road not present in the map, the map-matching function may find another road and position the current-location mark on it. Then, when the correct road is detected, the current-location mark may change to it.

- Effective range for comparing the vehicle position and travel direction calculated by the distance and direction with the road data read from the DVD-ROM is limited. Therefore, when there is an excessive gap between current vehicle position and the position on the map, correction by map-matching is not possible.

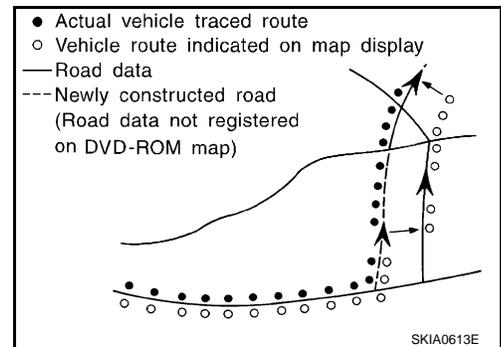

GPS (GLOBAL POSITIONING SYSTEM)

GPS (Global Positioning System) was developed for and is controlled by the US Department of Defense. The system utilizes GPS satellites (NAVSTAR), sending out radio waves while flying on an orbit around the earth at an altitude of approximately 21,000 km (13,100 miles).

The GPS receiver calculates the vehicle's position in three dimensions (latitude/longitude/altitude) according to the time lag of the radio waves received from four or more GPS satellites (three-dimensional positioning). If radio waves were received only from three GPS satellites, the GPS receiver calculates the vehicle's position in two dimensions (latitude/longitude), and utilize the altitude data calculated previously with radio waves from four or more GPS satellites (two-dimensional positioning).


Position correction by GPS is not available while the vehicle is stopped.

Accuracy of GPS will deteriorate under the following conditions:

- In two-dimensional positioning, GPS accuracy will deteriorate when altitude of the vehicle position changes.
- The accuracy can be even lower depending on the arrangement of the GPS satellites utilized for the positioning.
- Position detection is not possible when vehicle is in an area where radio waves from the GPS satellite do not reach, such as in a tunnel, parking lot in a building, and under an elevated highway. Radio waves from the GPS satellites may not be received when some object is located over the GPS antenna.

NOTE:

- Even a high-precision three dimensional positioning, the detection result has an error about 10 m (30ft).
- Because the signals of GPS satellite is controlled by the Tracking and Control Center in the United States, the accuracy may be degraded lower intentionally or the radio waves may stop.

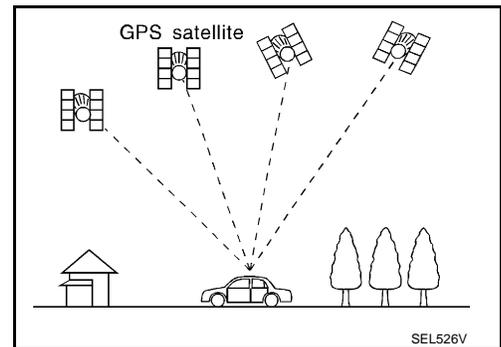

Component Description


INFOID:000000004657398

NAVI CONTROL UNIT

NAVIGATION SYSTEM


< SERVICE INFORMATION >

- NAVI control unit connects to the display unit and NAVI switch with communication lines.
- The gyro (angular speed sensor) and the DVD-ROM drive are built-in units that control the navigation functions.
- Signals are received from the gyro, the vehicle speed sensor, and the GPS antenna. Vehicle location is determined by combining these data with the data contained in the DVD-ROM map. Locations information is shown on display unit.
- NAVI control unit outputs ON signal and voice guidance signal to audio unit.

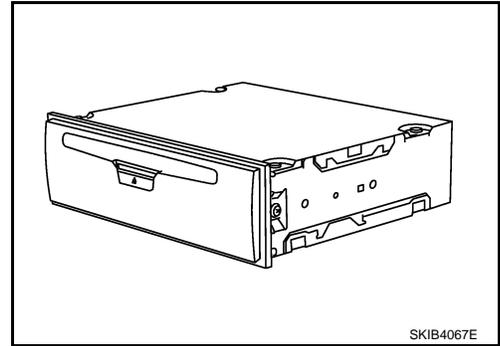

DVD-ROM Drive

Maps, traffic control regulations, and other pertinent information can be easily read from the DVD-ROM (1).

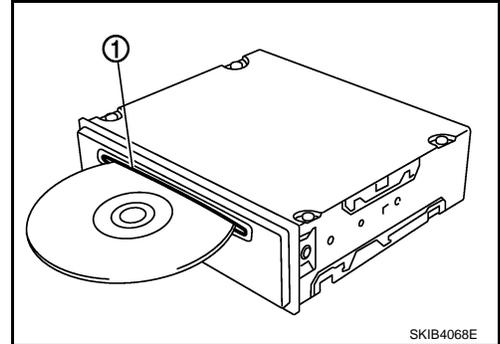

DVD-ROM


- The DVD-ROM has maps, traffic control regulations, and other pertinent information.
- To improve DVD-ROM map matching and route determination functions, the DVD-ROM uses an exclusive Nissan format. Therefore, the use of a DVD-ROM provided by other manufacturers cannot be used.

Gyro (Angular Speed Sensor)

- The oscillator gyro sensor is used to detect changes in vehicle steering angle.
- The gyro is built into the NAVI control unit.


GPS ANTENNA

The GPS antenna receives and amplifies the radio waves from the GPS satellites, and then transmits the GPS signal to NAVI control unit.

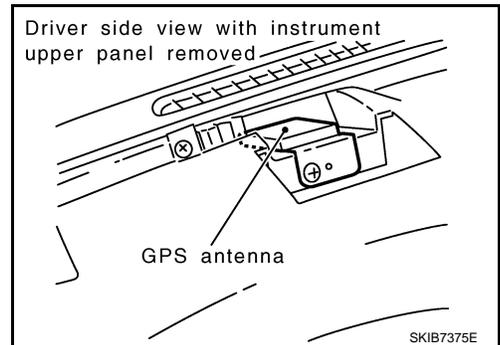

DISPLAY UNIT

- Display unit connects to the NAVI control unit and NAVI switch with communication lines.
- Display unit receives RGB image signal from NAVI control unit, and RGB image is displayed.

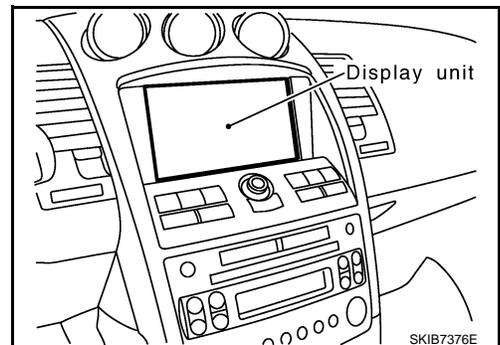


NAVI SWITCH

A
B
C
D
E
F
G
H
I
J
AV
L
M
N
O
P

NAVIGATION SYSTEM


< SERVICE INFORMATION >

- NAVI switch connects to the display unit and NAVI control unit with communication lines.
- Operation signal from NAVI switch is transmitted to NAVI control unit through display unit.

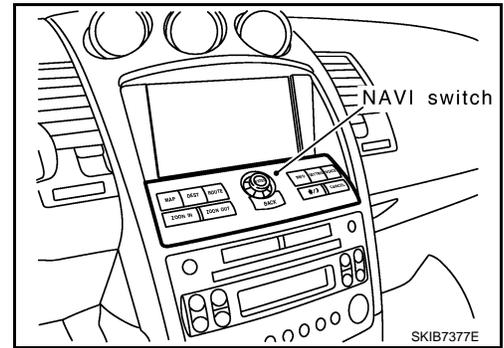

Component Parts Location

INFOID:000000004657399

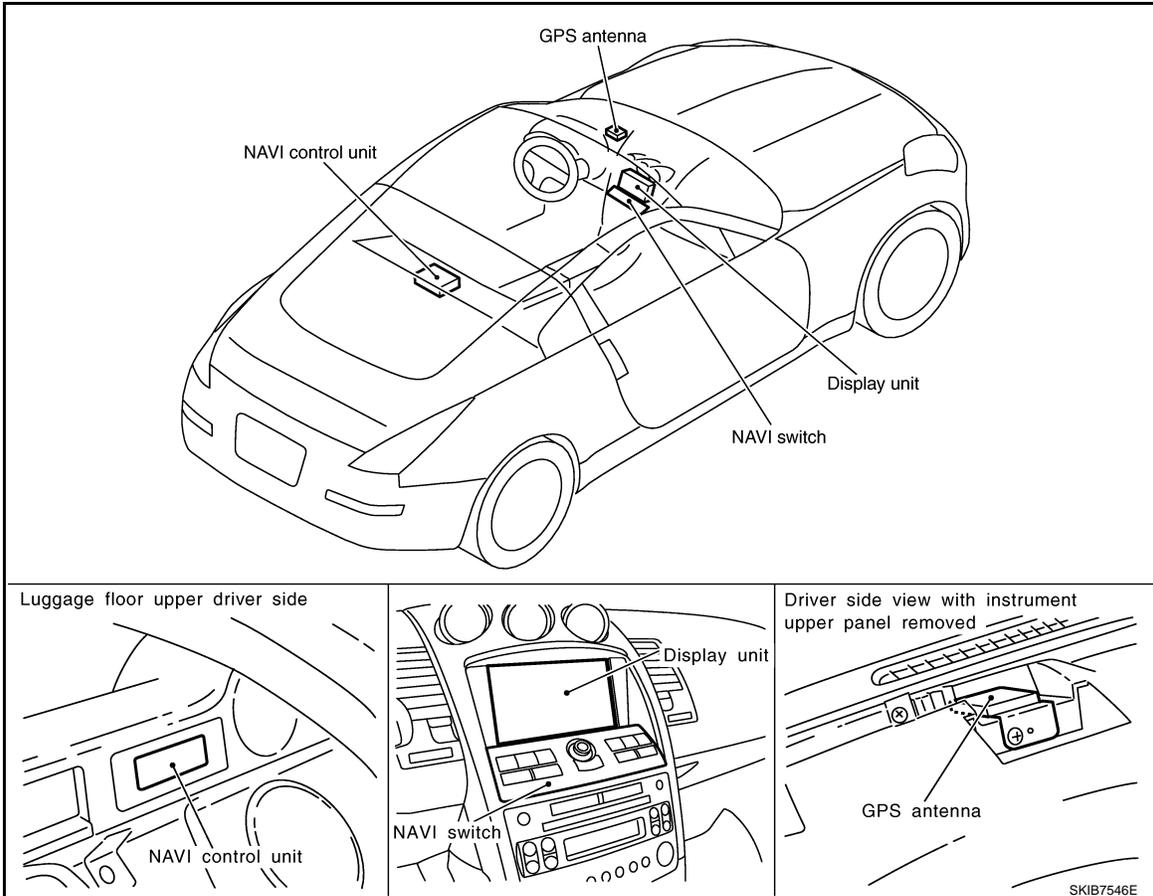


NAVIGATION SYSTEM

< SERVICE INFORMATION >

Schematic

INFOID:000000004657400

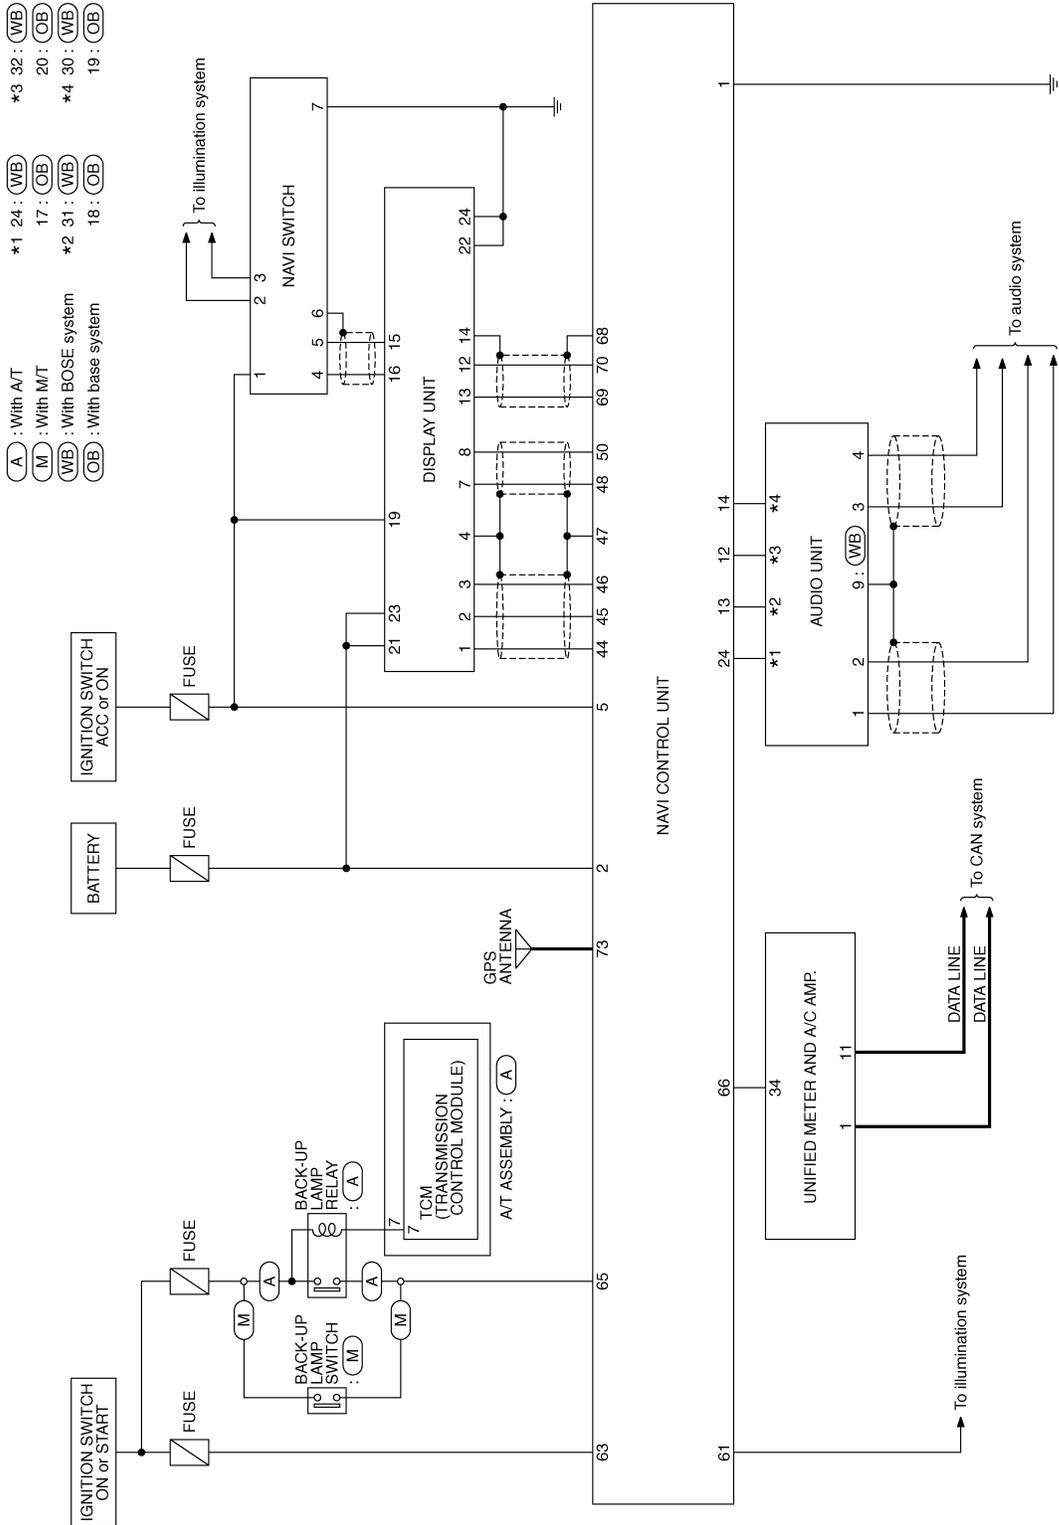

TKWT4081E

A
B
C
D
E
F
G
H
I
J
K
L
M
N
O
P

AV



NAVIGATION SYSTEM

< SERVICE INFORMATION >

Wiring Diagram - NAVI -

INFOID:000000004657401

AV-NAVI-01

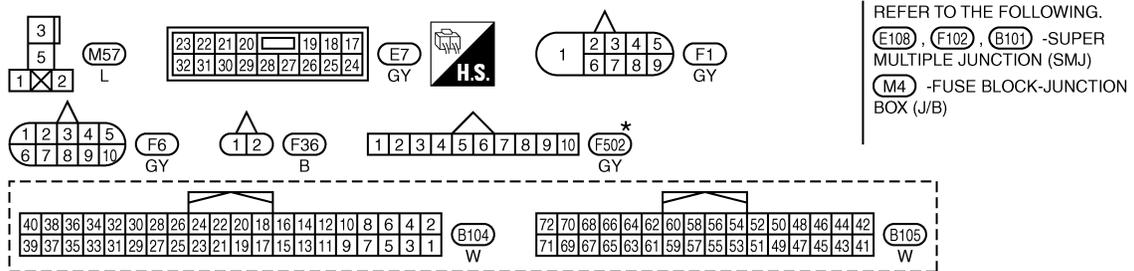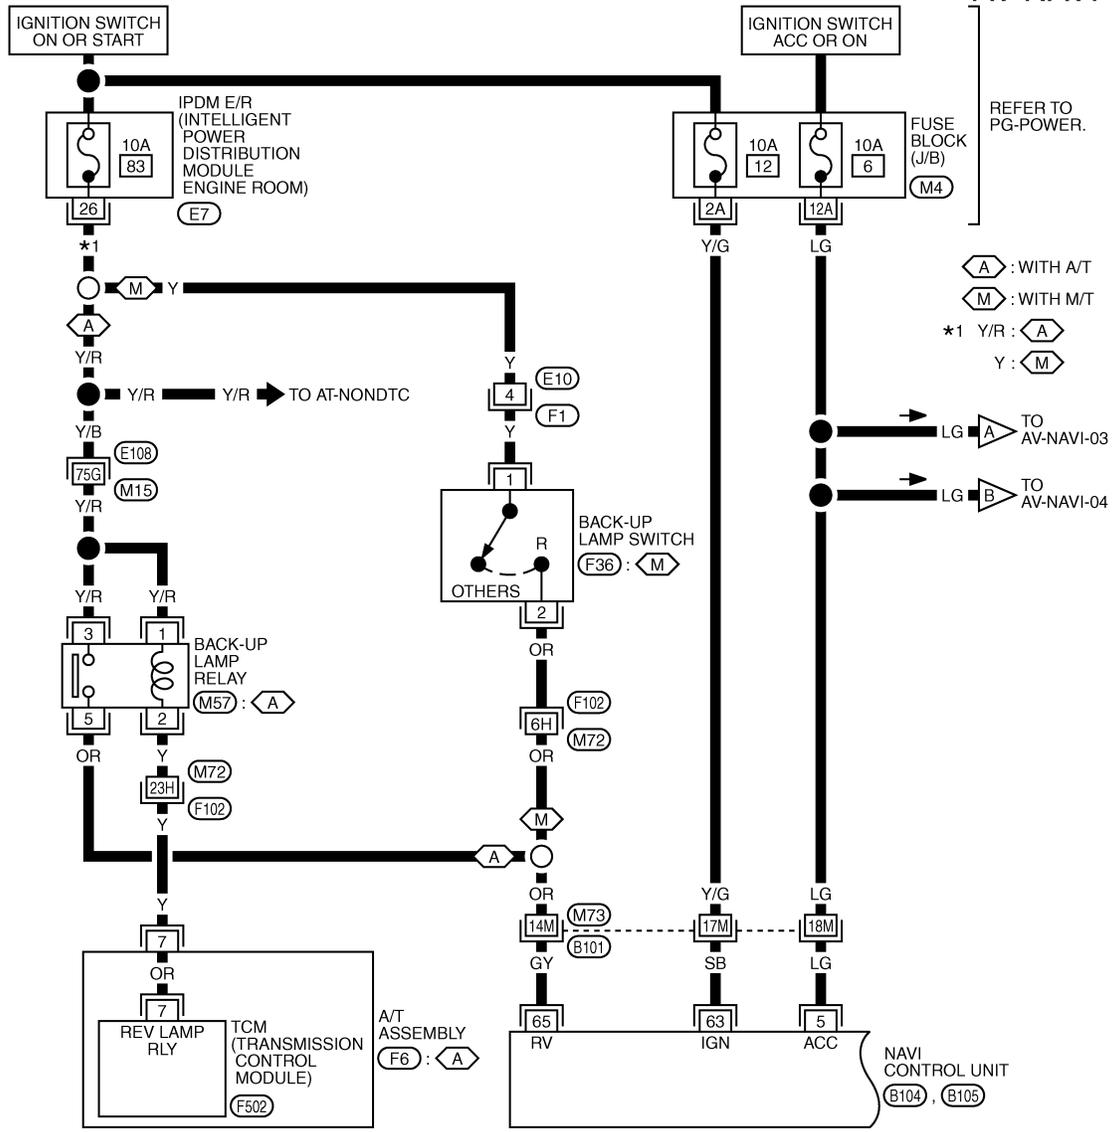



*: THIS CONNECTOR IS NOT SHOWN IN "HARNESS LAYOUT", PG SECTION.

TKWT5803E

NAVIGATION SYSTEM

< SERVICE INFORMATION >

AV-NAVI-02

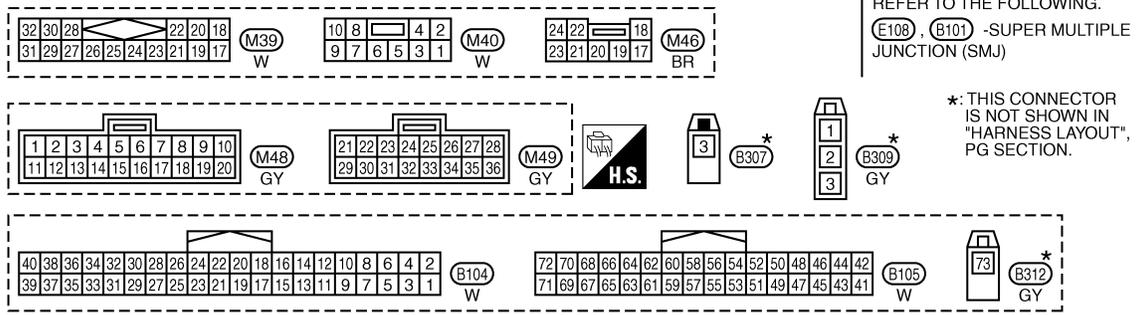
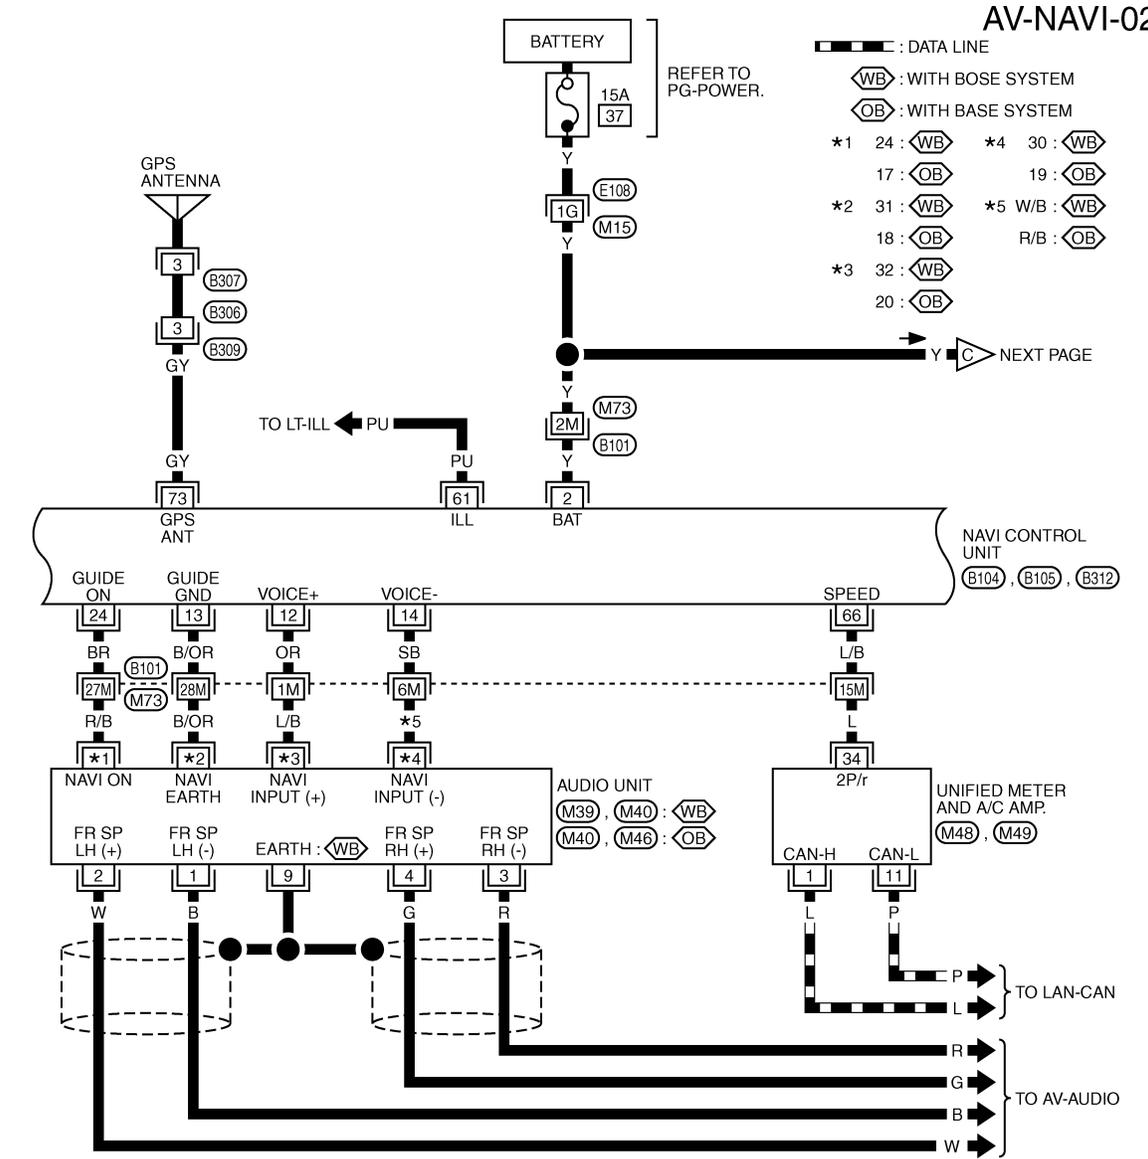


TKWWT5629E

NAVIGATION SYSTEM

< SERVICE INFORMATION >

AV-NAVI-03



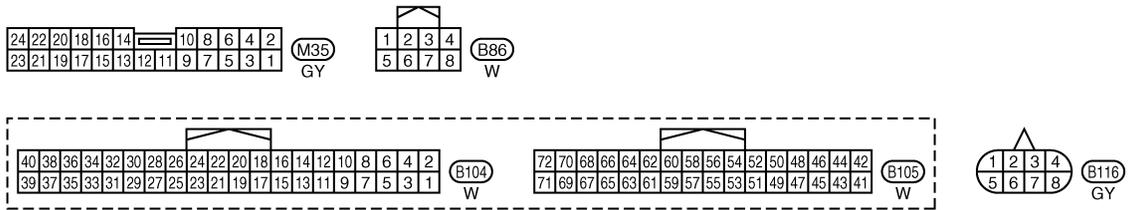
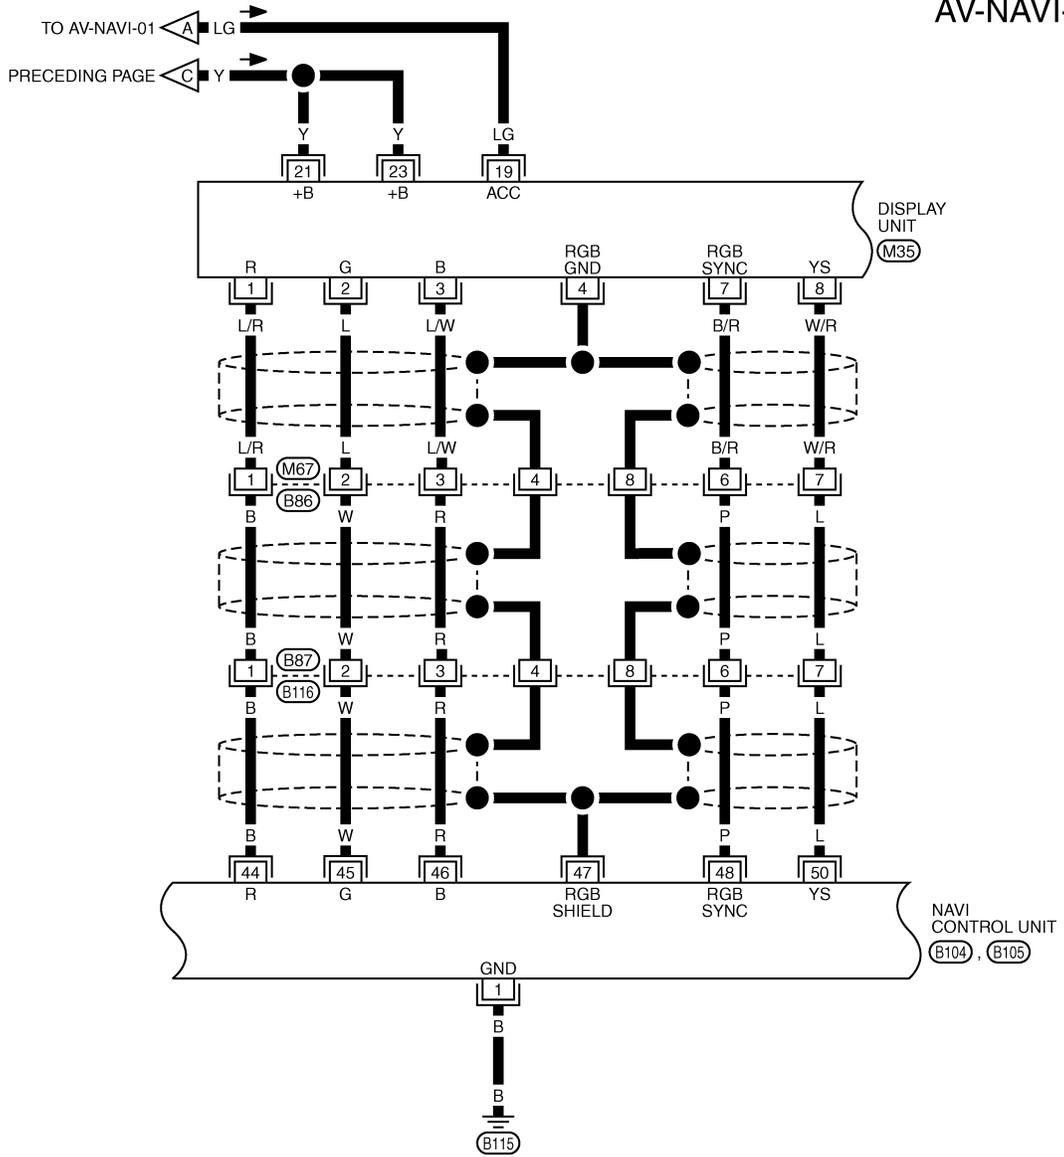


TKWT5804E

NAVIGATION SYSTEM

< SERVICE INFORMATION >

   AV-NAVI-04

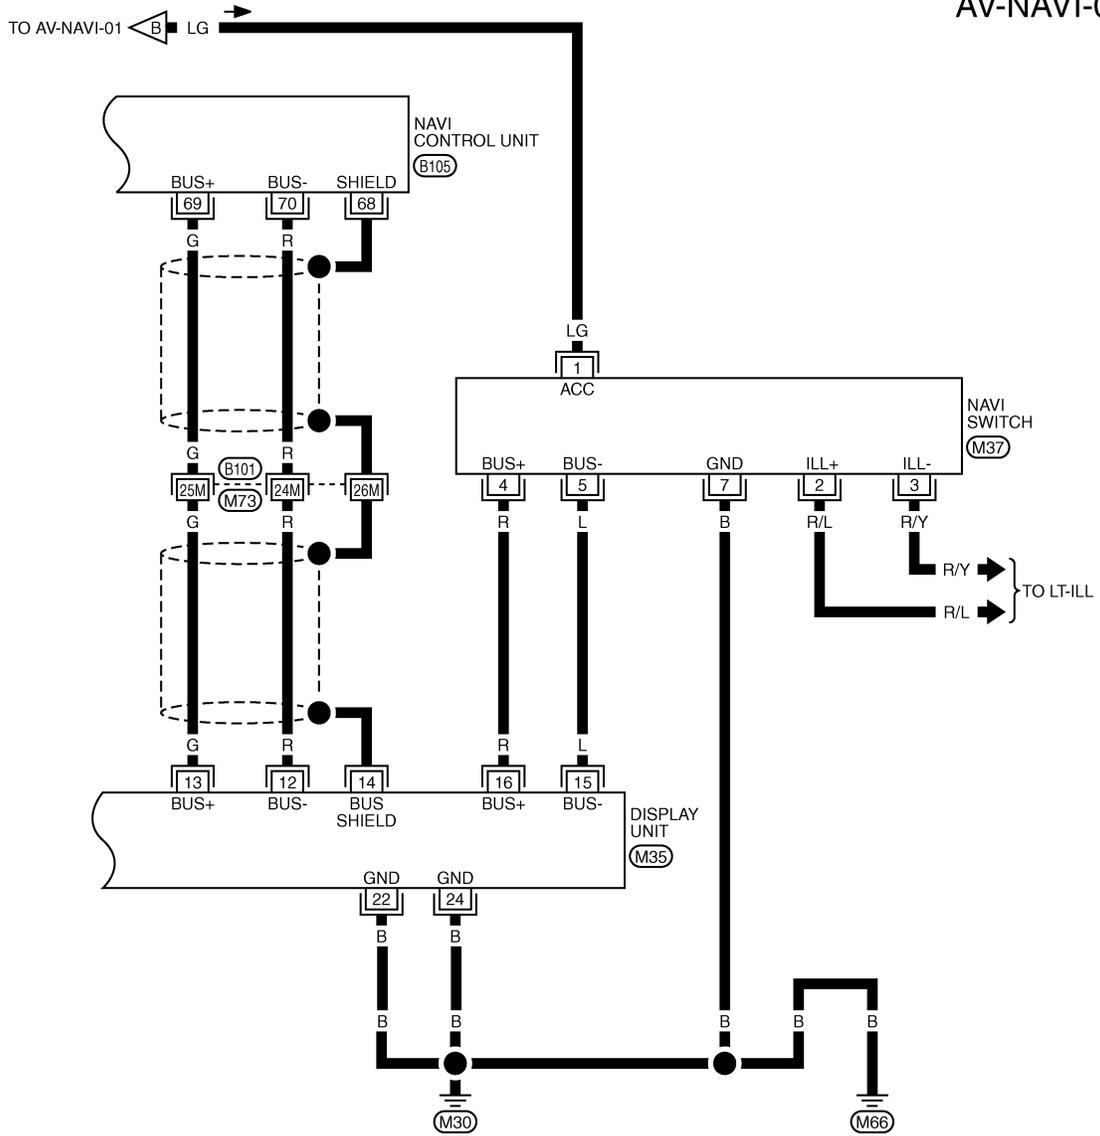

REFER TO THE FOLLOWING.
 (B101) -SUPER MULTIPLE JUNCTION (SMJ)

TKWT5631E

 

A
B
C
D
E
F
G
H
I
J
AV
L
M
N
O
P

NAVIGATION SYSTEM

< SERVICE INFORMATION >

Wiring Diagram - COMM -


INFOID:000000004657402

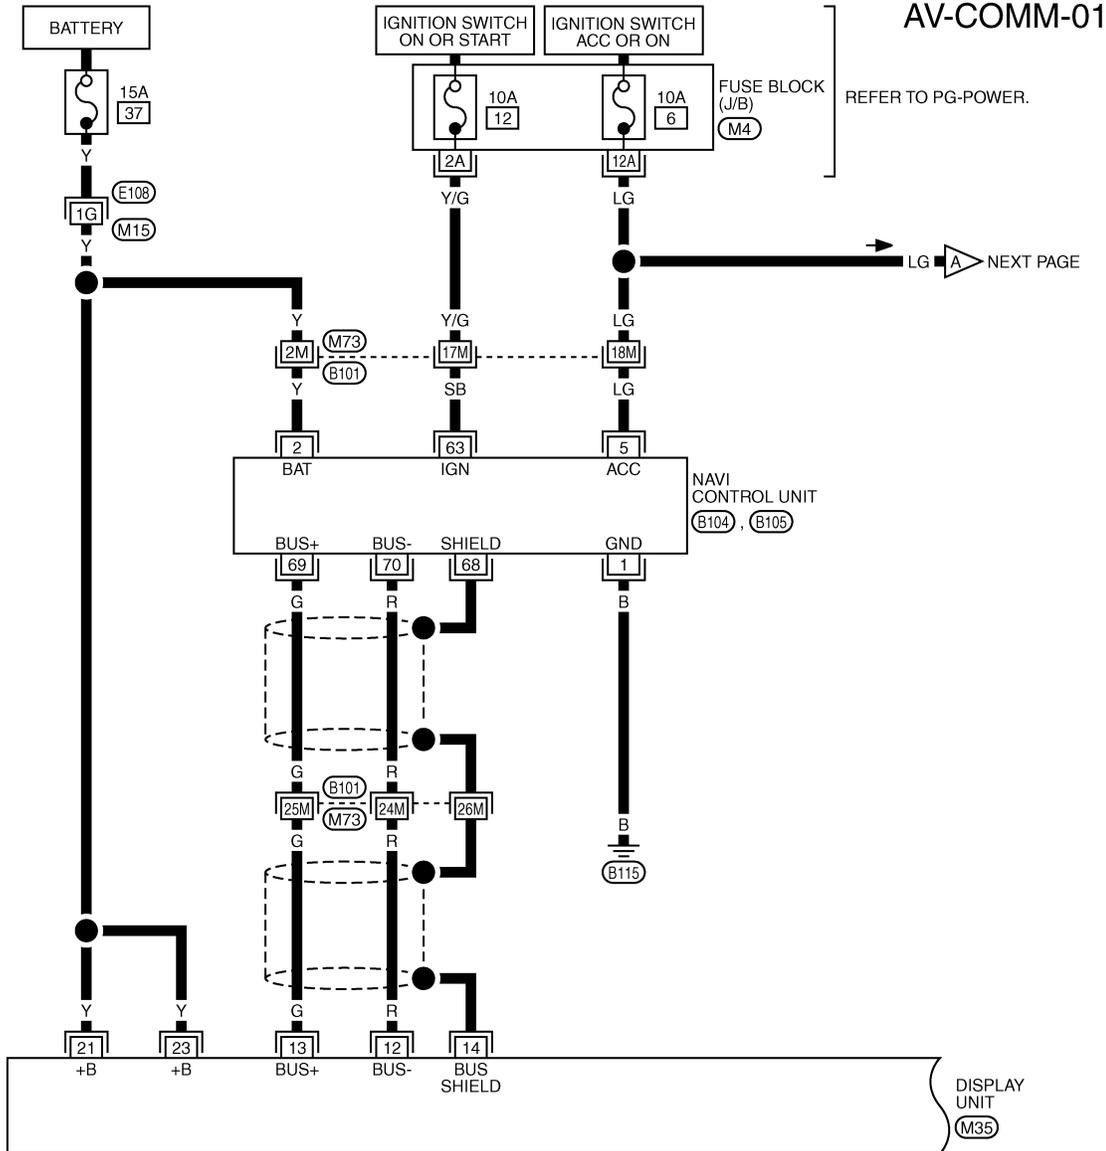

REFER TO THE FOLLOWING.

(E108), (B101) -SUPER MULTIPLE JUNCTION (SMJ)

 (M4) -FUSE BLOCK-JUNCTION BOX (J/B)





TKWT5632E

NAVIGATION SYSTEM

< SERVICE INFORMATION >

 AV-COMM-02

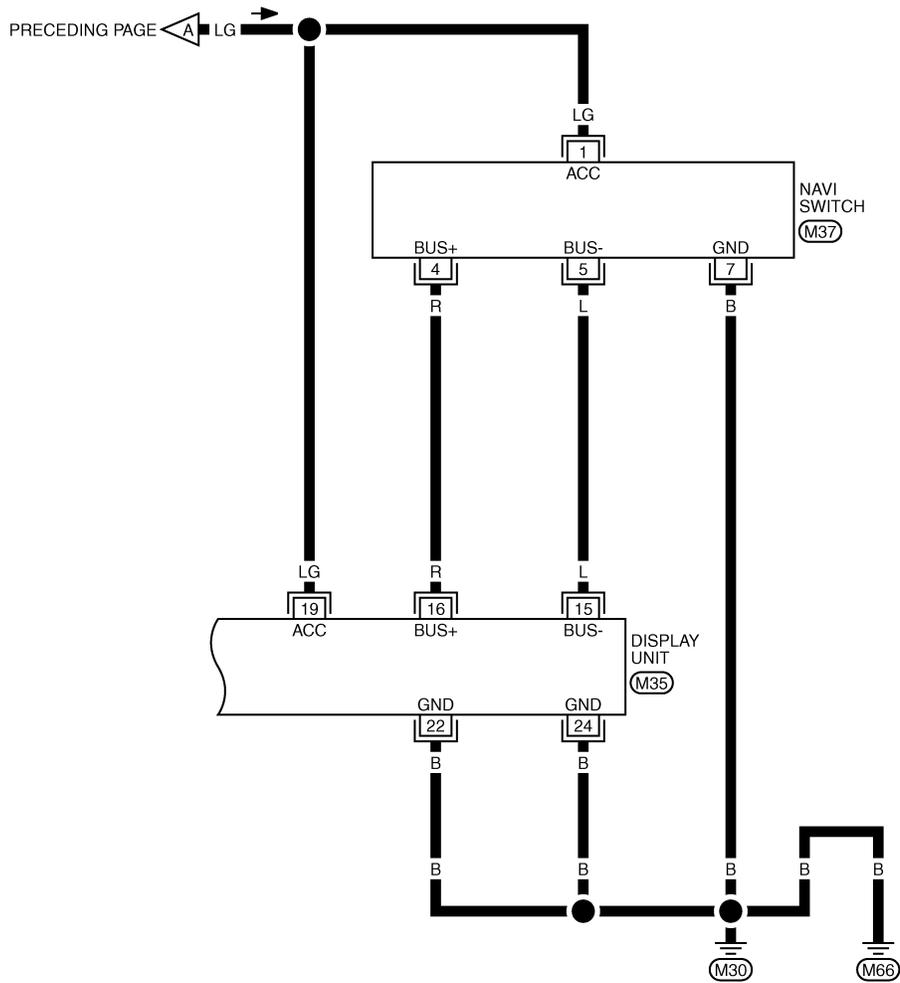

TKWT5633E

A
B
C
D
E
F
G
H
I
J
L
M
N
O
P






AV

NAVIGATION SYSTEM

< SERVICE INFORMATION >





Terminal and Reference Value for NAVI Control Unit

INFOID:000000004657403

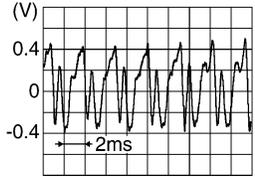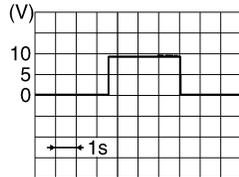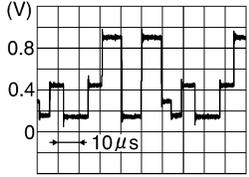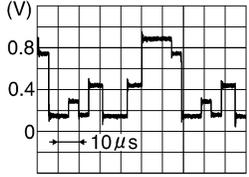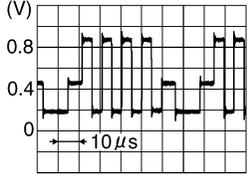Terminal (Wire color)		Item	Signal input/ output	Condition		Reference value
(+)	(-)			Ignition switch	Operation	
1 (B)	Ground	Ground	—	ON	—	Approx. 0 V
2 (Y)	Ground	Battery power supply	Input	OFF	—	Battery voltage
5 (LG)	Ground	ACC power supply	Input	ACC	—	Battery voltage
12 (OR)	14 (SB)	Voice guidance signal	Output	ON	Press "VOICE" button	 <p style="text-align: right;">SKIB3597E</p>
24 (BR)	13 (B/OR)	Voice guidance ON signal	Output	ON	Press "VOICE" button	 <p style="text-align: right;">SKIB0232E</p>
44 (B)	Ground	RGB signal (R: red)	Output	ON	Start Confirmation/Adjustment mode, and then display color bar by selecting "Color Spectrum bar" on Display Diagnosis screen	 <p style="text-align: right;">SKIB7360E</p>
45 (W)	Ground	RGB signal (G: green)	Output	ON	Start Confirmation/Adjustment mode, and then display color bar by selecting "Color Spectrum bar" on Display Diagnosis screen	 <p style="text-align: right;">SKIB7361E</p>
46 (R)	Ground	RGB signal (B: blue)	Output	ON	Start Confirmation/Adjustment mode, and then display color bar by selecting "Color Spectrum bar" on Display Diagnosis screen	 <p style="text-align: right;">SKIB7362E</p>
47	—	Shield	—	—	—	—

NAVIGATION SYSTEM

< SERVICE INFORMATION >

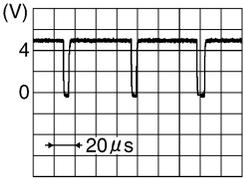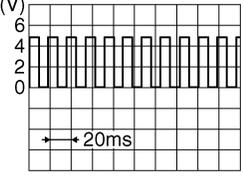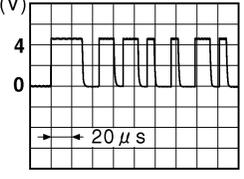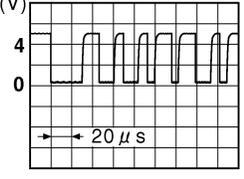Terminal (Wire color)		Item	Signal input/ output	Condition		Reference value
(+)	(-)			Ignition switch	Operation	
48 (P)	Ground	RGB synchronizing signal	Output	ON	—	 <small>SKIB3603E</small>
50 (L)	Ground	RGB area (YS) signal	Output	ON	—	Approx. 5 V
61 (PU)	Ground	Illumination signal	Input	ON	Lighting switch ON	Approx. 12 V
					Lighting switch OFF	Approx. 0 V
63 (SB)	Ground	Ignition signal	Input	ON	—	Battery voltage
65 (GY)	Ground	Reverse signal	Input	ON	Select R position	Approx. 12 V
					Other position	Approx. 0 V
66 (L/B)	Ground	Vehicle speed signal (2-pulse)	Input	ON	When vehicle speed is ap- prox. 40 km/h (25 MPH)	 <small>SKIA6649J</small>
68	—	Shield	—	—	—	—
69 (G)	Ground	Communication signal (+)	Input/ Output	ON	Operate navigation system with NAVI switch	 <small>SKIB7378E</small>
70 (R)	Ground	Communication signal (-)	Input/ Output	ON	Operate navigation system with NAVI switch	 <small>SKIB7379E</small>
73 (GY)	Ground	GPS signal	Input	ON	Connector is not connected	Approx. 5 V

A
B
C
D
E
F
G
H
I
J
L
M
N
O
P







AV

NAVIGATION SYSTEM

< SERVICE INFORMATION >



Terminal and Reference Value for Display Unit

INFOID:000000004657404

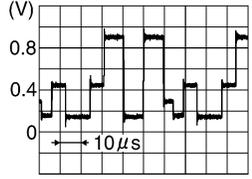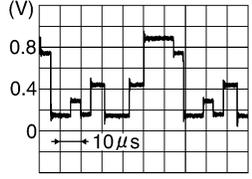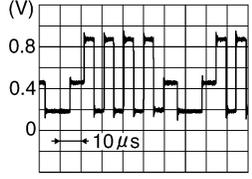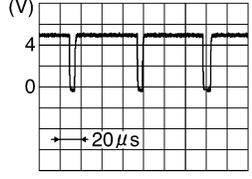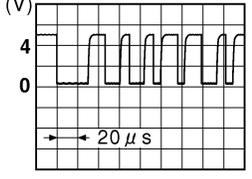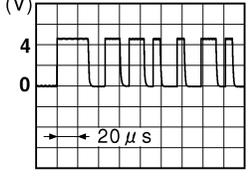Terminal (Wire color)		Item	Signal input/ output	Condition		Reference value
(+)	(-)			Ignition switch	Operation	
1 (L/R)	Ground	RGB signal (R: red)	Input	ON	Start Confirmation/Adjustment mode, and then display color bar by selecting "Color Spectrum bar" on Display Diagnosis screen	 <p style="text-align: right;">SKIB7360E</p>
2 (L)	Ground	RGB signal (G: green)	Input	ON	Start Confirmation/Adjustment mode, and then display color bar by selecting "Color Spectrum bar" on Display Diagnosis screen	 <p style="text-align: right;">SKIB7361E</p>
3 (L/W)	Ground	RGB signal (B: blue)	Input	ON	Start Confirmation/Adjustment mode, and then display color bar by selecting "Color Spectrum bar" on Display Diagnosis screen	 <p style="text-align: right;">SKIB7362E</p>
4	—	Shield	—	—	—	—
7 (B/R)	Ground	RGB synchronizing signal	Input	ON	—	 <p style="text-align: right;">SKIB3603E</p>
8 (W/R)	Ground	RGB area (YS) signal	Input	ON	—	Approx. 5 V
12 (R)	Ground	Communication signal (-)	Input/Output	ON	Operate navigation system with NAVI switch	 <p style="text-align: right;">SKIB7379E</p>
13 (G)	Ground	Communication signal (+)	Input/Output	ON	Operate navigation system with NAVI switch	 <p style="text-align: right;">SKIB7378E</p>
14	—	Shield	—	—	—	—



NAVIGATION SYSTEM

< SERVICE INFORMATION >

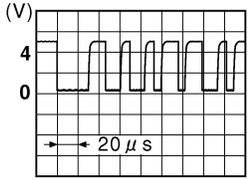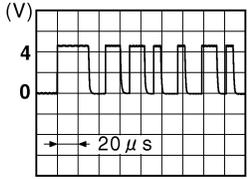Terminal (Wire color)		Item	Signal input/ output	Condition		Reference value
(+)	(-)			Ignition switch	Operation	
15 (L)	Ground	Communication signal (-)	Input/ Output	ON	Operate navigation system with NAVI switch	 <small>SKIB7379E</small>
16 (R)	Ground	Communication signal (+)	Input/ Output	ON	Operate navigation system with NAVI switch	 <small>SKIB7378E</small>
19 (LG)	Ground	ACC power supply	Input	ACC	—	Battery voltage
21 (Y)	Ground	Battery power supply	Input	OFF	—	Battery voltage
22 (B)	Ground	Ground	—	ON	—	Approx. 0 V
23 (Y)	Ground	Battery power supply	Input	OFF	—	Battery voltage
24 (B)	Ground	Ground	—	ON	—	Approx. 0 V

Terminal and Reference Value for NAVI Switch

INFOID:000000004657405

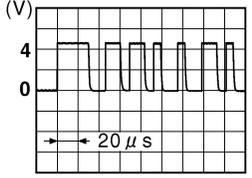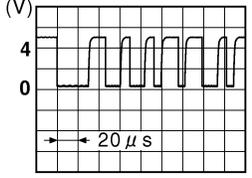Terminal (Wire color)		Item	Signal input/ output	Condition		Reference value
(+)	(-)			Ignition switch	Operation	
1 (LG)	Ground	ACC power supply	Input	ACC	—	Battery voltage
2 (R/L)	Ground	Illumination signal	Input	ON	Lighting switch ON	Approx. 12 V
					Lighting switch OFF	Approx. 0 V
3 (R/Y)	Ground	Illumination control signal	Input	ON	Illumination control switch is operated by lighting switch in ON position	Changes between approx. 0 and approx. 12 V
4 (R)	Ground	Communication signal (+)	Input/ Output	ON	Operate navigation system with NAVI switch	 <small>SKIB7378E</small>
5 (L)	Ground	Communication signal (-)	Input/ Output	ON	Operate navigation system with NAVI switch	 <small>SKIB7379E</small>
7 (B)	Ground	Ground	—	ON	—	Approx. 0 V

NAVIGATION SYSTEM

< SERVICE INFORMATION >

Special Note for Trouble Diagnosis

INFOID:000000004657406

Prior to perform trouble diagnosis, make sure there are no corresponding description in the “Example of Symptoms Possible No Malfunction”. Refer to [AV-82. "Example of Symptom Possible No Malfunction"](#).

On Board Self-Diagnosis Function

INFOID:000000004657407

DESCRIPTION

- Trouble diagnosis function of navigation system has a Self Diagnosis mode by automatic operation and a Confirmation/Adjustment mode by manual operation.
- Self Diagnosis mode checks for connections between the units constituting this system, analyzes each individual unit at the same time, and displays the results on the display unit.
- Confirmation/Adjustment mode displays trouble diagnosis that require an operation and a judgment by a human (auto-decision can not be performed by the system), confirmation of preset value, and an error history.

DIAGNOSIS ITEM


Mode		Description	
Self Diagnosis		<ul style="list-style-type: none"> • NAVI control unit diagnosis (DVD-ROM drive will not be diagnosed when no DVD-ROM is in it.). • Analyzes connection between the NAVI control unit and the GPS antenna, connection between the NAVI control unit and each unit, and operation of each unit. 	
Confirmation/ Adjustment	Display Diagnosis	Color tone and shading of the screen can be checked by the display of a color bar and a gray scale.	
	Vehicle Signals	Diagnosis of signals that are input to NAVI control unit can be performed for Vehicle speed, Lights, Ignition and Reverse.	
	Navigation	Steering Angle Adjustment	This mode is used to correct difference between actual turning angle of a vehicle and turning angle of the vehicle mark on the display.
		Speed Calibration	Under ordinary conditions, the navigation system distance measuring function will automatically compensate for minute decreases in wheel and tire diameter caused by tire wear or low-pressure. Speed Calibration can immediately restore system accuracy in cases such as when distance calibration is needed because of the use of tire chains.
	Error History	Malfunctions that occurred in the past are displayed, along with the number of times each has occurred. Time and location when/where the errors occurred are also displayed.	
Delete Unit Connection Log	Erase the connection history of unit and error history.		

Self-Diagnosis Mode

INFOID:000000004657408

OPERATION PROCEDURE

1. Start the engine.
2. Press and hold “MAP” and “☼/☾” buttons simultaneously for 5 seconds or more.
 - Shifting from current screen to previous screen is performed by pressing “BACK” button.

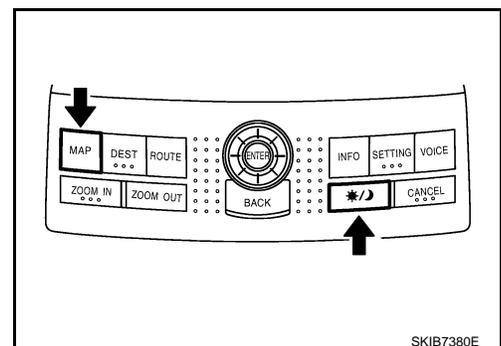


SKIB7380E


NAVIGATION SYSTEM

< SERVICE INFORMATION >

- The initial trouble diagnosis screen will be shown, and items "Self Diagnosis" and "Confirmation/Adjustment" will become selective.

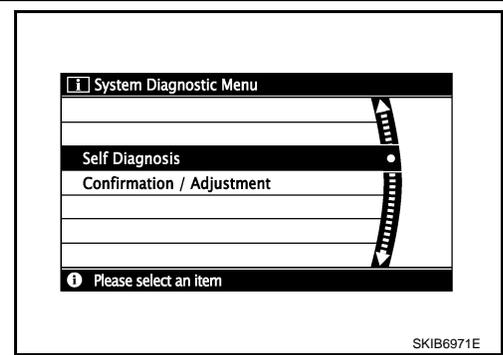


- Perform self-diagnosis by selecting the "Self Diagnosis".
 - Self-diagnosis screen is displayed, and then self-diagnosis starts.
 - The bar graph visible below self-diagnosis screen displays progress of the diagnosis.

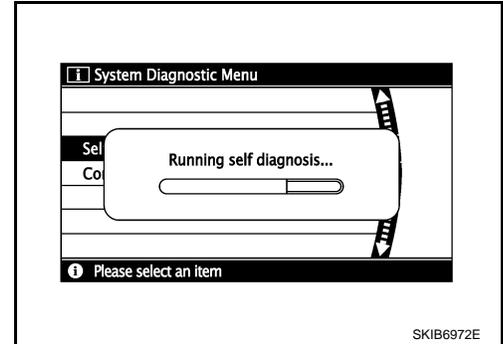


- On the diagnosis results screen, each unit name and connection line will be colored according to the diagnosis result, as follows.

Diagnosis results	Unit	Connection line
Normal	Green	Green
Connection malfunction	Gray	Yellow
DVD-ROM drive undiagnosed	Gray	Green
DVD-ROM and DVD-ROM drive malfunction	Yellow	Green
Unit returned an error	Red	Green

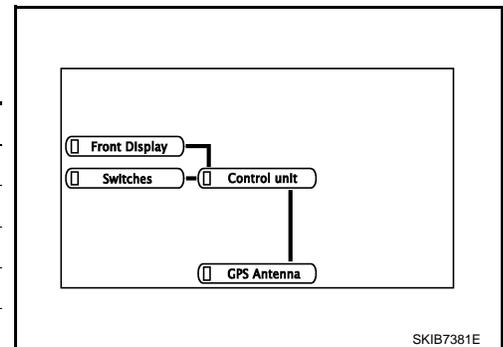

NOTE:

- Control unit = NAVI control unit
 - Switches = NAVI switch
 - Only Control unit (NAVI control unit) is displayed in red.
 - If multiple malfunctions occur at the same time for a single unit, the screen switch colors are determined according to the following order of priority: red > yellow > gray.
- Select a switch on the diagnosis results screen, and comments for the diagnosis results will be shown.

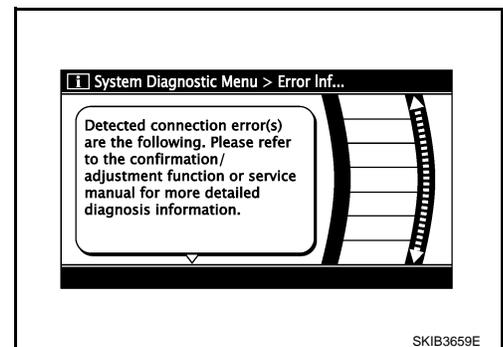





SELF-DIAGNOSIS RESULT

Check the applicable display in the following table, and then repair the malfunctioning parts.

Quick Reference Table

NAVIGATION SYSTEM

< SERVICE INFORMATION >

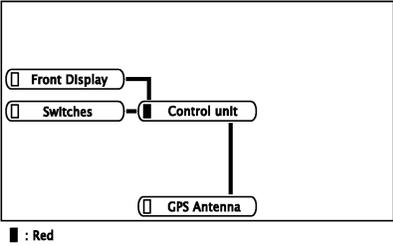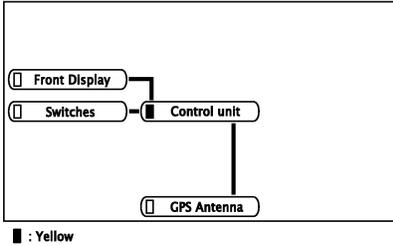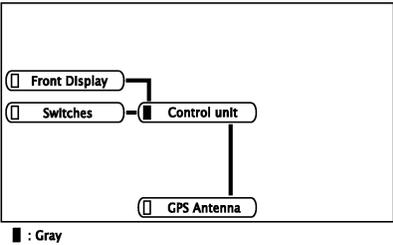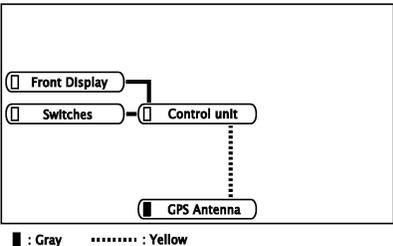Self-diagnosis result screen	Possible cause	Action to take
 <p>■ : Red</p> <p>SKIB7382E</p>	<p>NAVI control unit malfunction is detected</p>	<p>Replace NAVI control unit Refer to AV-85. "Removal and Installation of NAVI Control Unit"</p>
 <p>■ : Yellow</p> <p>SKIB7383E</p>	<ul style="list-style-type: none"> Malfunction is detected on DVD-ROM drive pickup lens in NAVI control unit There is dirt and damage on the DVD-ROM 	<ol style="list-style-type: none"> Check if the inserted DVD-ROM is specified for this navigation system, and the DVD-ROM is dirty, scratched or warped. If the results from the above checkup show no malfunction, insert the same DVD-ROM, and then restart self-diagnosis. If self-diagnosis results still show any malfunction, replace NAVI control unit.
 <p>■ : Gray</p> <p>SKIB7384E</p>	<p>DVD-ROM not inserted is detected</p>	<p>Insert DVD-ROM</p>
 <p>■ : Gray : Yellow</p> <p>SKIB7385E</p>	<p>GPS antenna connection malfunction is detected</p>	<ol style="list-style-type: none"> Check if GPS antenna feeder line is snapped or pinched. If the results from the above checkup show no malfunction, replace GPS antenna, and then restart self-diagnosis. If self-diagnosis results still show any malfunction, replace NAVI control unit.

Confirmation/Adjustment Mode

INFOID:000000004657409


OPERATION PROCEDURE

1. Start the engine.


NAVIGATION SYSTEM

< SERVICE INFORMATION >


2. Press and hold "MAP" and "☀/☾" buttons simultaneously for 5 seconds or more.
 - Shifting from current screen to previous screen is performed by pressing "BACK" button.

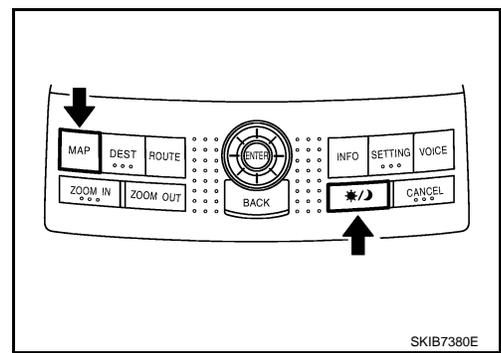


3. The initial trouble diagnosis screen will be shown, and items "Self Diagnosis" and "Confirmation/Adjustment" will become selective.
4. Select "Confirmation/Adjustment".

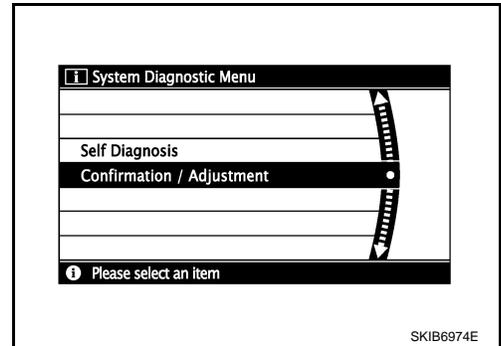

5. Each diagnosis is shown by selecting each screen switch on Confirmation/Adjustment screen.

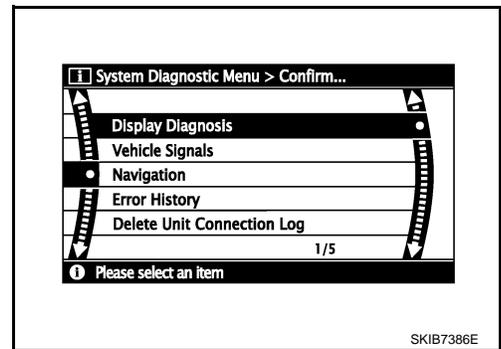

DISPLAY DIAGNOSIS

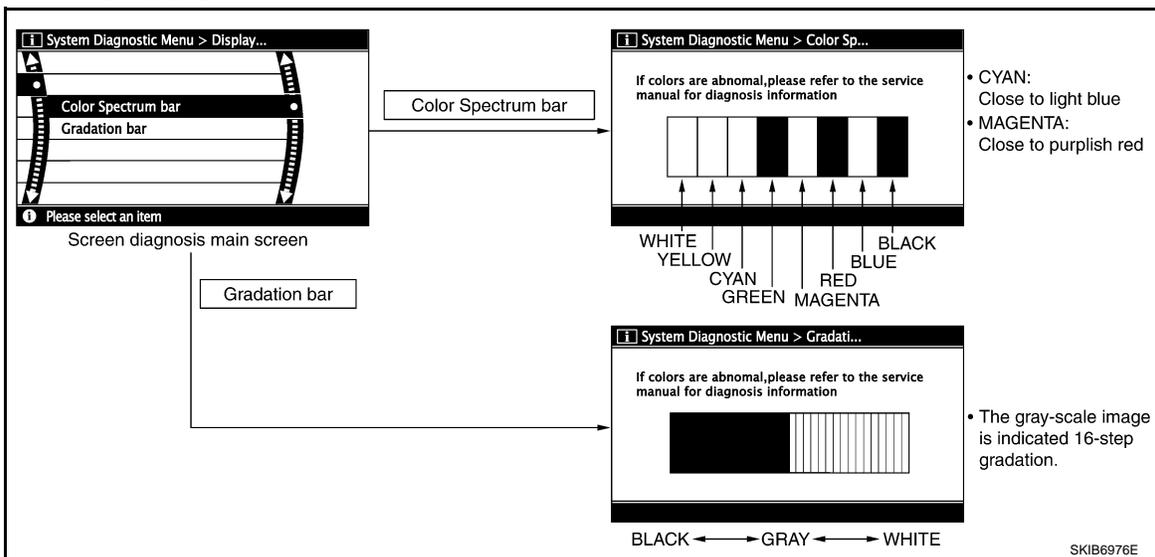

- If RGB signal is malfunctioning, the tint of the color bar display is as follows.

R (red) signal error : Light blue (Cyan) tint


NAVIGATION SYSTEM

< SERVICE INFORMATION >

G (green) signal error : **Purple (Magenta) tint**
B (blue) signal error : **Yellow tint**

VEHICLE SIGNALS

A comparison check can be made of each actual vehicle signal and the signals recognized by the NAVI control unit.

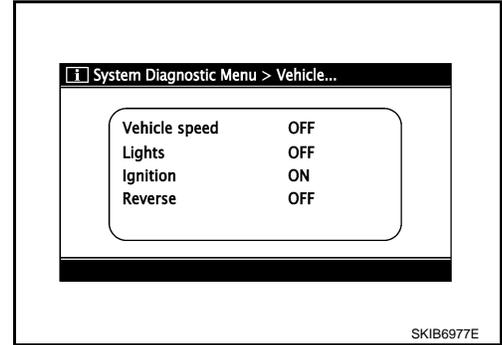

Diagnosis item	Display	Condition	Remarks
Vehicle speed	ON	When vehicle speed is more than 0 km/h (0 MPH)	Changes in indication may be delayed. This is normal.
	OFF	When vehicle speed is 0 km/h (0 MPH)	
	—	Ignition switch in ACC position	
Lights	ON	Lighting switch ON	—
	OFF	Lighting switch OFF	
Ignition	ON	Ignition switch ON	—
	OFF	Ignition switch ACC position	
Reverse	ON	Selector lever in R position	Changes in indication may be delayed. This is normal.
	OFF	Selector lever in any position other than R position	
	—	Ignition switch in ACC position	


NOTE:

If ignition signal is NG, each vehicle signal of vehicle speed and reverse is not displayed.

NAVIGATION

Steering Angle Adjustment

The steering angle output value detected by the gyroscope can be adjusted.

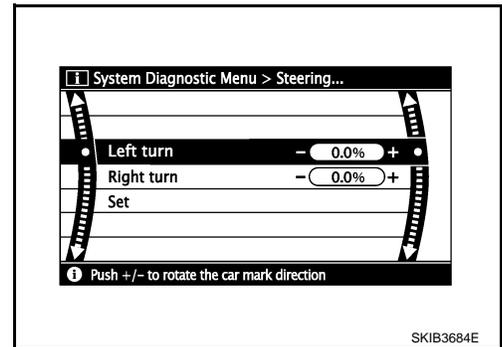


Speed Calibration

NAVIGATION SYSTEM

< SERVICE INFORMATION >

Usually the automatic distance correction function adjusts the malfunction in distance caused by the tires wearing down or the tire pressure change. If prompt adjustment is necessary when the tire chains are installed etc., perform this procedure.

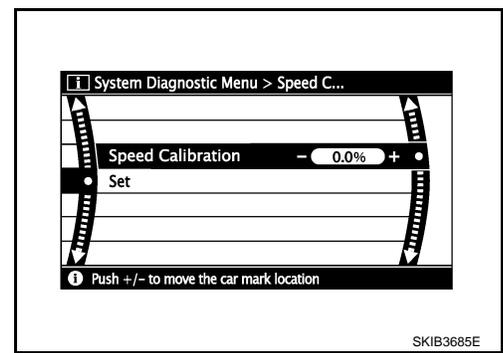

ERROR HISTORY


Diagnosis results of self-diagnosis depend on if any error occurred during the time after selecting "Self Diagnosis" until self-diagnosis results is displayed.

Meanwhile, when an error occurs before selecting "Self Diagnosis", and if an error does not occur until self-diagnosis results is displayed, a diagnosis result is judged as normal.

Consequently, a diagnosis needs to be performed with "Error History" for the past error that is not available with self-diagnosis.

"Error History" displays the time and place of the most recent occurrence of that error. However, take note of the following points.

- Correct time of the error occurrence may not be displayed when the GPS antenna substrate within the NAVI control unit has malfunctioned.
- Place of the error occurrence is represented by the position of the vehicle mark at the time when the error occurred. If the vehicle mark has deviated from the correct position, then the place of the error occurrence may not be located correctly.
- When the ignition switch is turned ON if the error is detected, the counter increases 1. Even if it is normal when the ignition switch is turned ON the next time, the counter does not decrease.
- The upper limit of the counter is 50. 51 or more is displayed as 50. It can be reset to 0 by "Delete log" switch.

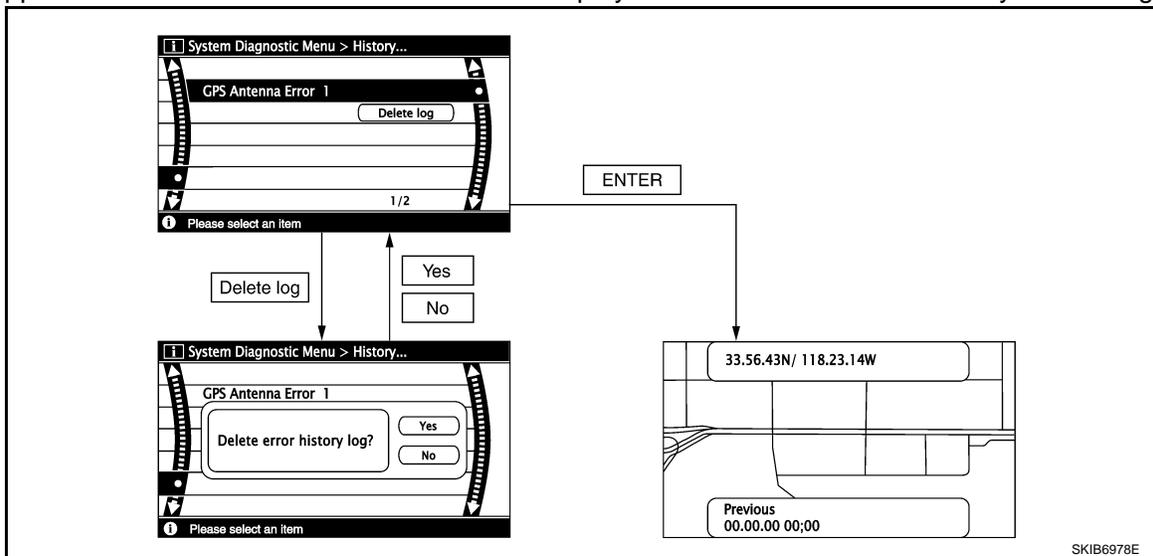

Diagnosis by Error History

- When having a difficulty on the investigation of cause due to multiple errors with a reproducible malfunction, turn ON the ignition switch from OFF mode after making a memo of the item and number of time (or delete "Error History"). Check "Error History" again after the malfunction was reproduced, and then perform diagnosis focusing on the item of which number of time increased.
- DVD-ROM error history may be restored because DVD-ROM cannot be temporarily read. (Driving on rough road etc.) Then, erase the error history. (This is not a malfunction.) Perform service in "Action to take" if error history are repeatedly indicated again.

NAVIGATION SYSTEM

< SERVICE INFORMATION >

Error item	Possible cause	Action to take
GPS Antenna Error	GPS antenna connection malfunction is detected	<ol style="list-style-type: none"> 1. Start self-diagnosis, and make sure of the result. 2. If any error is found, GO TO 3. If any error is not found, delete the error history and end the diagnosis. (This is not a malfunction.) 3. Check if GPS antenna feeder line is snapped or pinched. 4. If the results from the above checkup show no malfunction, replace GPS antenna, and then restart self-diagnosis. 5. If self-diagnosis results still show any malfunction, replace NAVI control unit.
FLASH-ROM Error Of Control Unit	NAVI control unit malfunction is detected	<ol style="list-style-type: none"> 1. Start self-diagnosis, and make sure of the result. 2. If any error is found, replace NAVI control unit. Refer to AV-85, "Removal and Installation of NAVI Control Unit". If any error is not found, delete the error history and end the diagnosis. (This is not a malfunction.)
Connection Of Gyro		
GPS Communication Error	GPS malfunction is detected	<p>If the symptoms such as the GPS receipt malfunction occur, intermittent malfunction caused by strong radio interference may be detected.</p> <p>If the malfunction always occurs, replace NAVI control unit.</p>
GPS ROM Error		
GPS RAM Error		
GPS RTC Error		
DVD-ROM Mechanism not Detected	<ul style="list-style-type: none"> • Malfunction is detected on DVD-ROM drive pickup lens in NAVI control unit • There is dirt and damage on the DVD-ROM 	<ol style="list-style-type: none"> 1. Check if the inserted DVD-ROM is specified for this navigation system, and the DVD-ROM is dirty, scratched or warped. 2. If the results from the above checkup show no malfunction, insert the same DVD-ROM, and then restart self-diagnosis. 3. If self-diagnosis results still show any malfunction, replace NAVI control unit.
DVD-ROM Communication Error		
DVD-ROM Mechanism Error		
DVD-ROM Focus Error		
DVD-ROM TOC Error		
DVD-ROM Disc Error		
DVD-ROM Seek Error		
DVD-ROM Error Correction Error		
DVD-ROM Read Error		
DVD-ROM Data Transfer Error		
DVD-ROM Data Error		
DVD-ROM Loading / Eject Error		
DVD-ROM Time-out		
Front Display Connection Error	Display unit power supply and ground circuit malfunction is detected	<ol style="list-style-type: none"> 1. Delete the error history, and turn OFF ignition switch. 2. Turn ON ignition switch, and make sure of the error history. 3. If the error item listed left is displayed again, GO TO 4. If the error item is not displayed, end the diagnosis. (This is not a malfunction.) 4. Check display unit power supply and ground circuit. 5. If the results from the above checkup show no malfunction, replace display unit.


NAVIGATION SYSTEM

< SERVICE INFORMATION >

Error item	Possible cause	Action to take
Switches Connection Error	<ul style="list-style-type: none"> • NAVI switch power supply and ground circuit malfunction is detected • Malfunction is detected on communication signal between display unit and NAVI switch • Malfunction is detected on communication signal between NAVI control unit and display unit 	<ol style="list-style-type: none"> 1. Delete the error history, and turn OFF ignition switch. 2. Turn ON ignition switch, and make sure of the error history. 3. If the error item listed left is displayed again, GO TO 4. If the error item is not displayed, end the diagnosis. (This is not a malfunction.) 4. Check NAVI switch power supply and ground circuit. 5. Check communication circuit between display unit and NAVI switch. 6. Check communication circuit between NAVI control unit and display unit. 7. If the results from the above checkup show no malfunction, replace NAVI switch, display unit, or NAVI control unit, and then start self-diagnosis. 8. If self-diagnosis results still show any malfunction, replace one of the two units that is not replaced yet. 9. If self-diagnosis results still show any malfunction, replace the other unit.
<ul style="list-style-type: none"> • Front Display Connection Error • Switches Connection Error 	<ul style="list-style-type: none"> • Malfunction is detected on communication signal between NAVI control unit and display unit • Malfunction is detected on communication signal between display unit and NAVI switch 	<ol style="list-style-type: none"> 1. Delete the error history, and turn OFF ignition switch. 2. Turn ON ignition switch, and make sure of the error history. 3. If the error item listed left is displayed again, GO TO 4. If the error item is not displayed, end the diagnosis. (This is not a malfunction.) 4. Check communication circuit between NAVI control unit and display unit. 5. Check communication circuit between display unit and NAVI switch. 6. If the results from the above checkup show no malfunction, replace NAVI switch, display unit, or NAVI control unit, and then start self-diagnosis. 7. If self-diagnosis results still show any malfunction, replace one of the two units that is not replaced yet. 8. If self-diagnosis results still show any malfunction, replace the other unit.

DELETE UNIT CONNECTION LOG

Erase the connection history of unit and error history that is recorded in NAVI control unit (clear the connection history of the removed unit).

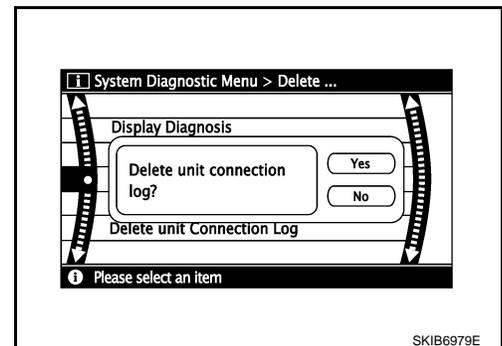

All Images Are Not Displayed

Symptom: RGB image such as a map screen is not displayed.

INFOID:000000004657410

NAVIGATION SYSTEM

< SERVICE INFORMATION >

1. CHECK CONDITION

Check if brightness of screen changes when  button on NAVI switch is turned on after turning on ignition switch.

Does brightness of screen change?


YES >> GO TO 5.

NO >> GO TO 2.

2. CHECK NAVI CONTROL UNIT POWER SUPPLY AND GROUND CIRCUIT

1. Check voltage between NAVI control unit harness connector terminals and ground.

Terminals		OFF	ACC	ON
(+)				
Connector	Terminal	(-)		
B104	2	Battery voltage	Battery voltage	Battery voltage
	5	0 V	Battery voltage	Battery voltage

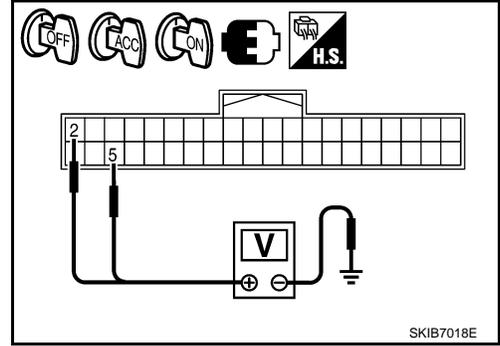


2. Turn ignition switch OFF.
3. Disconnect NAVI control unit connector.
4. Check continuity between NAVI control unit harness connector B104 terminal 1 and ground.

1 – Ground : Continuity should exist.

OK or NG

OK >> GO TO 3.


NG >> Repair harness or connector.

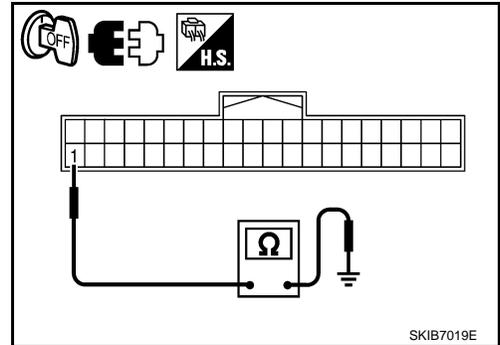

3. CHECK DISPLAY UNIT POWER SUPPLY AND GROUND CIRCUIT

1. Check voltage between display unit harness connector terminals and ground.

Terminals		OFF	ACC	ON
(+)				
Connector	Terminal	(-)		
M35	21, 23	Battery voltage	Battery voltage	Battery voltage
	19	0 V	Battery voltage	Battery voltage

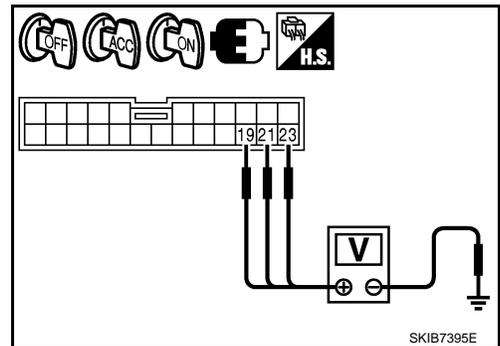

2. Turn ignition switch OFF.
3. Disconnect display unit connector.

NAVIGATION SYSTEM


< SERVICE INFORMATION >

4. Check continuity between display unit harness connector M35 terminals 22, 24 and ground.

22, 24 – Ground : Continuity should exist.

OK or NG

- OK >> GO TO 4.
NG >> Repair harness or connector.

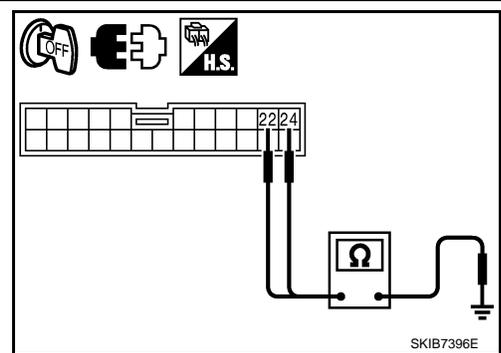

4.CHECK NAVI CONTROL UNIT AND DISPLAY UNIT

1. Replace NAVI control unit or display unit.
2. Turn ignition switch ON.
3. Check if an image is displayed on the screen.

Is an image displayed on the screen?

- YES >> INSPECTION END
NO >> Replace the other unit.

5.CHECK HARNESS

1. Turn ignition switch OFF.
2. Disconnect NAVI control unit and display unit connectors.
3. Check continuity between NAVI control unit harness connector (A) B105 terminal 50 and display unit harness connector (B) M35 terminal 8.


50 – 8 : Continuity should exist.

4. Check continuity between NAVI control unit harness connector (A) B105 terminal 50 and ground.

50 – Ground : Continuity should not exist.

OK or NG

- OK >> GO TO 6.
NG >> Repair harness or connector.

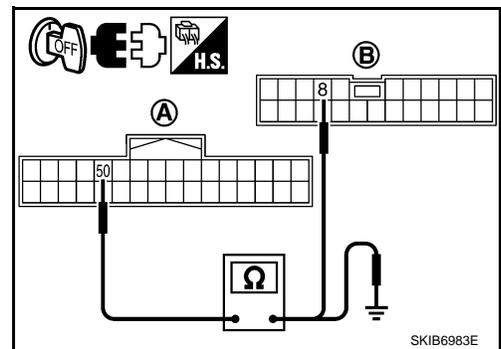


6.CHECK RGB AREA (YS) SIGNAL

1. Connect NAVI control unit and display unit connectors.
2. Turn ignition switch ON.
3. Check voltage between NAVI control unit harness connector B105 terminal 50 and ground.

50 – Ground : Approx. 5 V

OK or NG

- OK >> Replace display unit.
NG >> Replace NAVI control unit.

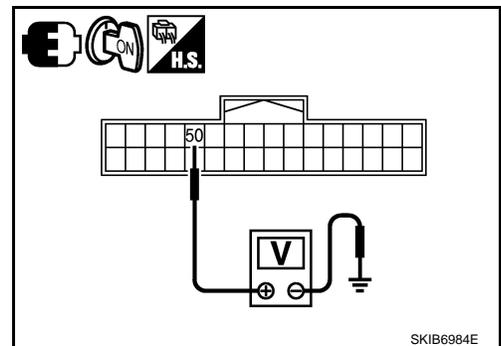

Navigation System Is Not Operated by NAVI Switch

INFOID:000000004657411

Symptom: Initial screen (NISSAN screen) or warning screen is displayed after ignition switch turns ON. But NAVI switch does not work.


1.CHECK NAVI SWITCH POWER SUPPLY AND GROUND CIRCUIT

NAVIGATION SYSTEM

< SERVICE INFORMATION >

1. Check voltage between NAVI switch harness connector terminal and ground.

Terminals		OFF	ACC	ON
(+)				
Connector	Terminal	(-)		
M37	1	Ground	0 V	Battery voltage

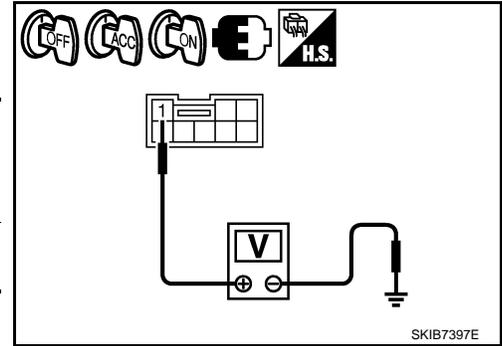


2. Turn ignition switch OFF.
3. Disconnect NAVI switch connector.
4. Check continuity between NAVI switch harness connector M37 terminal 7 and ground.

7 – Ground : Continuity should exist.

OK or NG

- OK >> GO TO 2.
 NG >> Repair harness or connector.

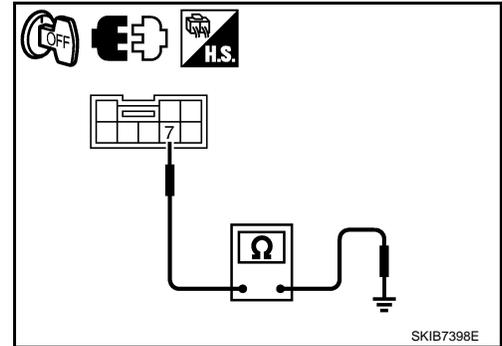

2. CHECK HARNESS

1. Disconnect display unit connector.
2. Check continuity between display unit harness connector (A) M35 terminals 15, 16 and NAVI switch harness connector (B) M37 terminals 5, 4.

15 – 5 : Continuity should exist.

16 – 4 : Continuity should exist.

3. Check continuity between display unit harness connector (A) M35 terminals 15, 16 and ground.

15, 16 – Ground : Continuity should not exist.

OK or NG

- OK >> GO TO 3.
 NG >> Repair harness or connector.

3. CHECK HARNESS

1. Disconnect NAVI control unit connector.
2. Check continuity between NAVI control unit harness connector (A) B105 terminals 69, 70 and display unit harness connector (B) M35 terminals 13, 12.

69 – 13 : Continuity should exist.



70 – 12 : Continuity should exist.

3. Check continuity between NAVI control unit harness connector (A) B105 terminals 69, 70 and ground.

69, 70 – Ground : Continuity should not exist.

OK or NG

- OK >> GO TO 4.

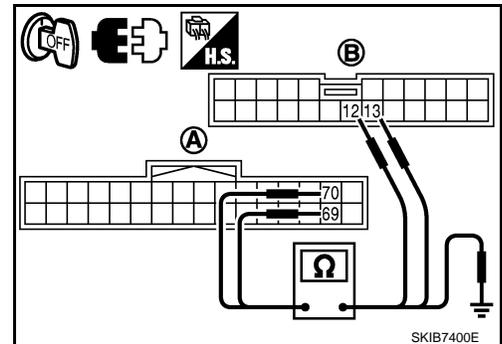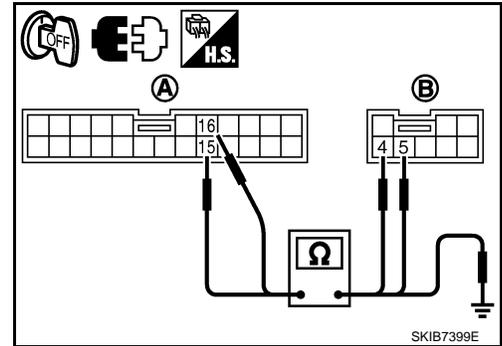

NAVIGATION SYSTEM

< SERVICE INFORMATION >

NG >> Repair harness or connector.

4. CHECK NAVI SWITCH, DISPLAY UNIT AND NAVI CONTROL UNIT

1. Replace NAVI switch, display unit, or NAVI control unit.
2. Make sure that navigation system can be operated by NAVI switch.

OK or NG

OK >> INSPECTION END

NG >> GO TO 5.

5. CHECK NAVI SWITCH, DISPLAY UNIT AND NAVI CONTROL UNIT

1. Replace one of the two units that is not replaced yet.
2. Make sure that navigation system can be operated by NAVI switch.

OK or NG

OK >> INSPECTION END

NG >> Replace the other unit.

Tint Is Strange for the RGB Image

INFOID:000000004657412

Symptom: Tint of RGB image is strange.

1. CHECK HARNESS

1. Turn ignition switch OFF.
2. Disconnect NAVI control unit and display unit connectors.
3. Check the malfunctioning circuit according to the symptoms.


• Light blue (Cyan) tinged screen

Check continuity between NAVI control unit harness connector (A) B105 terminal 44 and display unit harness connector (B) M35 terminal 1.

44 – 1 : Continuity should exist.

Check continuity between NAVI control unit harness connector (A) B105 terminal 44 and ground.

44 – Ground : Continuity should not exist.

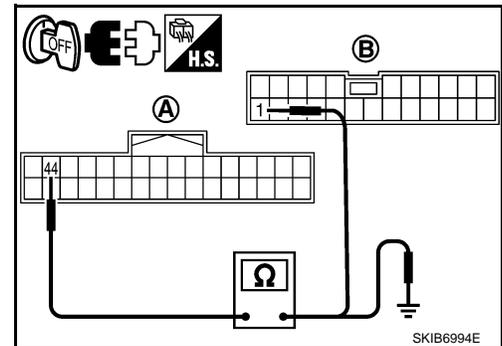


• Purple (Magenta) tinged screen

Check continuity between NAVI control unit harness connector (A) B105 terminal 45 and display unit harness connector (B) M35 terminal 2.

45 – 2 : Continuity should exist.

Check continuity between NAVI control unit harness connector (A) B105 terminal 45 and ground.

45 – Ground : Continuity should not exist.

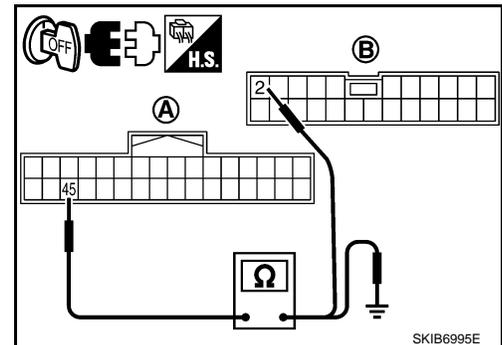

• Yellow tinged screen

A
B
C
D
E
F
G
H
I
J
AV
L
M
N
O
P

NAVIGATION SYSTEM


< SERVICE INFORMATION >

Check continuity between NAVI control unit harness connector (A) B105 terminal 46 and display unit harness connector (B) M35 terminal 3.

46 – 3 : Continuity should exist.

Check continuity between NAVI control unit harness connector (A) B105 terminal 46 and ground.

46 – Ground : Continuity should not exist.

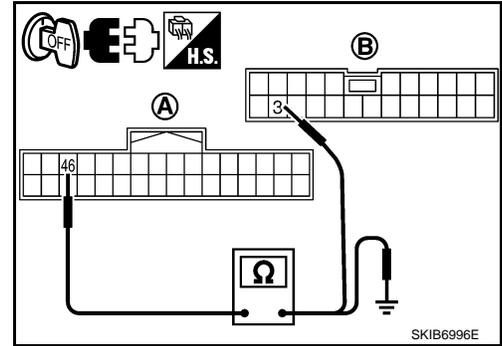

OK or NG

OK >> GO TO 2.

NG >> Repair harness or connector.


2. CHECK RGB SIGNAL

1. Connect NAVI control unit and display unit connectors.
2. Turn ignition switch ON.
3. Start Confirmation/Adjustment mode. Refer to [AV-68. "Confirmation/Adjustment Mode"](#).
4. Display color bar by selecting "Color Spectrum bar" on Display Diagnosis screen. Refer to [AV-68. "Confirmation/Adjustment Mode"](#).
5. Check the malfunctioning circuit according to the symptoms.


• Light blue (Cyan) tinged screen

Check voltage waveform between NAVI control unit harness connector B105 terminal 44 and ground using oscilloscope.

44 – Ground:

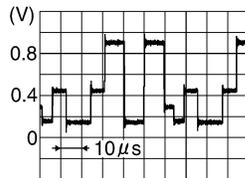

SKIB7360E

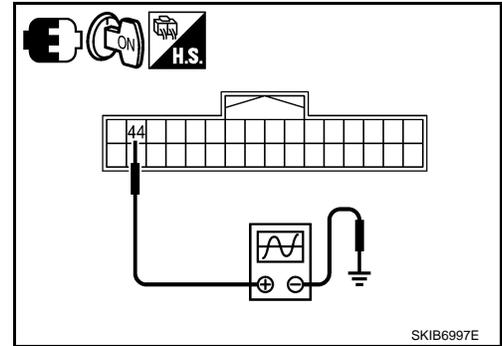


SKIB6997E


• Purple (Magenta) tinged screen

Check voltage waveform between NAVI control unit harness connector B105 terminal 45 and ground using or oscilloscope.

45 – Ground:

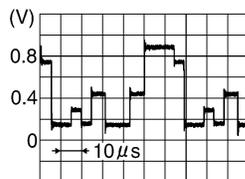

SKIB7361E

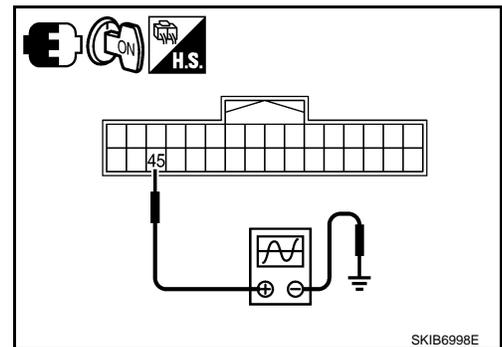

SKIB6998E



• Yellow tinged screen

NAVIGATION SYSTEM

< SERVICE INFORMATION >

Check voltage waveform between NAVI control unit harness connector B105 terminal 46 and ground using oscilloscope.

46 – Ground:

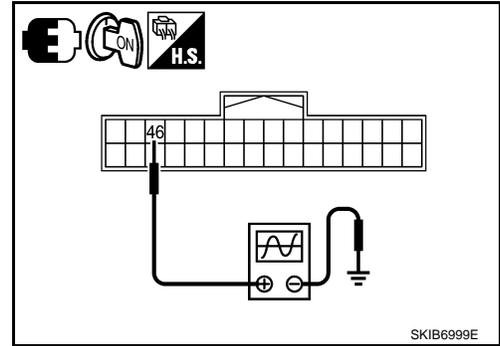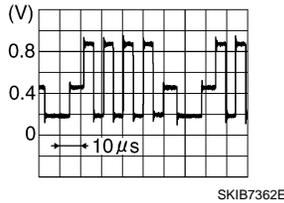

OK or NG

- OK >> Replace display unit.
- NG >> Replace NAVI control unit.

RGB Image Is Rolling

INFOID:000000004657413

Symptom: RGB image such as a map screen is rolling.


1. CHECK HARNESS

1. Turn ignition switch OFF.
2. Disconnect NAVI control unit and display unit connectors.
3. Check continuity between NAVI control unit harness connector (A) B105 terminal 48 and display unit harness connector (B) M35 terminal 7.

48 – 7 : Continuity should exist.

4. Check continuity between NAVI control unit harness connector (A) B105 terminal 48 and ground.

48 – Ground : Continuity should not exist.

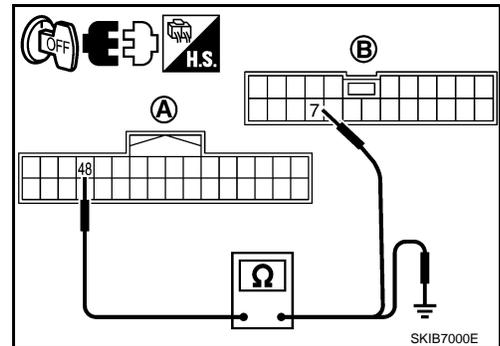



OK or NG

- OK >> GO TO 2.
- NG >> Repair harness or connector.

2. CHECK RGB SYNCHRONIZING SIGNAL

1. Connect NAVI control unit and display unit connectors.
2. Turn ignition switch ON.
3. Check voltage waveform between NAVI control unit harness connector B105 terminal 48 and ground using oscilloscope.

48 – Ground:

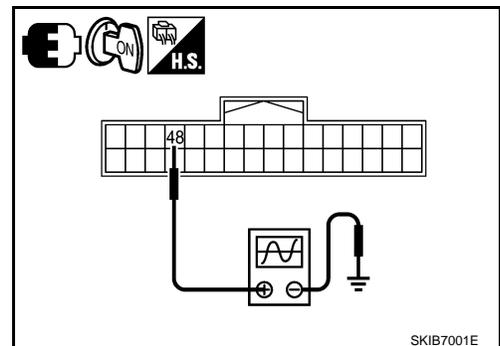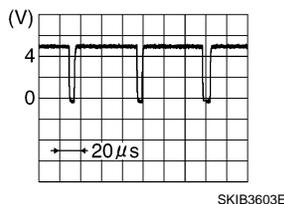

OK or NG

- OK >> Replace display unit.
- NG >> Replace NAVI control unit.

Voice Guidance Is Not Heard

INFOID:000000004657414

Symptom: Voice guidance does not sound at route guidance.

1. CHECK CONDITION

NAVIGATION SYSTEM

< SERVICE INFORMATION >

Turn audio system ON, and check if any sound can be heard from front door speaker.

OK or NG

OK >> GO TO 2.

NG >> Refer to [AV-36. "Trouble Diagnosis"](#) and repair malfunctioning part.

2. CHECK CONDITION

Turn audio system ON, and check if front door speaker is muted when pressing "VOICE" button during sounding from front door speaker.

Is front door speaker muted?

YES >> GO TO 3.

NO >> GO TO 5.

3. CHECK HARNESS

With BOSE system


1. Turn ignition switch OFF.
2. Disconnect NAVI control unit and audio unit connectors.
3. Check continuity between NAVI control unit harness connector (A) B104 terminals 12, 14 and audio unit harness connector (B) M39 terminals 32, 30.

12 – 32 : Continuity should exist.

14 – 30 : Continuity should exist.

4. Check continuity between NAVI control unit harness connector (A) B104 terminals 12, 14 and ground.

12, 14 – Ground : Continuity should not exist.

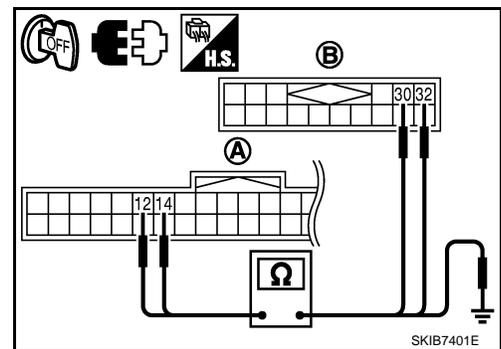

With base system


1. Turn ignition switch OFF.
2. Disconnect NAVI control unit and audio unit connectors.
3. Check continuity between NAVI control unit harness connector (A) B104 terminals 12, 14 and audio unit harness connector (B) M46 terminals 20, 19.

12 – 20 : Continuity should exist.

14 – 19 : Continuity should exist.

4. Check continuity between NAVI control unit harness connector (A) B104 terminals 12, 14 and ground.

12, 14 – Ground : Continuity should not exist.

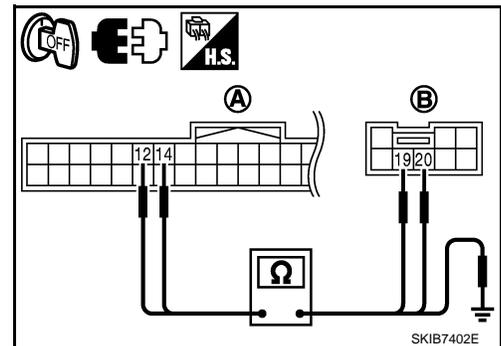

OK or NG

OK >> GO TO 4.

NG >> Repair harness or connector.


4. CHECK VOICE GUIDANCE SIGNAL

1. Connect NAVI control unit and audio unit connectors.
2. Turn ignition switch ON.

NAVIGATION SYSTEM


< SERVICE INFORMATION >

- When pressing "VOICE" button, check voltage waveform between NAVI control unit harness connector B104 terminals 12 and 14 using or oscilloscope.

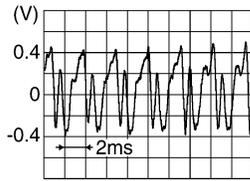

SKIB3597E

12 – 14:

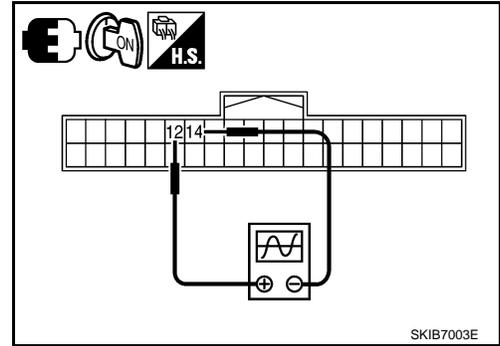

SKIB7003E

OK or NG

- OK >> Replace audio unit.
 NG >> Replace NAVI control unit.

5. CHECK HARNESS

With BOSE system


- Turn ignition switch OFF.
- Disconnect NAVI control unit and audio unit connectors.
- Check continuity between NAVI control unit harness connector (A) B104 terminals 13, 24 and audio unit harness connector (B) M39 terminals 31, 24.

13 – 31 : Continuity should exist.

24 – 24 : Continuity should exist.

- Check continuity between NAVI control unit harness connector (A) B104 terminal 24 and ground.

24 – Ground : Continuity should not exist.

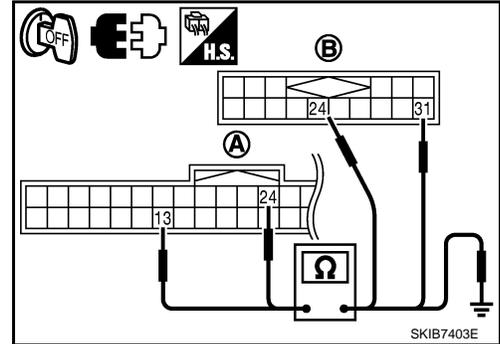

SKIB7403E

With base system


- Turn ignition switch OFF.
- Disconnect NAVI control unit and audio unit connectors.
- Check continuity between NAVI control unit harness connector (A) B104 terminals 13, 24 and audio unit harness connector (B) M46 terminals 18, 17.

13 – 18 : Continuity should exist.

24 – 17 : Continuity should exist.

- Check continuity between NAVI control unit harness connector (A) B104 terminal 24 and ground.

24 – Ground : Continuity should not exist.

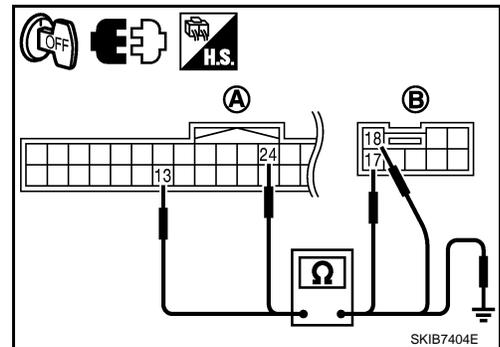

SKIB7404E

OK or NG

- OK >> GO TO 6.
 NG >> Repair harness or connector.

6. CHECK VOICE GUIDANCE ON SIGNAL



- Connect NAVI control unit and audio unit connectors.
- Turn ignition switch ON.

NAVIGATION SYSTEM

< SERVICE INFORMATION >

3. When pressing "VOICE" button, check voltage waveform between NAVI control unit harness connector B104 terminals 24 and 13 using oscilloscope.

24 – 13:

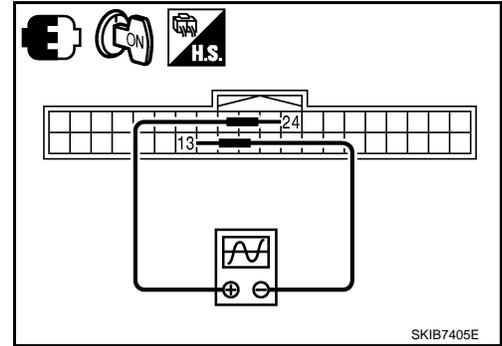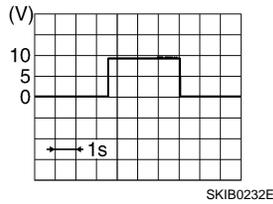

OK or NG

- OK >> Replace audio unit.
NG >> Replace NAVI control unit.

Vehicle Mark Is Not Displayed Properly

INFOID:000000004657415

Symptom: Vehicle mark is not displayed at the vehicle driving position properly.

1. NAVIGATION SYSTEM ADJUSTMENT

1. Select "Navigation" in Confirmation/Adjustment mode, and adjust items, "Steering Angle Adjustment" and "Speed Calibration". Refer to [AV-68, "Confirmation/Adjustment Mode"](#).
2. Check symptom with driving.

Is any malfunction observed?

- YES >> GO TO 2.
NO >> INSPECTION END

2. SELF-DIAGNOSIS

Start self-diagnosis, and check any malfunction related to GPS. Refer to [AV-66, "Self-Diagnosis Mode"](#).

Is any malfunction related to GPS observed?

- YES >> Repair malfunctioning part by diagnosis results.
NO >> GO TO 3.

3. CHECK VEHICLE SIGNAL

Select "Vehicle Signals" in Confirmation/Adjustment mode, and check the vehicle speed signal and reverse signal inputting to NAVI control unit. Refer to [AV-68, "Confirmation/Adjustment Mode"](#).

OK or NG

- OK >> Limit of position detection capacity.
NG >> • Check NAVI control unit vehicle speed signal circuit, and repair malfunctioning part.
• Check NAVI control unit reverse signal circuit, and repair malfunctioning part.

Example of Symptom Possible No Malfunction

INFOID:000000004657416

For Navigation System operation information, refer to Navigation System Owner's Manual.

BASIC OPERATIONS

Symptom	Possible cause	Possible solution
No image is displayed.	The brightness is at the lowest setting.	Adjust the brightness of the display.
	The display is turned off.	Press and hold the button to turn on the display.
No voice guidance is available. or The volume is too high or too low.	The volume is not set correctly, or it is turned off.	Adjust the volume of voice guidance.

NAVIGATION SYSTEM

< SERVICE INFORMATION >

Symptom	Possible cause	Possible solution
No map is displayed on the screen.	The DVD-ROM is not inserted, or it is inserted upside down.	Insert the DVD-ROM correctly.
	A screen other than map screen is displayed.	Press the "MAP" button.
	The pickup lens of the DVD unit is dirty.	The pickup lens can become dirty depending on how you use the vehicle. Contact a NISSAN dealer or qualified workshop for pickup lens cleaning.
The screen is too dim. The movement is slow.	The temperature in the interior of the vehicle is low.	Wait until the interior of the vehicle has warmed up.
Some pixels in the display are darker or brighter than others.	This condition is an inherent characteristic of liquid crystal displays.	This is not a malfunction.
Some menu items cannot be selected.	Some menu items become unavailable while the vehicle is driven.	Park the vehicle in a safe location, then operate the navigation system.

NOTE:

Locations stored in the Address Book and other memory functions may be lost if the vehicle's battery is disconnected or is discharged. If this occurs, service the vehicle's battery as necessary and re-enter the information in the Address Book.

VEHICLE MARKS

Symptom	Possible cause	Possible solution
Names of roads and locations differ between plan view and BIRD-VIEW™.	This is because the quantity of the displayed information is reduced so that the screen does not become difficult to read. There is also a chance that names of the roads or locations may be displayed several times, and the names appearing on the screen may be different because of a processing procedure.	This is not a malfunction.
The vehicle mark is not displayed in the correct position.	The vehicle was transported after the ignition switch was turned off, for example, by a ferry or car transporter.	Drive the vehicle for a while on a road where GPS signals can be received.
	The position and direction of the vehicle mark may be incorrect depending on the driving environments and the levels of positioning accuracy of the navigation system.	This is not a malfunction. Drive the vehicle for a while to automatically correct the position and direction of the vehicle mark.
When the vehicle is travelling on a new road, the vehicle mark is located on another road nearby.	The system automatically places the vehicle mark on the nearest available road, because the new road is not stored in the map data.	Updated road information will be included in the next version of the DVD-ROM.
The screen does not switch to the night screen even after turning on the headlights.	The daytime screen was set the last time the headlights were turned on.	Set the screen to the night screen mode using  button when you turn on the headlights.
The map does not scroll even when the vehicle is moving.	The current location map screen is not displayed.	Press the "MAP" button.
The vehicle mark is not displayed.	The current location map screen is not displayed.	Press the "MAP" button.
The GPS indicator on the screen remains gray.	GPS signals cannot be received depending on the vehicle location, such as in a parking garage, on a road that has numerous tall buildings, etc.	Drive on an open, straight road for a while.
	A sufficient amount of GPS satellites is not available.	Please wait for the satellites to move to locations available for your navigation system.

NAVIGATION SYSTEM

< SERVICE INFORMATION >

Symptom	Possible cause	Possible solution
The location of the vehicle mark is misaligned from the actual position.	When using tire chains or replacing the tires, speed calculations based on the speed sensor may be incorrect.	Drive the vehicle for a while [at approximately 30 km/h (19 MPH) for about 30 minutes] to automatically correct the vehicle's mark position. If this does not correct the vehicle mark position, contact a NISSAN dealer or qualified workshop.
	The map data has a mistake or is incomplete (the vehicle mark position is always misaligned in the same area).	Updated road information will be included in the next version of the DVD-ROM.

DVD-ROM

Symptom	Possible cause	Possible solution
The message "Error" appears.	The DVD-ROM is dirty or partially damaged.	Check the DVD-ROM and wipe it clean with a soft cloth.
		In you see any damage, replace the DVD-ROM.

ROUTE CALCULATION AND VISUAL GUIDANCE

Symptom	Possible cause	Possible solution
In the auto re-route calculation, waypoints are not included.	Waypoints that you have already passed are not included in the auto re-route calculation.	If you want to go to that waypoint again, you need to edit the route.
Route information is not displayed.	Route calculation has not yet been performed.	Set the destination and perform route calculation.
	You are not driving on the suggested route.	Drive on the suggested route.
	Route guidance is set to off.	Turn on the route guidance.
The auto re-route calculation (or detour calculation) suggests the same route as the one previously suggested.	Route calculations took priority conditions into consideration, but the same route was calculated.	This is not a malfunction.
A waypoint cannot be added.	Five waypoints are already set on the route, including the ones that you have already passed.	A maximum of 5 waypoints can be set on the route. If you want to go to 6 or more waypoints, perform route calculations several times, as necessary.
The suggested route is not displayed.	Roads near the destination cannot be calculated.	Reset the destination to a main or ordinary road, and recalculate the route.
	The starting point and destination are too close.	Set a more distant destination.
	The starting point and destination are too far away.	Divide your trip by selecting one or two intermediate destinations, and perform a global route calculation based on multiple route calculations.
	There are time restricted roads (day of week, time) near the current vehicle location or destination.	Set [Use Time Restricted Roads] to off.
The part of the route that you have already passed is deleted.	A route is managed by sections between waypoints. If you passed the first waypoint, the section between the starting point and the waypoint is deleted. (It may not be deleted depending on the area.)	This is not a malfunction.

NAVIGATION SYSTEM

< SERVICE INFORMATION >

Symptom	Possible cause	Possible solution
An indirect route is suggested.	If there are restrictions (such as one-way streets) on roads close to the starting point or destination, the system may suggest an indirect route.	Adjust the location of the starting point or destination.
	The system may suggest an indirect route because route calculation does not take into consideration some areas such as narrow streets (grey roads).	Reset the destination to a main or ordinary road, and recalculate the route.
The landmark information does not correspond to the actual information.	This may be caused by insufficient or incorrect data on the DVD-ROM.	Updated information will be included in the next version of the DVD-ROM.
The suggested route does not exactly connect with the starting point, waypoints, or destination.	There is no data for route calculation closer to these locations.	Set the starting point, waypoints and destination on a main road, and perform route calculation.

VOICE GUIDANCE


Symptom	Possible cause	Possible solution
Voice guidance is not available.	Voice guidance is only available at certain intersections marked with  . In some cases, voice guidance is not available even when the vehicle should make a turn.	This is not malfunction.
	The vehicle has deviated from the suggested route.	Go back to the suggested route or request route calculation again.
	Voice guidance is set to off.	Turn on the voice guidance.
	Route guidance is set to off.	Turn on the route guidance.
The guidance content does not correspond to the actual condition.	The content of voice guidance may vary, depending on the types of intersections where turns are made.	Follow all traffic rules and regulations.

Removal and Installation of NAVI Control Unit

INFOID:000000004657417

REMOVAL

1. Remove luggage floor finisher upper (front) (Coupe models), or luggage floor finisher upper (Roadster models). Refer to [EI-34. "Removal and Installation \(for Coupe Models\)"](#), or [EI-36. "Removal and Installation \(for Roadster Models\)"](#).
2. Remove screws (A), and remove NAVI control unit (1).
3. Remove NAVI control unit from bracket.

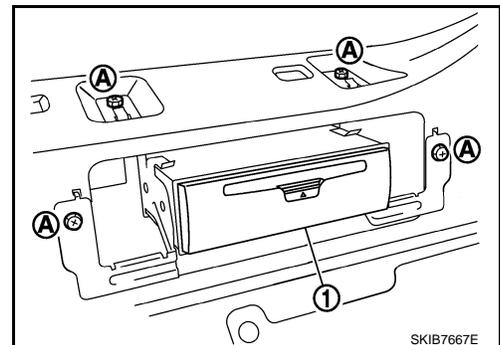

INSTALLATION

Installation is the reverse order of removal.

Removal and Installation of GPS Antenna

INFOID:000000004657418


REMOVAL

1. Remove instrument driver panel upper. Refer to [IP-12](#).

NAVIGATION SYSTEM

< SERVICE INFORMATION >

2. Remove screw (1), and remove GPS antenna.

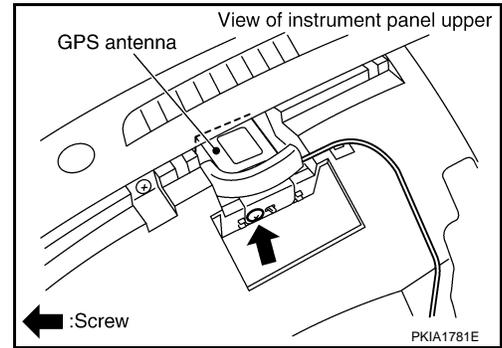

INSTALLATION


Installation is the reverse order of removal.

Removal and Installation of NAVI Switch


INFOID:000000004657419

REMOVAL

1. Insert cloth-covered driver into gaps between mask (1) and NAVI switch (2), and remove mask (1).

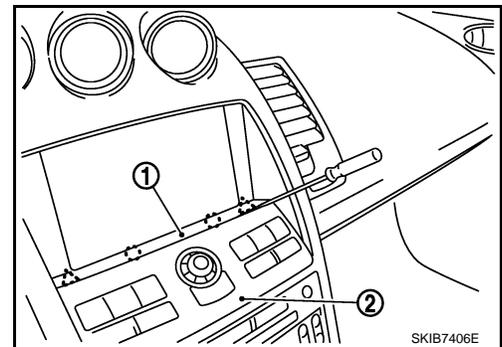

2. Remove screws (A), and remove NAVI switch (1).

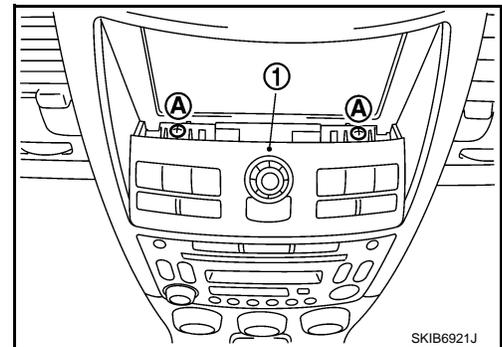

INSTALLATION

Installation is the reverse order of removal.

Removal and Installation of Display Unit

INFOID:000000004657420


REMOVAL

1. Remove cluster lid C. Refer to [IP-12](#).


NAVIGATION SYSTEM

< SERVICE INFORMATION >

2. Remove screws (2), and remove display unit.

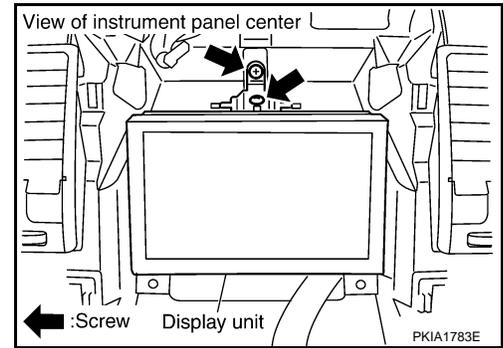

3. Remove screws (4), and remove bracket.

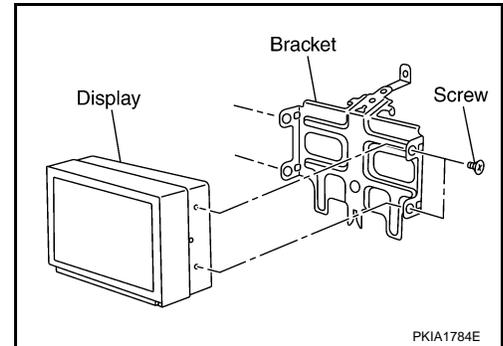

INSTALLATION

Installation is the reverse order of removal.

A
B
C
D
E
F
G
H
I
J
L
M
N
O
P

AV

TELEPHONE

< SERVICE INFORMATION >


TELEPHONE

System Description

INFOID:000000004657421

HANDS-FREE PHONE SYSTEM

- For Hands-free phone system operation information, refer to Owner's Manual.
- TEL adapter unit has Bluetooth® module. It can perform wireless hands-free telephone calls using a cellular phone in vehicle compartment.
- 5 or less cellular phones can be registered into the TEL adapter unit.
- Hands-free phone mode starts by transmitting steering switch signal to TEL adapter unit when pressing  button.
- Hands-free phone mode ends by transmitting steering switch signal to TEL adapter unit when pressing  button.
- When uttering to the TEL microphone, TEL microphone signal (audio signal) is transmitted from the TEL microphone to the TEL adapter unit and transmitted to the cellular phone with the Bluetooth® communication.
- Audio signals from a party at the other end are transmitted from the cellular phone to the TEL adapter unit with the Bluetooth® communication, and transmitted from the TEL adapter unit to the audio unit, then the party's voice is output from the front door speaker.
- Audio unit switches the voice from front speaker RH to TEL voice when receiving TEL ON signal from TEL adapter unit.

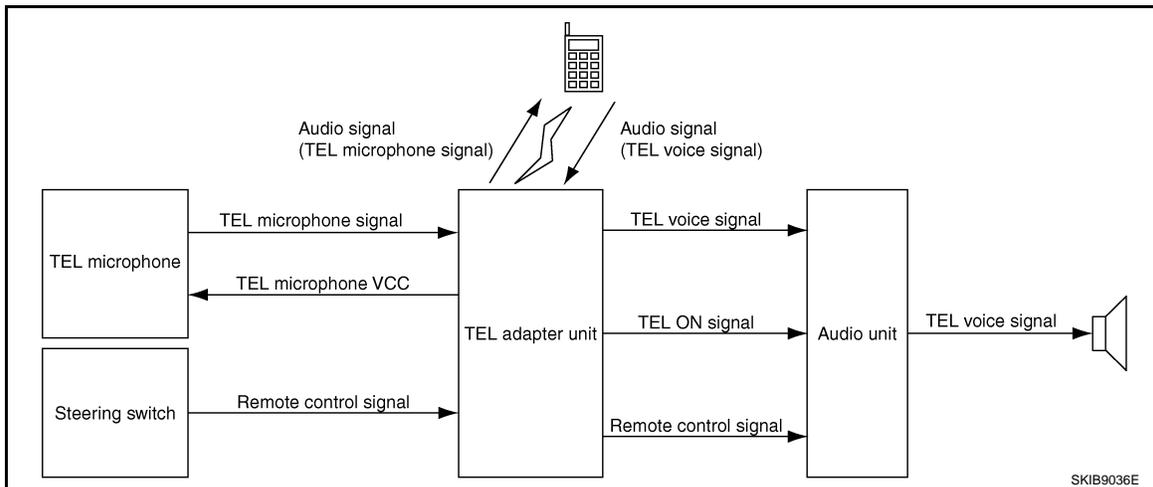


TELEPHONE

< SERVICE INFORMATION >

Component Parts Location

INFOID:000000004657422

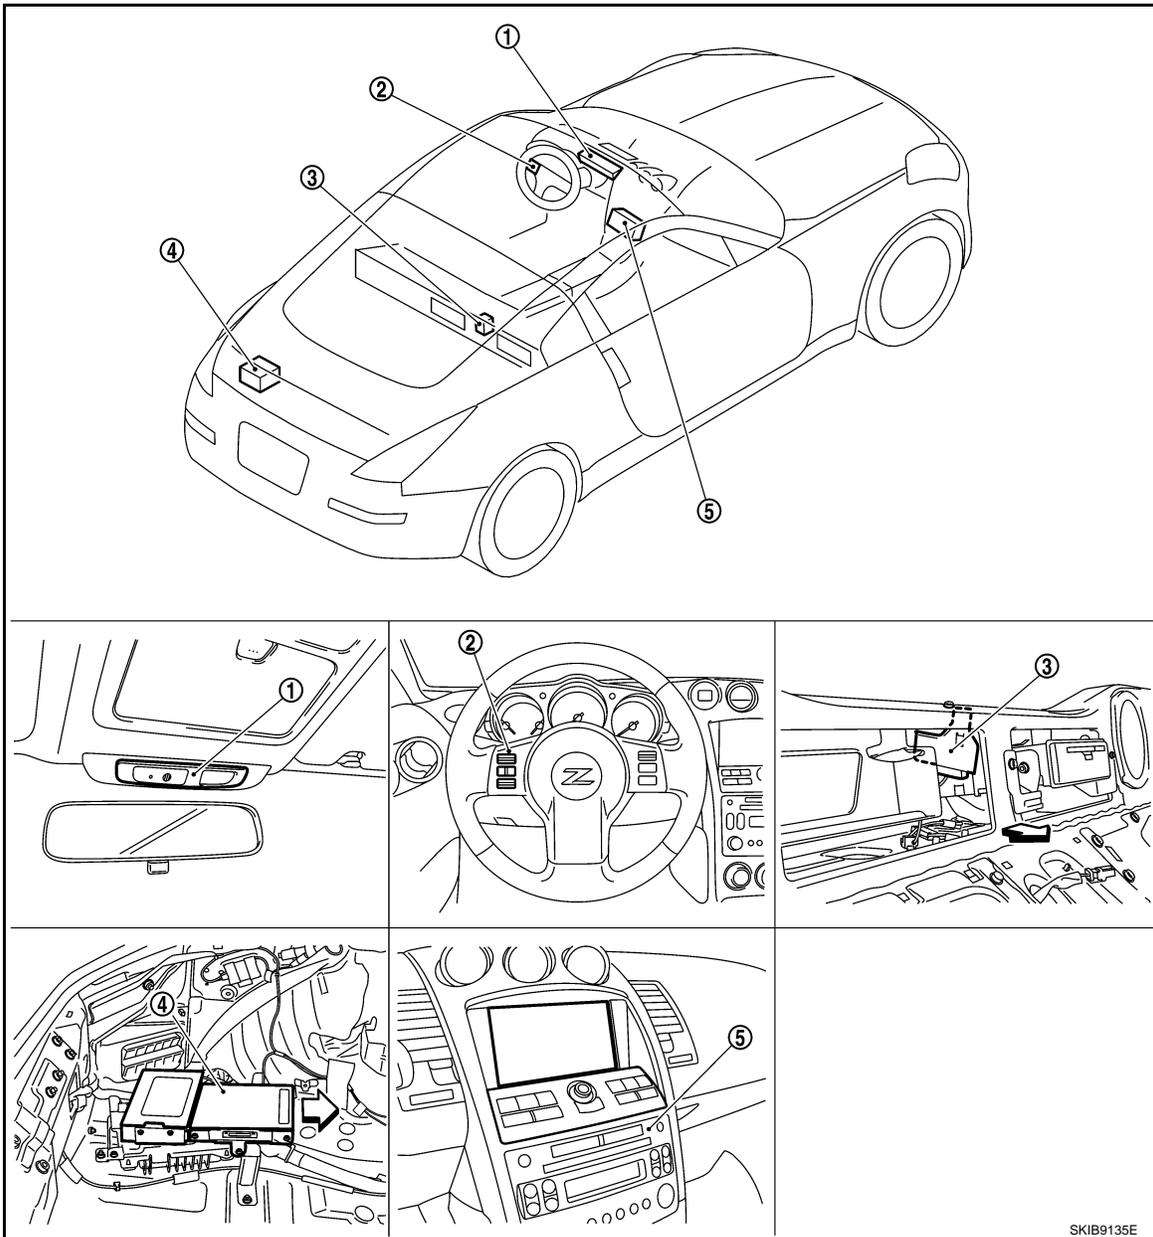

1. TEL microphone

2. Steering switch

3. TEL antenna

4. TEL adapter unit

5. Audio unit

← : Vehicle front


A
B
C
D
E
F
G
H
I
J
AV
L
M
N
O
P

TELEPHONE

< SERVICE INFORMATION >

Location of TEL Antenna

INFOID:000000004657423

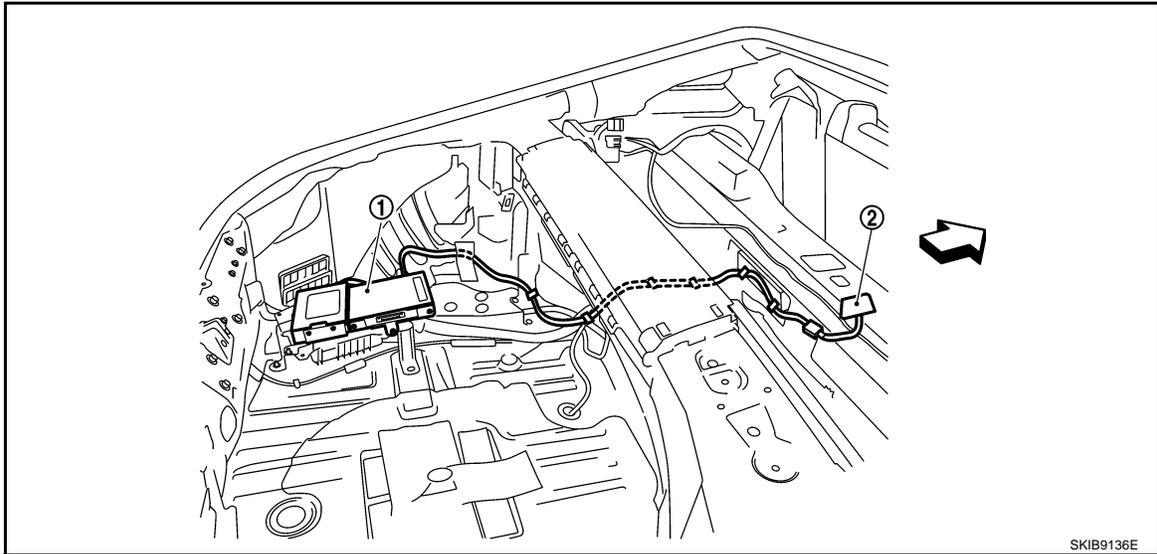

1. TEL adapter unit

2. TEL antenna


⇨ : Vehicle front

TELEPHONE

< SERVICE INFORMATION >

Schematic

INFOID:000000004657424

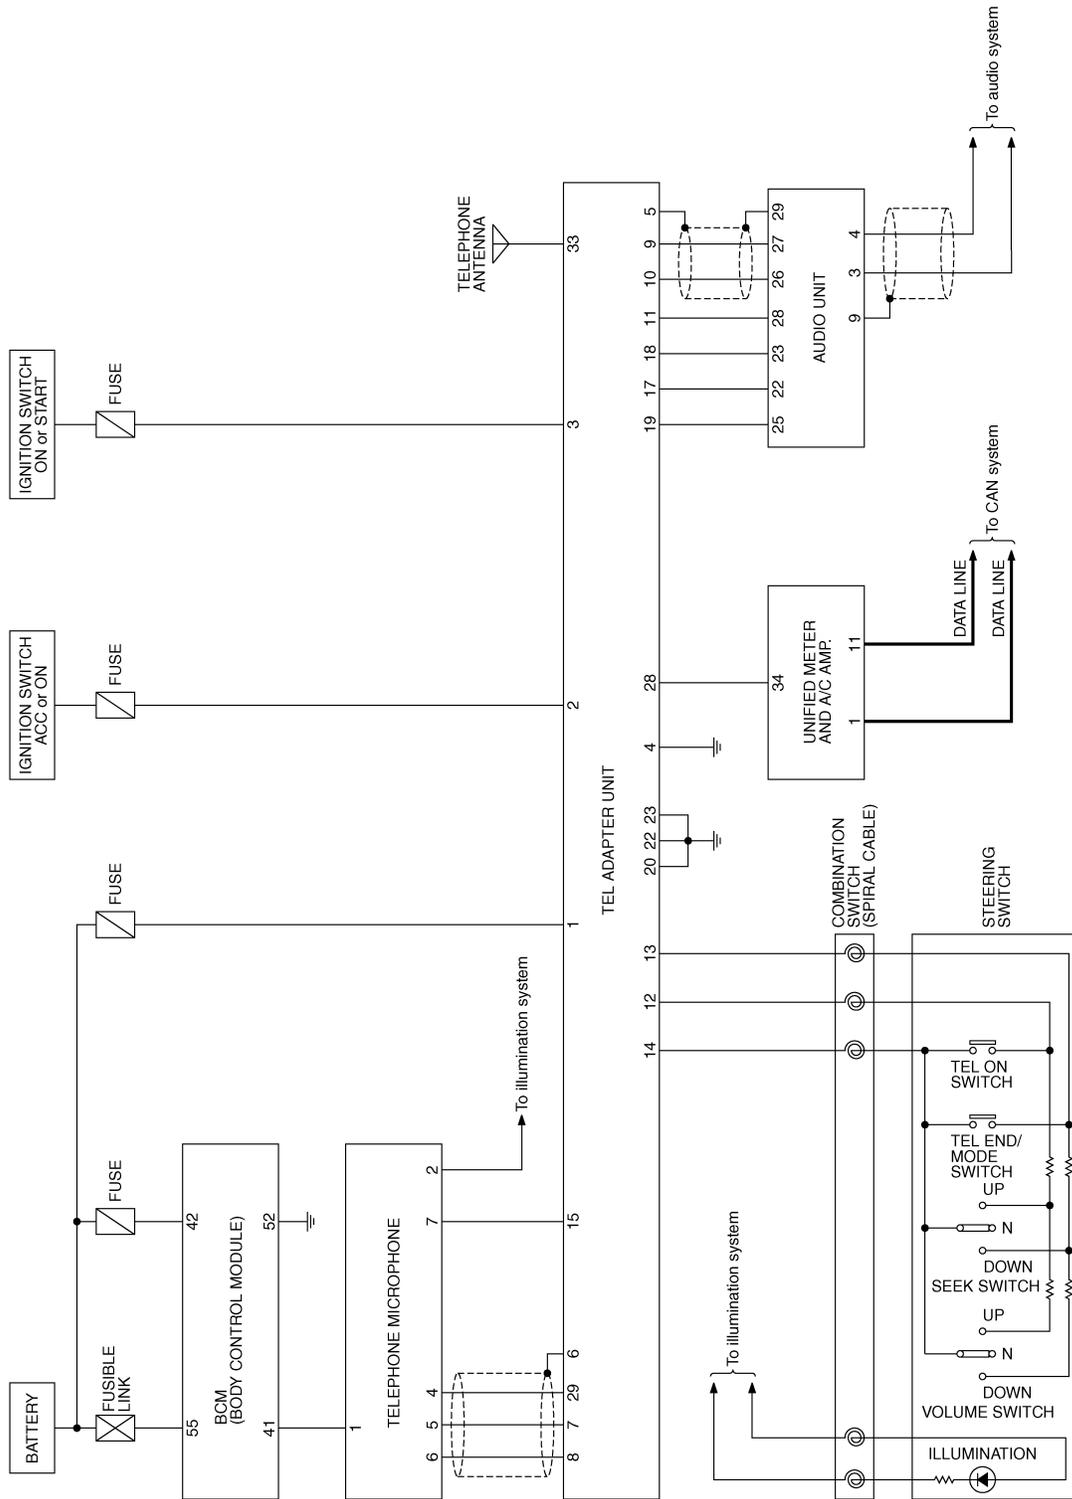

TKWT5806E

A
B
C
D
E
F
G
H
I
J
AV
L
M
N
O
P



TELEPHONE

< SERVICE INFORMATION >

Wiring Diagram - H/PHONE -

INFOID:000000004657425

AV-H/PHON-01

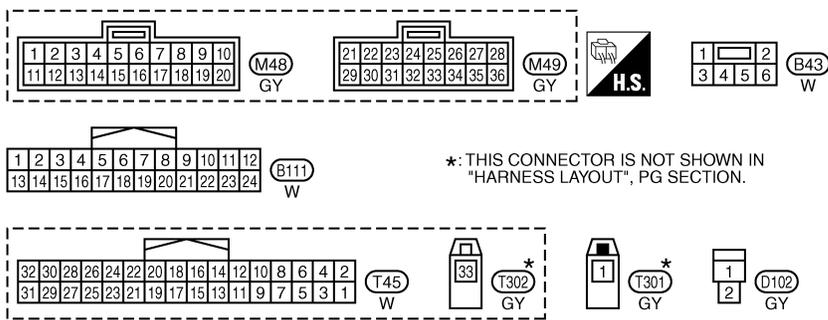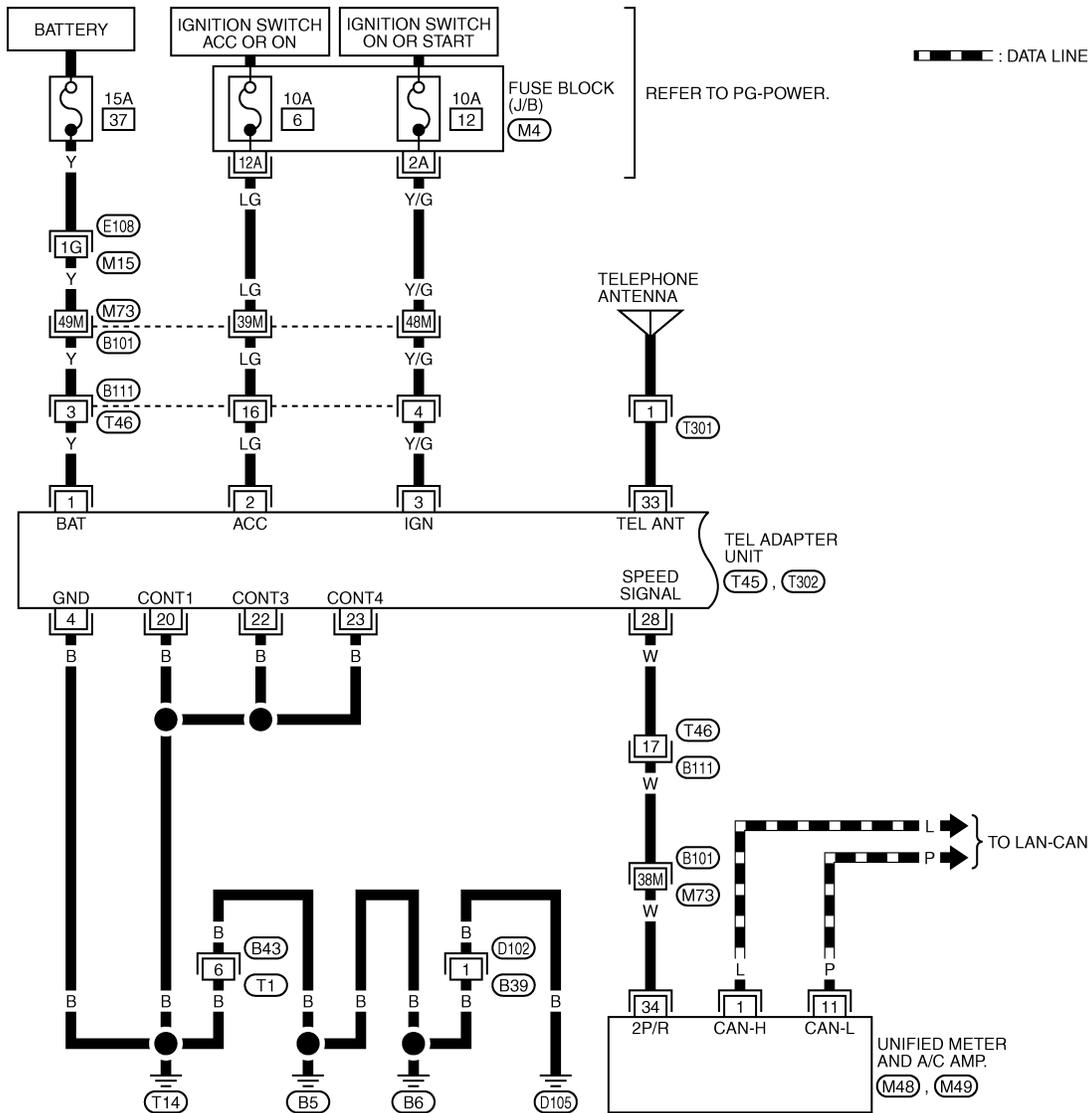

REFER TO THE FOLLOWING.
 (E108), (B101) -SUPER MULTIPLE JUNCTION (SMJ)
 (M4) -FUSE BLOCK-JUNCTION BOX (J/B)



*: THIS CONNECTOR IS NOT SHOWN IN "HARNESS LAYOUT", PG. SECTION.

TKWT5807E

TELEPHONE

< SERVICE INFORMATION >

 AV-H/PHON-02

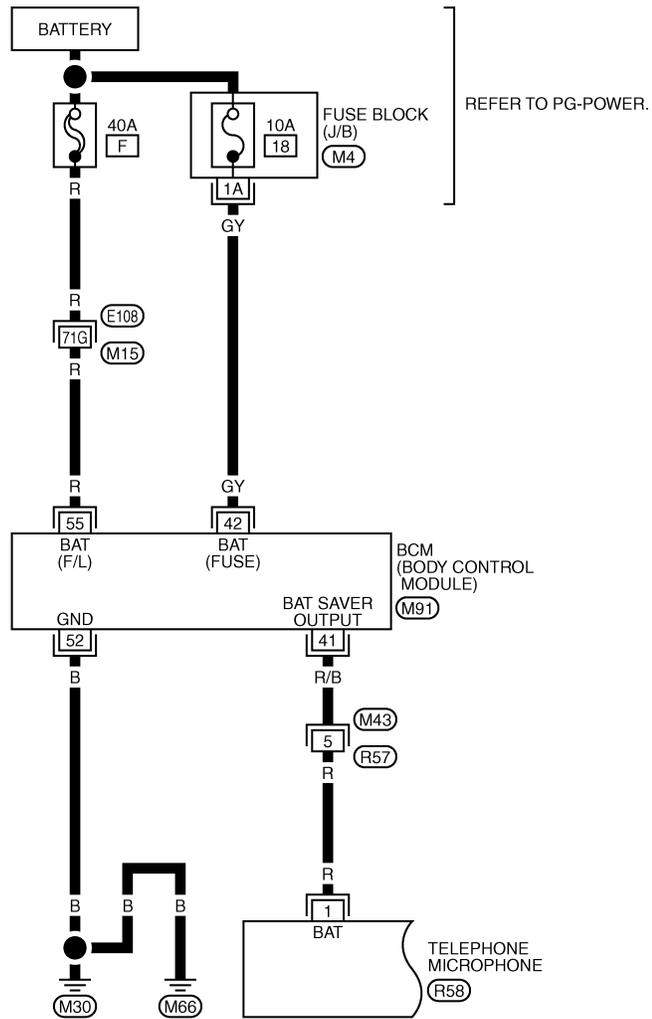

REFER TO THE FOLLOWING.
 (E108) -SUPER MULTIPLE JUNCTION (SMJ)
 (M4) -FUSE BLOCK-JUNCTION BOX (J/B)
 (M91) -ELECTRICAL UNITS

TKWT5551E

 

A
B
C
D
E
F
G
H
I
J
L
M
N
O
P

AV

TELEPHONE

< SERVICE INFORMATION >

AV-H/PHON-03

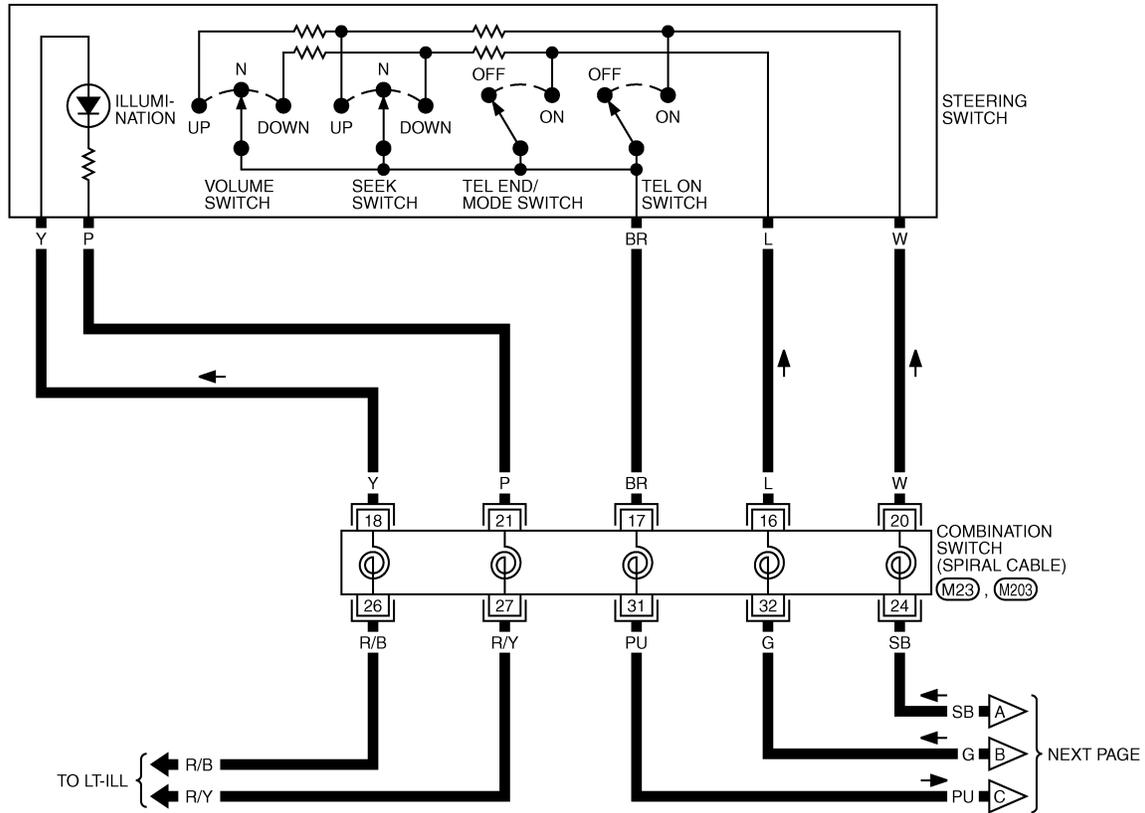




*: THIS CONNECTOR IS NOT SHOWN IN "HARNESS LAYOUT", PG SECTION.

TKWT5808E

TELEPHONE

< SERVICE INFORMATION >

  AV-H/PHON-04

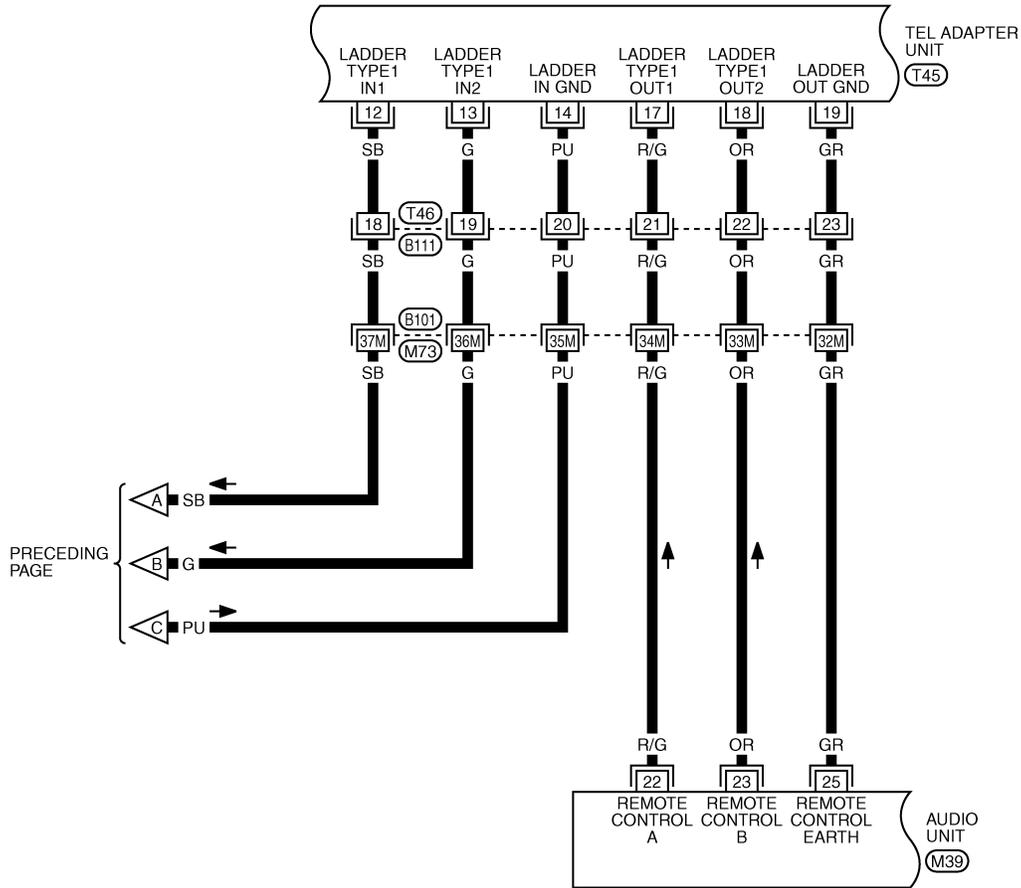

REFER TO THE FOLLOWING.
 (B101) -SUPER MULTIPLE
 JUNCTION (SMJ)

TKWT5553E



A
B
C
D
E
F
G
H
I
J
L
M
N
O
P

AV

TELEPHONE

< SERVICE INFORMATION >

AV-H/PHON-05

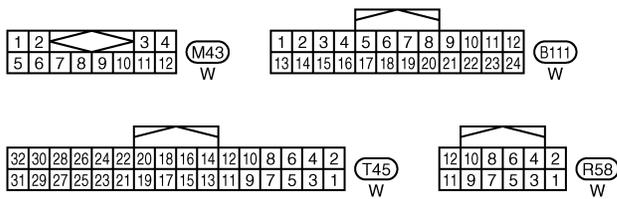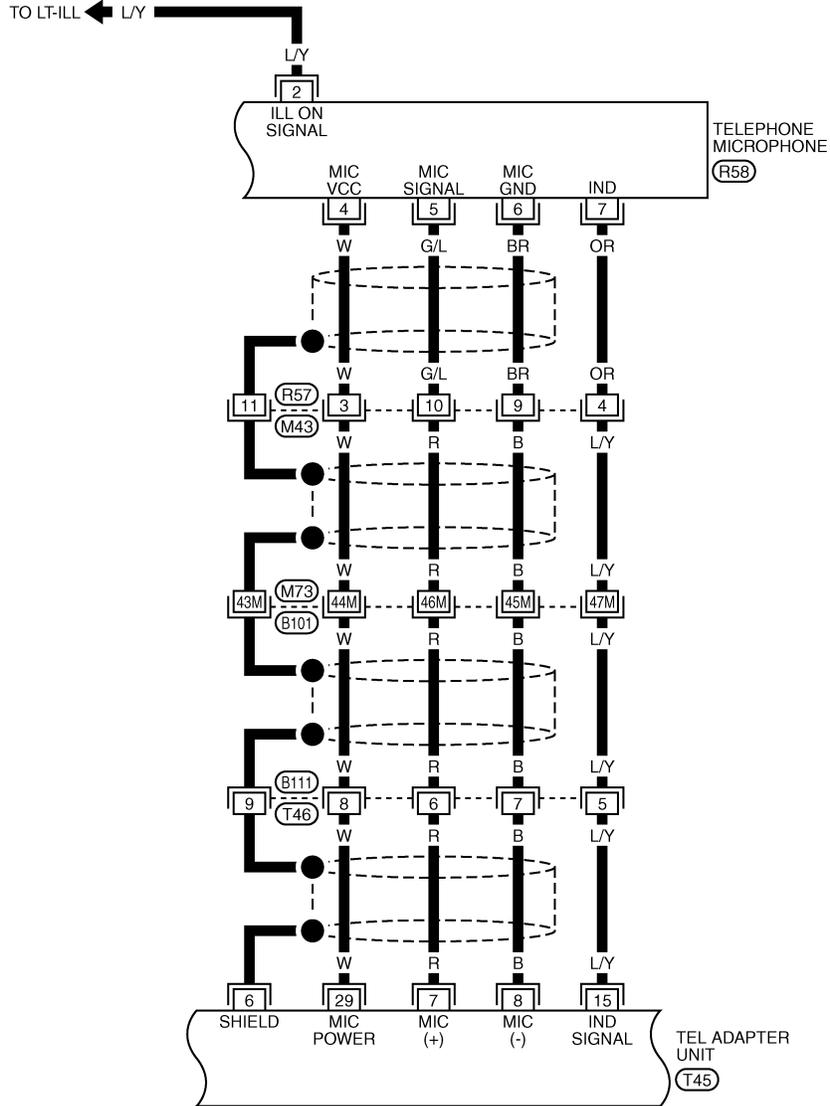





REFER TO THE FOLLOWING.
 (B101) -SUPER MULTIPLE JUNCTION (SMJ)

TKW75554E

TELEPHONE

< SERVICE INFORMATION >

   AV-H/PHON-06

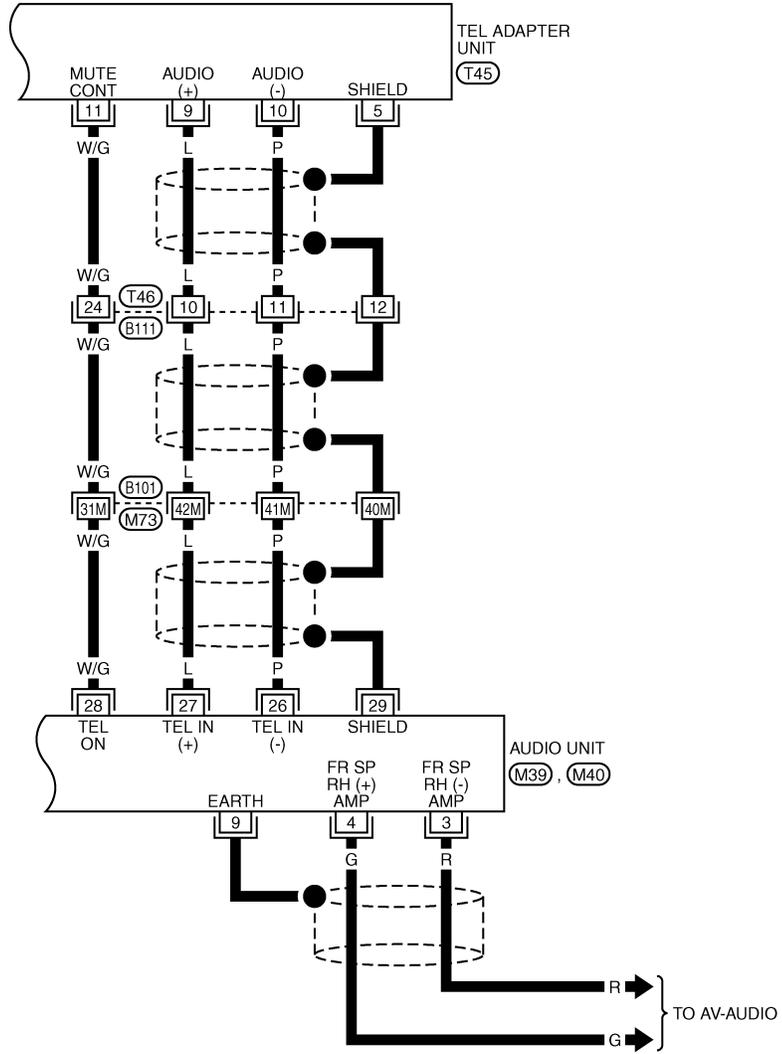

REFER TO THE FOLLOWING.
 (B101) -SUPER MULTIPLE JUNCTION (SMJ)

TKWT5809E

A
B
C
D
E
F
G
H
I
J
L
M
N
O
P



AV

TELEPHONE

< SERVICE INFORMATION >


Terminal and Reference Value for TEL Adapter Unit

INFOID:000000004657426

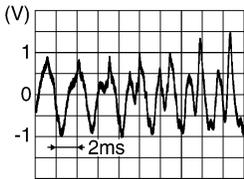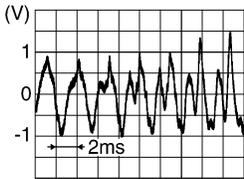Terminal (Wire color)		Item	Signal input/ output	Condition		Reference value
+	-			Ignition switch	Operation	
1 (Y)	Ground	Battery power supply	Input	OFF	—	Battery voltage
2 (LG)	Ground	ACC power supply	Input	ACC	—	Battery voltage
3 (Y/G)	Ground	Ignition signal	Input	ON	—	Battery voltage
4 (B)	Ground	Ground	—	ON	—	Approx. 0 V
5	—	Shield	—	—	—	—
6	—	Shield	—	—	—	—
7 (R)	8 (B)	TEL microphone signal	Input	ON	Uttering in front of the microphone while using the hands-free phone system.	 SKIB3609E
9 (L)	10 (P)	TEL voice signal	Output	ON	Receiving the party's voice while using the hands-free phone system.	 SKIB3609E
11 (W/G)	Ground	TEL ON signal	Output	ON	While using hands-free phone system	Approx. 0 V
					Except while using hands-free phone system	Approx. 5 V
12 (SB)	14 (PU)	Remote control signal A	Input	ON	Press and hold  switch	Approx. 0 V
					Press and hold SEEK UP switch	Approx. 1.7 V
					Press and hold VOLUME UP switch	Approx. 3.3 V
					Except for above	Approx. 5 V
13 (G)	14 (PU)	Remote control signal B	Input	ON	Press and hold  switch	Approx. 0 V
					Press and hold SEEK DOWN switch	Approx. 1.7 V
					Press and hold VOLUME DOWN switch	Approx. 3.3 V
					Except for above	Approx. 5 V
14 (PU)	Ground	Remote control signal ground	—	ON	—	Approx. 0 V
15 (L/Y)	Ground	Indicator signal	Output	ON	Microphone indicator ON	Approx. 1 V
					Microphone indicator OFF	Approx. 10 V

TELEPHONE

< SERVICE INFORMATION >

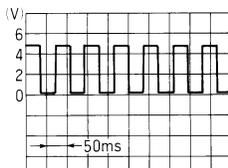Terminal (Wire color)		Item	Signal input/ output	Condition		Reference value
+	-			Ignition switch	Operation	
17 (R/G)	19 (GR)	Remote control signal A	Output	ON	Press and hold SEEK UP switch	Approx. 1.7 V
					Press and hold VOLUME UP switch	Approx. 3.3 V
					Except for above	Approx. 5 V
18 (OR)	19 (GR)	Remote control signal B	Output	ON	Press and hold  switch	Approx. 0 V (Audio mode) Approx. 5 V (TEL mode)
					Press and hold SEEK DOWN switch	Approx. 1.7 V
					Press and hold VOLUME DOWN switch	Approx. 3.3 V
					Except for above	Approx. 5 V
19 (GR)	Ground	Remote control signal ground	—	ON	—	Approx. 0 V
20 (B)	Ground	Control signal 1	—	ON	—	Approx. 0 V
22 (B)	Ground	Control signal 3	—	ON	—	Approx. 0 V
23 (B)	Ground	Control signal 4	—	ON	—	Approx. 0 V
28 (W)	Ground	Vehicle speed signal (2-pulse)	Input	ON	When vehicle speed is ap- prox. 40 km/h (25 MPH)	NOTE: Maximum voltage may be 12 V due to specifications (connected units).  ELF1080D
29 (W)	Ground	TEL Microphone VCC	Output	ON	—	Approx. 5 V
33	—	TEL antenna signal	Input	ON	Not connected to Blue- tooth® antenna connector	Approx. 3 V

Self-Diagnosis Function

INFOID:000000004657427

- During on board diagnosis the diagnosis function of TEL adapter unit starts with the operation of the steering switch and performs the diagnosis when ignition switch ACC.
- The on board diagnosis has 3 modes: the self-diagnosis mode that performs the trouble diagnosis, the speaker adaptation data deleting mode and the hands free phone system initialization mode.

NOTE:


- Perform the diagnosis with the vehicle stopped.
- Perform STEP 2 if necessary.

STEP	Mode	Contents
STEP 1	Self-diagnosis	The self-diagnosis mode perform the following. <ul style="list-style-type: none"> • Diagnosis of TEL adapter unit, Bluetooth antenna and steering switch. • Vehicle speed pulse count. • Microphone test. Then reads out the results with the sound.
STEP 2	Speaker adaptation data deleting	The speaker adaptation data deleting mode can delete the speaker adapta- tion data.
	Hands free phone system initialization	Hands free phone system initialization mode can perform the initialization of hands free phone system.

TELEPHONE

< SERVICE INFORMATION >

Diagnosis Function Operation Procedure

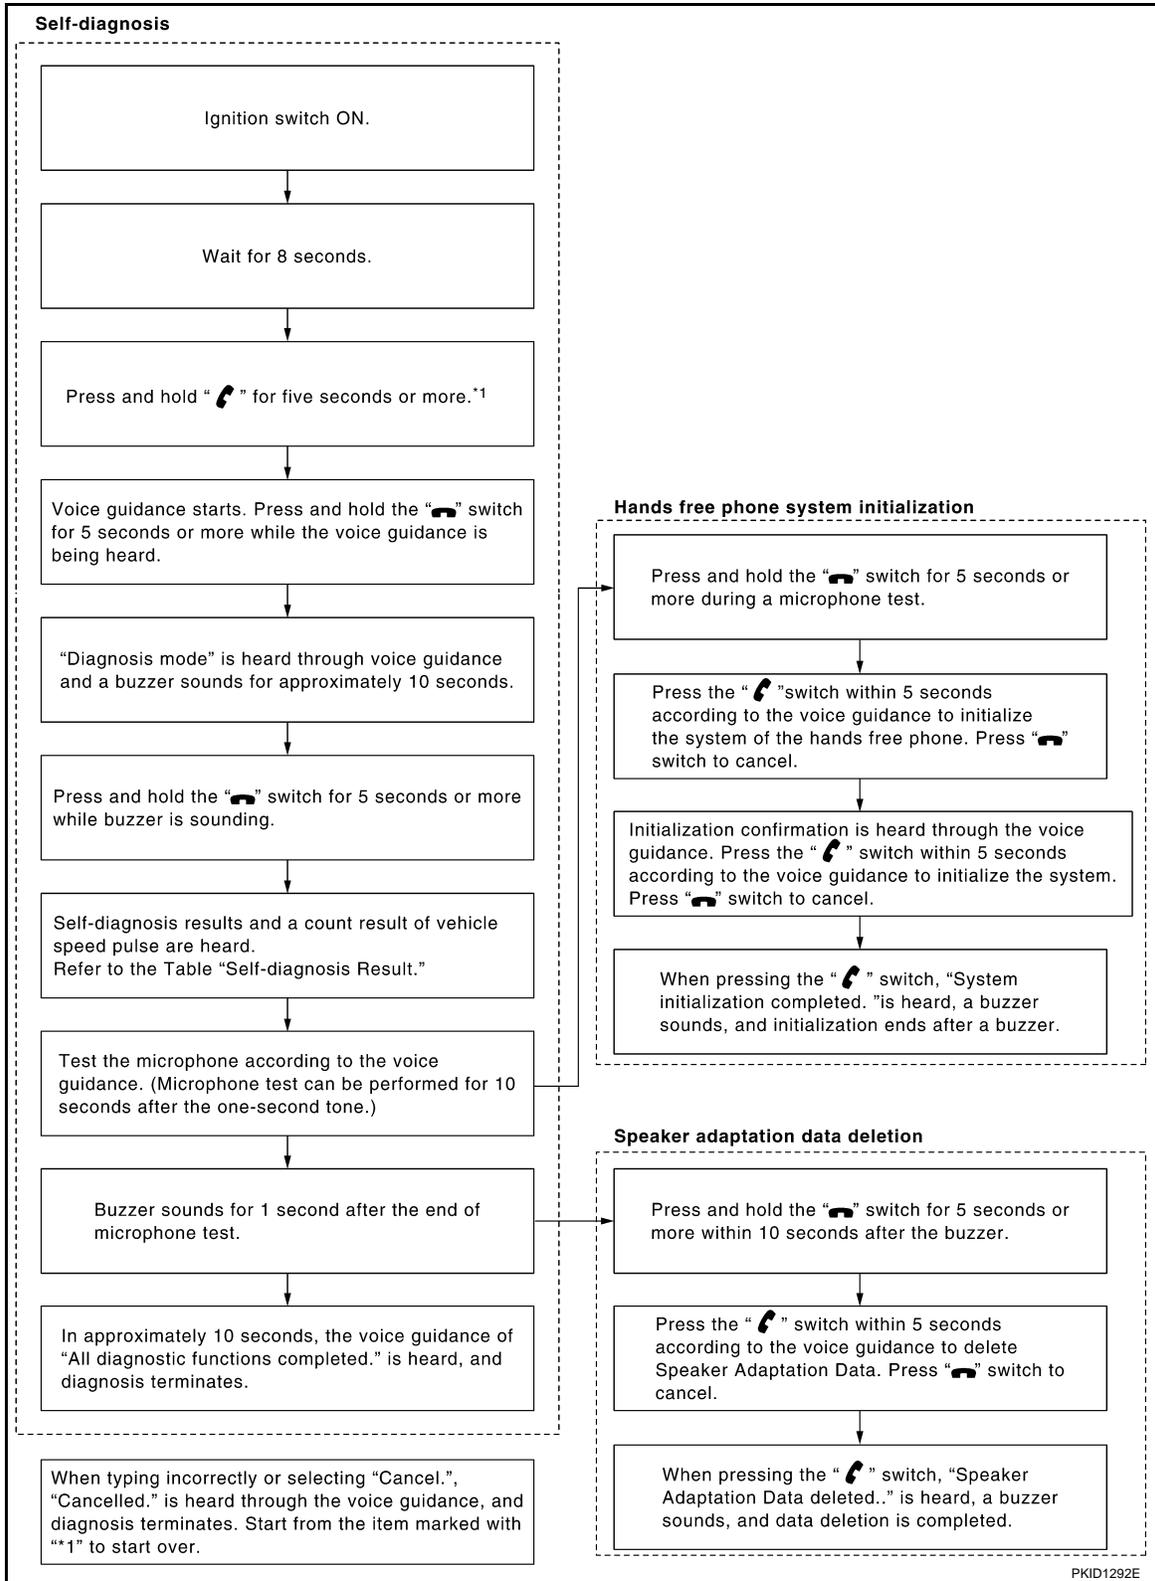

Error Item (Error Name)

Error name	Detection condition	Trouble-shooting method
There are no failure records to report	System is normal	—
Internal error	Error inside TEL adapter unit	Replace TEL adapter unit.

TELEPHONE

< SERVICE INFORMATION >

Error name	Detection condition	Trouble-shooting method
Bluetooth® antenna open	Open in the Bluetooth® antenna is detected	Check the Bluetooth® antenna feeder for open.
Bluetooth® antenna short	Short in the Bluetooth® antenna is detected	Check the Bluetooth® antenna feeder for short.
Bluetooth® antenna unplugged	Disconnected Bluetooth® antenna	Check the connection Bluetooth® antenna.
Phone button stuck	Stuck  switch	Check the steering switch.
Phone end button stuck	Stuck  switch	Refer to AV-102. "Component Inspection" .

Error Count

- Error count is read out simultaneously when reading out the error name.
- The errors are read out continuously when some errors occur at the same time.
- The error count guides "0" when the error occurs. The next time it counts up "1" if it is normal with the ignition switch ON.
- It continues the count up unless the initialization of hands free phone system is performed.

VEHICLE SPEED SIGNAL

- Check the input status of the vehicle speed pulse count after ignition switch turns ON.
- The guidance announces the type of error name and then the vehicle speed pulse count.

MICROPHONE TEST

Input the voice spoken into the microphone to the speaker, and checks the microphone function.

A
B
C
D
E
F
G
H
I
J
L
M
N
O
P

AV

TELEPHONE

< SERVICE INFORMATION >

Symptom Chart

INFOID:000000004657428

Indicator status	Symptom	Check item	Diagnosis procedure
ON (Normal)	Voice is not heard on the other end.	—	<ul style="list-style-type: none"> Check the TEL microphone signal circuit between TEL adapter unit to the TEL microphone. Check the TEL microphone power supply circuit between TEL adapter unit to the microphone.
	Voice guidance does not activate, or the volume of voice guidance is too low when pressing  switch. ("PHONE" is indicated on LCD screen of the audio unit)	—	Check TEL voice signal circuit between TEL adapter unit to the audio unit.
	Voice guidance does not activate, when pressing  switch. ("PHONE" is not indicated on LCD screen of the audio unit)	Dial the cellular phone. The front speaker RH outputs a dial tone.	<ol style="list-style-type: none"> Check "VOLUME UP" and "SEEK UP" switches function. Replace steering switch, if "VOLUME UP" and "SEEK UP" switches function is normal. If not, go to 3. Check if remote control signal A circuit between steering switch and TEL adapter unit is not open or short. Check voltage of remote control signal A between steering switch and TEL adapter unit when operating steering switch.
	None of the steering switch operations work.	Dial the cellular phone. The front speaker RH does not outputs a dial tone.	<ol style="list-style-type: none"> Check TEL ON signal circuit. Go to the next step if normal. Disconnect TEL adapter unit connector. Measure audio unit #28 terminal voltage. Replace TEL adapter unit if the voltage approx. 5 V. Replace audio unit if the voltage approx. 0 V.
OFF	Bluetooth® communication does not perform.	The indicator blinks for approx. 5 sec. when pressing  switch.	Perform the error history mode with self-diagnosis. Refer to AV-99, "Self-Diagnosis Function" .
		The indicator continue turning OFF when pressing  switch.	Check TEL adapter unit power supply, and ground circuit.

Component Inspection

INFOID:000000004657429


STEERING SWITCH

20 – 17

-  switch ON : Approx. 0 Ω
- "SEEK UP" switch ON : Approx. 165 Ω
- "VOLUME UP" switch ON : Approx. 652 Ω

16 – 17

-  switch ON : Approx. 0 Ω
- "SEEK DOWN" switch ON : Approx. 165 Ω
- "VOLUME DOWN" switch ON : Approx. 652 Ω

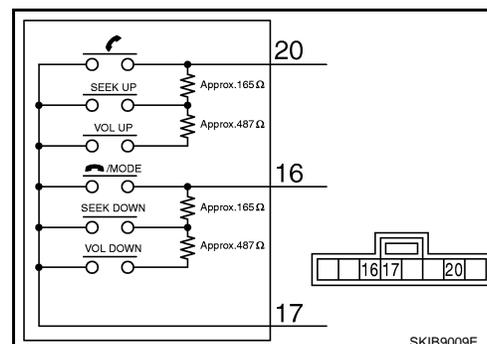

SKIB9009E

TELEPHONE


< SERVICE INFORMATION >

Removal and Installation of Telephone Microphone

INFOID:000000004657430

REMOVAL

1. Remove headlining. Refer to [EI-39, "Removal and Installation \(for Coupe Models\)"](#).
2. Remove mount pin (A), and remove telephone microphone(1).

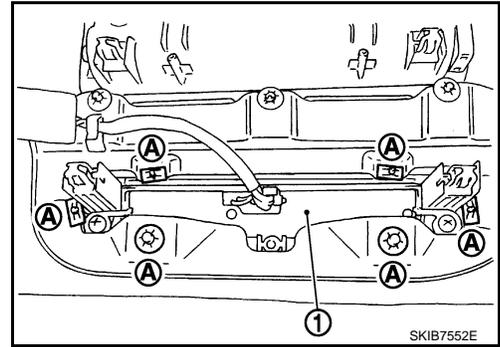

INSTALLATION

Installation is the reverse order of removal.

A
B
C
D
E
F
G
H
I
J
L
M
N
O
P

AV